

ENOriginal Instructions
Version 2 - August 2025

230V

PLASMA CUTTER

92454



These instructions accompanying the product are the original instructions. This document is part of the product, keep it for the life of the product passing it on to any subsequent holder of the product. Read all these instructions before assembling, operating or maintaining this product.

This manual has been compiled by Draper Tools describing the purpose for which the product has been designed, and contains all the necessary information to ensure its correct and safe use. By following all the general safety instructions contained in this manual, it will ensure both product and operator safety, together with longer life of the product itself.

All photographs and drawings in this manual are supplied by Draper Tools to help illustrate the operation of the product.

Whilst every effort has been made to ensure the accuracy of information contained in this manual, the Draper Tools policy of continuous improvement determines the right to make modifications without prior warning.

1. TITLE PAGE

1.1 INTRODUCTION:

USER MANUAL FOR: 230V Plasma Cutter

Stock No: 92454

Part No: IPC25

1.2 REVISIONS:

Date first published August 2019.

Version 2 - August 2025.

As our user manuals are continually updated, users should make sure that they use the very latest version.

Downloads are available from: <http://drapertools.com/manuals>

Draper Tools Limited
Hursley Road
Chandler's Ford
Eastleigh
Hampshire
SO53 1YF
UK

Draper Tools Europe B.V.
Oude Graaf 8
6002 NL
Weert
Netherlands

Website: drapertools.com

Product Helpline: +44 (0) 23 8049 4344

General Fax: +44 (0) 23 8026 0784

1.3 UNDERSTANDING THIS MANUALS SAFETY CONTENT:

WARNING! – Information that draws attention to the risk of injury or death.

CAUTION! – Information that draws attention to the risk of damage to the product or surroundings.

1.4 COPYRIGHT © NOTICE:

Copyright © Draper Tools Limited.

Permission is granted to reproduce this publication for personal and educational use only. Commercial copying, redistribution, hiring or lending is prohibited.

No part of this publication may be stored in a retrieval system or transmitted in any other form or means without written permission from Draper Tools Limited.

In all cases this copyright notice must remain intact.

2. CONTENTS

1	TITLE PAGE	
1.1	INTRODUCTION	2
1.2	REVISION HISTORY	2
1.3	UNDERSTANDING THIS MANUAL	2
1.4	COPYRIGHT NOTICE	2
2	CONTENTS	
2.1	CONTENTS	3
3.	WARRANTY	
3.1	WARRANTY	4
4.	INTRODUCTION	
4.1	SCOPE	5
4.2	SPECIFICATION	5
4.3	HANDLING AND STORAGE	5
5.	HEALTH AND SAFETY INFORMATION	
5.1	GENERAL POWER TOOL SAFETY WARNINGS	6-7
5.2	ADDITIONAL SAFETY INSTRUCTIONS FOR CUTTING	7-10
5.3	CONNECTION TO THE POWER SUPPLY	10
6.	TECHNICAL DESCRIPTION	
6.1	IDENTIFICATION	11
7.	UNPACKING AND CHECKING	
7.1	PACKAGING	12
7.2	WHAT'S IN THE BOX	12
8.	PREPARING THE PLASMA CUTTER	
8.1	GENERAL	13
8.2	CONTROLS & INDICATORS	14
8.3	WORK PIECE AND WORK AREA SET UP	14
8.4	ATTACH AIR HOSE TO BACK OF UNIT	14
8.5	ATTACH EARTH CLAMP	15
8.6	ATTACH TORCH	15
9.	BASIC PLASMA CUTTER OPERATIONS	
9.1	TORCH ASSEMBLY	16
9.2	OPERATING INSTRUCTIONS	17
10.	MAINTENANCE	18
11.	TROUBLESHOOTING	
11.1	TROUBLESHOOTING	19-20
12.	OPTIONAL ACCESSORIES	
12.1	OPTIONAL ACCESSORIES	21
13.	DISPOSAL	
13.1	DISPOSAL	22
14.	EXPLANATION OF SYMBOLS	
14.1	EXPLANATION OF SYMBOLS	23
	DECLARATION OF CONFORMITY	ENCLOSED

3. WARRANTY

3.1 WARRANTY

Draper tools have been carefully tested and inspected before shipment and are guaranteed to be free from defective materials and workmanship.

Should the tool develop a fault, please return the complete tool to your nearest distributor or contact

Draper Tools Limited, Chandler's Ford, Eastleigh, Hampshire, SO53 1YF. England.

Telephone Sales Desk: (023) 8049 4333 or Product Help Line (023) 8049 4344.

A proof of purchase **must** be provided with the tool.

If upon inspection it is found that the fault occurring is due to defective materials or workmanship, repairs will be carried out free of charge. This warranty period covering parts and labour is 12 months from the date of purchase except where tools are hired out when the warranty period is 90 days from the date of purchase. This warranty does not apply to any consumable parts, any type of battery or normal wear and tear, nor does it cover any damage caused by misuse, careless or unsafe handling, alterations, accidents, or repairs attempted or made by any personnel other than the authorised Draper warranty repair agent.

Note: If the tool is found not to be within the terms of warranty, repairs and carriage charges will be quoted and made accordingly.

This warranty applies in lieu of any other warranty expressed or implied and variations of its terms are not authorised.

Your Draper warranty is not effective unless you can produce upon request a dated receipt or invoice to verify your proof of purchase within the warranty period.

Please note that this warranty is an additional benefit and does not affect your statutory rights.

Draper Tools Limited.

4. INTRODUCTION

4.1 SCOPE

This Plasma cutting machine is designed with advanced inverter technology, which produces a stable current while reducing the weight and volume of the overall machine. This machine is suitable for the cutting of ferrous metals up to and including 8mm thickness. Any other application is considered misuse.

4.2 SPECIFICATION

Stock no.	92454
Part no.	IPC25
Input:	
Voltage†	230V~
Phase	1
Frequency	50/60Hz
Rated Current Range	10-25A
Main fuse†	13A
Air pressure	43.5psi (3bar)
Cutting thickness max.	
Clean cut	5mm
Severance	8mm
Duty cycle	25%@25A, 60%@16A, 100%@12.5A
Efficiency	70%
Insulation class	S
Degree of ingress Protection rating	IP21S
Weight	8.9kg

4.3 HANDLING AND STORAGE

- Care must be taken when handling this product.
 - Dropping this power tool could have an effect on its accuracy and could also result in personal injury. This product is not a toy and must be respected.
- Environmental conditions can have a detrimental effect on this product if neglected.
 - Exposure to damp air can gradually corrode components.
 - If the product is unprotected from dust and debris, components will become clogged.
 - If not cleaned and maintained correctly or regularly, the machine will not perform at its best.

5. HEALTH AND SAFETY INFORMATION

5.1 GENERAL POWER TOOL SAFETY WARNINGS

WARNING Read all safety warnings, instructions, illustrations and specifications provided with this power tool. *Failure to follow all instructions listed below may result in electric shock, fire and/or serious injury.*

Save all warnings and instructions for future reference.

The term "power tool" in the warnings refers to your mains-operated (corded) power tool or battery-operated (cordless) power tool.

Work area safety

Keep work area clean and well lit. *Cluttered or dark areas invite accidents.*

Do not operate power tools in explosive atmospheres, such as in the presence of flammable liquids, gases or dust. *Power tools create sparks which may ignite the dust or fumes.*
Keep children and bystanders away while operating a power tool. *Distractions can cause you to lose control.*

Electrical safety

Power tool plugs must match the outlet. Never modify the plug in any way. Do not use any adapter plugs with earthed (grounded) power tools. *Unmodified plugs and matching outlets will reduce risk of electric shock.*

Avoid body contact with earthed or grounded surfaces, such as pipes, radiators, ranges and refrigerators. *There is an increased risk of electric shock if your body is earthed or grounded.*
Do not expose power tools to rain or wet conditions. *Water entering a power tool will increase the risk of electric shock.*

Do not abuse the cord. Never use the cord for carrying, pulling or unplugging the power tool. Keep cord away from heat, oil, sharp edges or moving parts. *Damaged or entangled cords increase the risk of electric shock.*

When operating a power tool outdoors, use an extension cord suitable for outdoor use. *Use of a cord suitable for outdoor use reduces the risk of electric shock.*

If operating a power tool in a damp location is unavoidable, use a residual current device (RCD) protected supply. *Use of an RCD reduces the risk of electric shock.*

Personal safety

Stay alert, watch what you are doing and use common sense when operating a power tool. Do not use a power tool while you are tired or under the influence of drugs, alcohol or medication. *A moment of inattention while operating power tools may result in serious personal injury.*

Use personal protective equipment. Always wear eye protection. *Protective equipment such as a dust mask, non-skid safety shoes, hard hat or hearing protection used for appropriate conditions will reduce personal injuries.*

Prevent unintentional starting. Ensure the switch is in the off-position before connecting to power source and/or battery pack, picking up or carrying the tool. *Carrying power tools with your finger on the switch or energising power tools that have the switch on invites accidents.*

Remove any adjusting key or wrench before turning the power tool on. *A wrench or a key left attached to a rotating part of the power tool may result in personal injury.*

Do not overreach. Keep proper footing and balance at all times. *This enables better control of the power tool in unexpected situations.*

Dress properly. Do not wear loose clothing or jewellery. Keep your hair and clothing away from moving parts. *Loose clothes, jewellery or long hair can be caught in moving parts.*

If devices are provided for the connection of dust extraction and collection facilities, ensure these are connected and properly used. *Use of dust collection can reduce dust-related hazards.*
Do not let familiarity gained from frequent use of tools allow you to become complacent and ignore tool safety principles. *A careless action can cause severe injury within a fraction of a second.*

5. HEALTH AND SAFETY INFORMATION

Power tool use and care

Do not force the power tool. Use the correct power tool for your application. *The correct power tool will do the job better and safer at the rate for which it was designed.*

Do not use the power tool if the switch does not turn it on and off. *Any power tool that cannot be controlled with the switch is dangerous and must be repaired.*

Disconnect the plug from the power source and/or remove the battery pack, if detachable, from the power tool before making any adjustments, changing accessories, or storing power tools. *Such preventive safety measures reduce the risk of starting the power tool accidentally.*

Store idle power tools out of the reach of children and do not allow persons unfamiliar with the power tool or these instructions to operate the power tool. *Power tools are dangerous in the hands of untrained users.*

Maintain power tools and accessories. Check for misalignment or binding of moving parts, breakage of parts and any other condition that may affect the power tool's operation. If damaged, have the power tool repaired before use. *Many accidents are caused by poorly maintained power tools.*

Keep cutting tools sharp and clean. *Properly maintained cutting tools with sharp cutting edges are less likely to bind and are easier to control.*

Use the power tool, accessories and tool bits etc. in accordance with these instructions, taking into account the working conditions and the work to be performed. *Use of the power tool for operations different from those intended could result in a hazardous situation.*

Keep handles and grasping surfaces dry, clean and free from oil and grease. *Slippery handles and grasping surfaces do not allow for safe handling and control of the tool in unexpected situations.*

Service

Have your power tool serviced by a qualified repair person using only identical replacement parts. *This will ensure that the safety of the power tool is maintained.*

5.2 ADDITIONAL SAFETY INSTRUCTIONS FOR CUTTING

Warning: When using electric tools basic safety precautions should always be followed to reduce the risk of fire, electric shock and personal injury including the following.

Read all these instructions before attempting to operate this product and save these instructions.

ELECTRIC SHOCK CAN KILL:

- Remove the plug from the socket before carrying out adjustment, servicing or maintenance.
- Allow 5 minutes waiting time for the capacitors to discharge before removing the panels for any maintenance operations
- Do not touch live electrical parts.
- Never use electrode holders or cables with damaged or deteriorated insulation.
- Keep working environment, equipment, cables and clothing free from grease, oil, moisture and dirt.
- Ensure machine has been correctly earthed and all panels are fitted securely.
- The operator must be insulated from the floor and work bench using a dry insulation mat.
- Wear isolating footwear and gloves that are in good condition, i.e. without holes.
- In hazardous conditions of increased electric shock always ensure a second person is present in case of accident.
- Never change electrodes with bare hands or damp gloves.
- Keep welding cables away from power cables.
- Regularly inspect the condition of the cutting, earth and power cables for signs of damage.

5. HEALTH AND SAFETY INFORMATION

- Do leave machine unattended and remove plug from socket when not in use.
- Do not use cables unsuitable for the amperage.
- Ensure earth clamp is adjacent to cut, secured to bare metal and when not in use is insulated for safety.
- Keep all equipment well maintained.
- The operator shall prevent gas cylinders in the vicinity of the work piece from becoming part of the cutting circuit.

FUMES & GASES CAN BE HARMFUL:

- The cutting process generates hazardous fumes as a by product. Inhalation of these fumes is hazardous to health.
- Keep your head away from the cut to avoid breathing the fumes.
- If cutting in confined spaces ensure adequate ventilation and use a fume extractor.
- Fumes displace oxygen. Danger of suffocation.
- By products of cutting can react with other chemical vapours to produce a toxic/explosive environment.

WELDING CAN CAUSE FIRE OR EXPLOSION:

- Cutting and allied processes can cause fire and explosions and precautions shall be taken to prevent these hazards.
- Before starting a cut ensure the area is clear of flammable materials.
- Remove any inflammables to a safe distance, especially substances likely to generate a dangerous vapour.
- The cutting flame can cause serious burns. Avoid contact with skin.
- Sparks and molten metal are cast out during cutting. Take precautions to prevent fire igniting and wear protective clothing.
- Sparks and molten metal will pass through gaps. Be aware that fire can start out of sight. Flammables in a locked cabinet may not be safe.
- Do not cut pressurised containers.
- Do not cut tanks, drums or other vessels until they have been correctly cleaned/prepared for welding.
- Always have appropriate and fully maintained fire fighting equipment suitable for the materials used and for use in electrical environments available in close proximity at all times.
- Keep clothing free from oil and grease.
- Wear hat, flame-proof apron, woollen clothing, gloves, long sleeve tops with closed neck, trousers (without turn-ups) to cover nonslip boots.
- Protective head and shoulder coverings should be worn when overhead cutting.
- Avoid taking any fuels with you e.g. cigarette lighters or matches.
- Hot spots and their immediate surroundings should be observed until their temperature has dropped to normal.

PERSONAL PROTECTION:

- The body should be protected by suitable clothing.
- The use of neck protection may be necessary against reflected radiation.
- Wear safety glasses when chipping, wire brushing, grinding or when near cooling cuts as metal filings or slag can be thrown up. Fully enclosed goggles are advisable.
- Arc machines generate a magnetic field which is detrimental to pacemaker recipients. Consult your doctor before going near welding equipment/operations.

5. HEALTH AND SAFETY INFORMATION

- The UV and IR radiation generated by cutting is highly damaging to the eye, causing burns. This can also affect the skin. Protect the eyes and face.
- The face and eyes shall be protected by suitable welding shields equipped with appropriate ocular protection filters.
- Where environments are subject to pedestrians and traffic ensure a protective screen is used to avoid accidental arc glare.
- Do not cut in the vicinity of children or animals and ensure no one is looking before striking up.
- In the cutting environment, damaging levels of noise can exist. Wear hearing protection if the process dictates.
- Do not touch hot equipment or metal. Allow the cut time to cool, use the correct tool and wear protective welding gauntlets.
- Wear flame retardant clothing (leather, wool, etc.).
- Take care when adjusting or maintaining the torch that it has had time to cool sufficiently and is disconnected.
- The arc generates ultra-violet radiation (can damage skin and eyes);
- visible light (can dazzle eyes and impair vision);
- infra-red (heat) radiation (can damage skin and eyes);
- Such radiation can be direct or reflected from surfaces such as bright metals and light coloured objects.

GAS CYLINDERS:

- Gas cylinders should be located or secured so that they cannot be knocked over.
- Shield gas containers can explode if damaged. Take care when handling.
- Ensure gas cylinders are shut-off when not in use and between operations.
- Take care that no build-up of gas is permitted to form in confined area's.
- Cylinders must be in an upright position at all times during use and storage.
- The gas cylinder must never come in to contact with the electrode.
- Follow the manufacturer's instructions for handling, storing and using the gas bottle correctly and safely.
- Use the correct equipment to connect the gas bottle to the welding torch.

LIMITATIONS:

- Do not use for;
- operations in severe conditions (e.g. extreme climates, freezer applications, strong magnetic fields etc).
- operations subject to special rules (e.g. potentially explosive atmospheres, mines etc).
- operations that require ingress protection greater than IPX0, e.g. in rain or snow etc.

GENERAL:

- Training should be sought out in
- the safe use of this equipment;
- the processes;
- the emergency procedures;
- Cutting power sources are not to be used for pipe thawing.
- Take precautions against toppling over, if the power source shall be placed on a tilted plane.
- All equipment should be kept in good working condition, inspected and, when defective, promptly repaired or withdrawn from service - All equipment should be placed so that

5. HEALTH AND SAFETY INFORMATION

it does not present a hazard in passageways, on ladders or stairways, and should be operated in accordance with the manufacturer's instructions.

- In the vicinity of an arc, non-reflective curtains or screens shall be used to isolate persons from the arc radiation. A warning, e.g. a symbol for eye protection, should refer to the hazard of arc radiation.

5.3 CONNECTION TO THE POWER SUPPLY

Caution! Risk of electric shock. Do not open.

This appliance is supplied with an approved plug and cord for your safety.

If the power supply cord is damaged, it must be replaced by Draper Tools, an authorised service agent or similarly qualified personnel in order to avoid a hazard.

The damaged or incomplete plug, when cut from the cord, shall be disabled to prevent connection to a live electrical outlet.

This appliance is a Class I[†] appliance and is designed for connection to a power supply matching that detailed on the rating label and compatible with the plug fitted.

The value of the fuse fitted is marked on the pin face of the plug. Should the fuse need replacing, use a small plain-slot screwdriver to remove the fuse cover. Ensure the substitute is of the correct rating, approved to BS 1362 and ASTA or BS Kite marked.

ASTA 

BSI 

This should only be performed by suitably qualified personnel.

If an extension lead is required, use an approved and compatible lead rated for this appliance.


Follow all the instructions supplied with the extension lead.

Important: ALWAYS follow the extension lead instructions regarding maximum load while the cable is wound. If in doubt, unwind the entire cable. A coiled extension lead generates heat which could melt the lead and cause a fire.

[†]EARTHED : This product requires an earth connection to protect against electric shock from accessible conductive parts in the event of failure of the basic insulation.

6. TECHNICAL DESCRIPTION

6.1 IDENTIFICATION

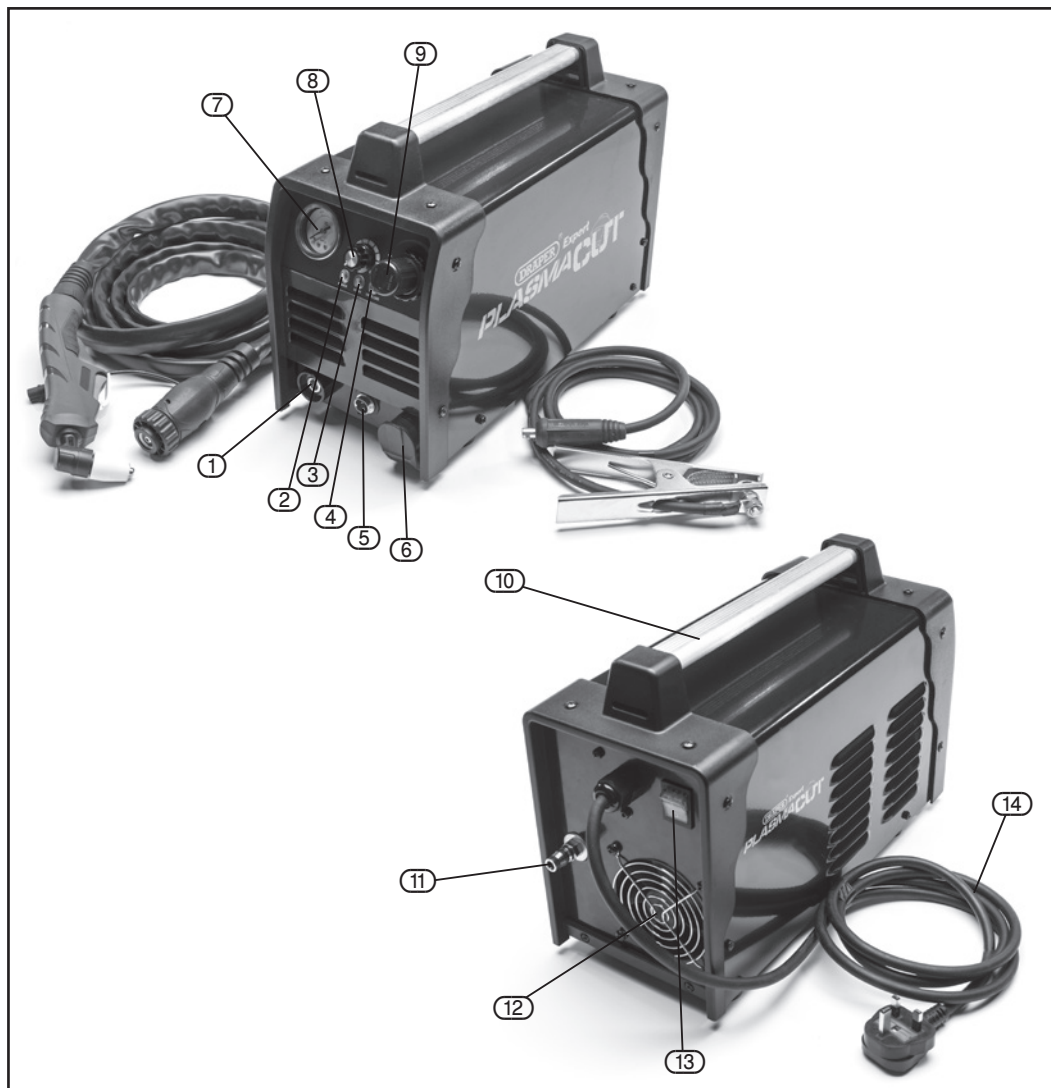

- ① Earth lead connection
- ② Power indicator light
- ③ Work/in use indicator light
- ④ Overload indicator light
- ⑤ Trigger connection
- ⑥ Torch connection
- ⑦ Air pressure gauge

- ⑧ Current adjustment dial
- ⑨ Air adjustment dial
- ⑩ Carry handle
- ⑪ Compressed air feed
- ⑫ Cooling fan
- ⑬ Mains power switch
- ⑭ Power cord and plug

7. UNPACKING AND CHECKING

7.1 PACKAGING

Carefully remove the product from the packaging and examine it for any sign of damage that may have happened during shipping. Lay the contents out and check them against the parts shown below. If any part is damaged or missing; please contact the Draper Help Line (the telephone number appears on the Title page) and do not attempt to use the product.


The packaging material should be retained at least during the guarantee period: in case the machine needs to be returned for repair.

Warning! Some of the packaging materials used may be harmful to children. Do not leave any of these materials in the reach of children.

If any of the packaging is to be thrown away, make sure they are disposed of correctly; according to local regulations.

7.2 WHAT'S IN THE BOX

As well as the plasma cutter, there are several parts not fitted or attached to it.

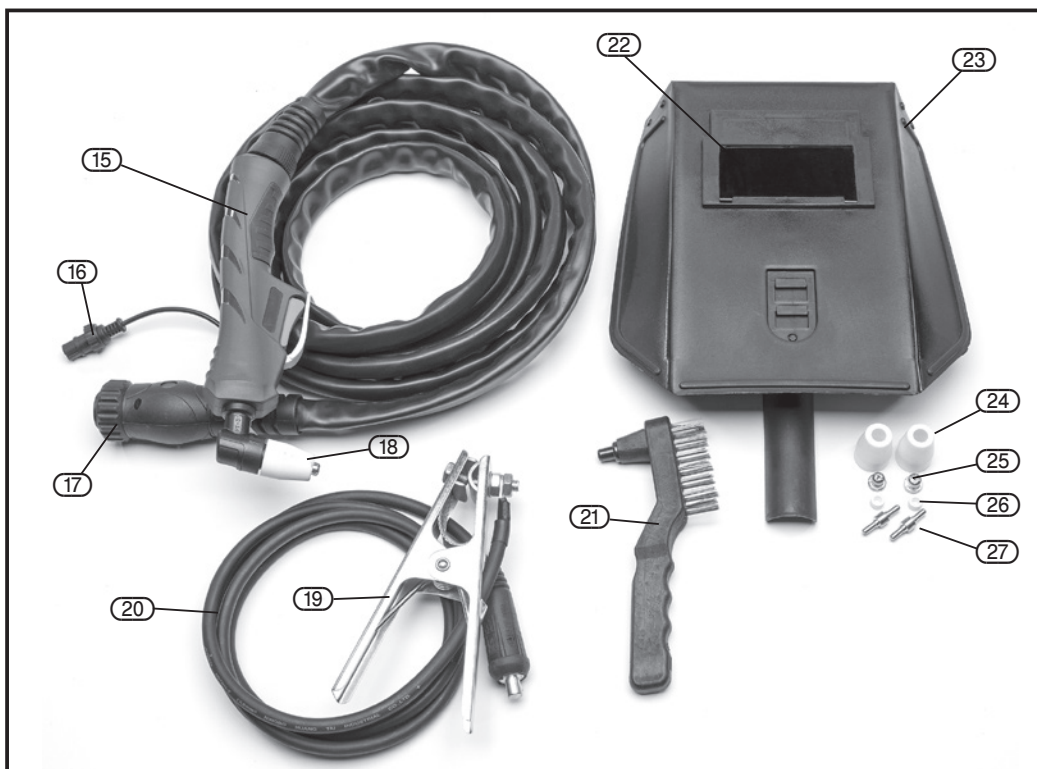

(15) Plasma torch

(16) Torch trigger connector

(17) Torch connector

(18) Ceramic shroud

(19) Earth clamp

(20) Earth cable

(21) Chipping hammer/brush

(22) Shaded glass filter

(23) Face shield

(24) Spare ceramic shrouds

(25) Spare tips

(26) Spare rings

(27) Spare electrodes

8. PREPARING THE PLASMA CUTTER

8.1 GENERAL

This medium weight, portable cutter requires no special lifting instructions, however it contains dedicated circuitry and must be handled with care.


Note: Although the Electrode and nozzle are classed as a nonconsumable, it will be consumed by the cutting process and require eventual replacement.

Read the entire Important Safety Information section at the beginning of this manual including all text under subheadings therein before set up or use of this product.

Warning: To prevent serious injury from accidental operation:

Turn the Power Switch (13) of the Plasma Cutter to its "OFF" position and unplug the plasma cutter from its electrical outlet before assembling or making any adjustments to the plasma cutter.

Note: For additional information regarding the parts listed in the following pages, refer to the Assembly Diagram near the end of this manual.

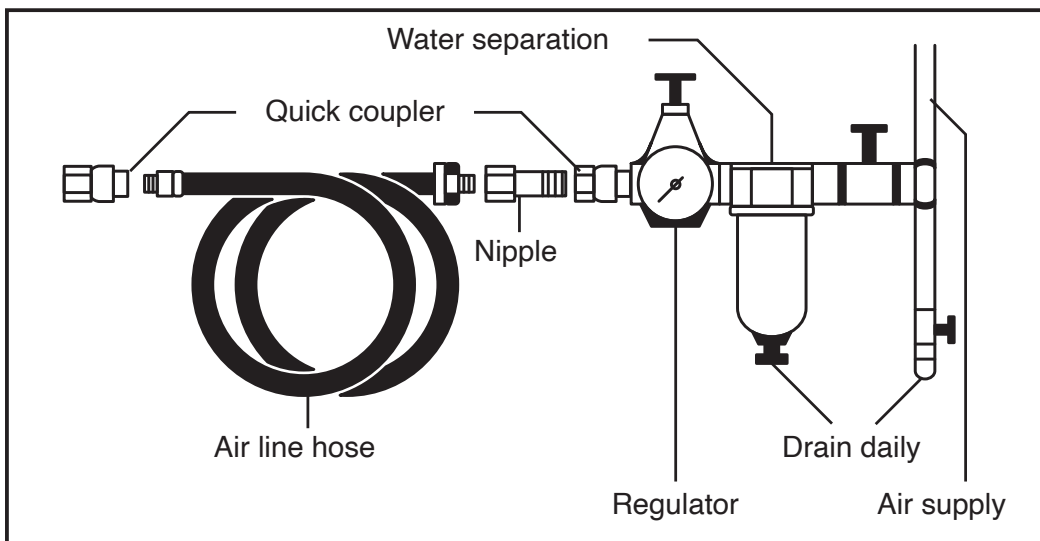

The air regulator is set external. A male Quick Release Adapter need to be mounted on the Air Pressure Regulator by user. Attach your compressor's air supply hose to the Quick Release Adapter. Then, adjust your compressor to deliver 0.3 to 0.35 MPA compressed air.

During operation, you can regulate air pressure through the Plasma Cutter by adjusting the Knob located on the Air Pressure Regulator (see 8.2 on page 14).

8. PREPARING THE PLASMA CUTTER

8.2 CONTROLS & INDICATORS

Power Switch (13): is on back side of machine.

Current adjustment dial (8): Allows you to adjust the current from 10 to 25 Amps.

Green LED Light (2): When illuminated, means the Plasma Cutter is on.

Red LED Light (3): When illuminated, means cutting is in process.

Yellow LED Light (4): When illuminated, means the Plasma Cutter has become overheated and the unit will automatically shut down. Stop using the Plasma Cutter while leaving the Power Switch ON to allow the Cooling Fan to operate. The LED Light will turn off automatically when the unit cools down and then you may resume cutting.

Dial (9) can be pulled to release the lock and then can be rotated to select air pressure. Once the correct air pressure is selected press the cap to lock it in place.

8.3 WORK PIECE AND WORK AREA SET UP

Designate a work area that is clean and well-lit. The work area must not allow access by children or pets to prevent injury and distraction.

Route the Power Cord along a safe route to reach the work area without creating a tripping hazard or exposing the Power Cord to possible damage. The Power Cord must reach the work area with enough extra length to allow free movement while working.

Contact the nozzle of the torch to the work piece, press the button of the torch until the arc-starting, then perform the cutting operation.

There must not be hazardous objects, such as utility lines or foreign objects, nearby that will present a hazard while working.

A barrier, such as a welding curtain or welding shroud should be put up to protect others in the work area and limit the spray of sparks.

8.4 ATTACH AIR HOSE TO BACK OF UNIT

Connect air hose securely to the hose connector (11) ensuring an air tight seal with a hose clamp.



FIG.1



FIG.2

8. PREPARING THE PLASMA CUTTER

8.5 ATTACH EARTH CLAMP

With the lug on the pin at top, push the connector (20.1) fully into the port ① then turned clockwise 180° to lock hand tight only.

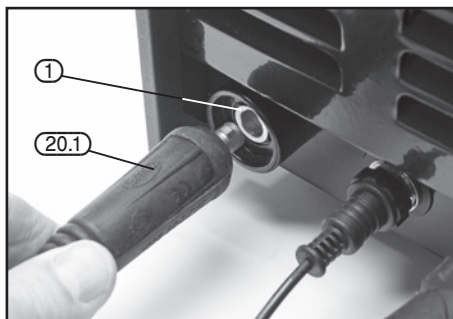


FIG.3

8.6 ATTACH TORCH

To connect the torch trigger (17), align the 2 pins and push to fit, then secure using the outer metal ring screwing it onto trigger port (6).

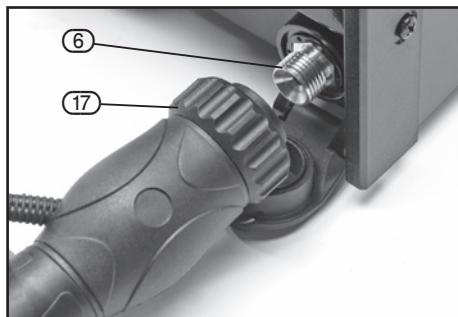


FIG.4

The torch hose (16) is a push fit into port (5) with a screw down securing collar.

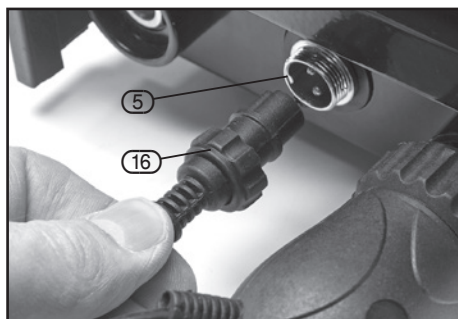


FIG.5

9. BASIC PLASMA CUTTER OPERATIONS

Note: Under no circumstances must the plasma nozzle be removed or any other work be carried out on the torch with the machine switched on. Ignoring this precaution could lead to serious burns or contact with high DC voltages.

If the machine has just been used for cutting, allow the cooling air to stop before switching the machine off for torch servicing.

The torch should be kept free of slag at all times to ensure the free passage of air.

9.1 TORCH ASSEMBLY

To assemble / dismantle the torch:


1. Invert the torch so the tip points upwards.
2. Unscrew and remove the shield cup.
3. Remove the Tip, swirl baffle and electrode.
4. Ensure the torch head thread is upper most.
5. Fit electrode into end of torch head.
6. Fit swirl baffle onto electrode, ensure is it seated fully onto the electrode.
7. Fit tip onto the swirl baffle.
8. Fit shield cup and screw on.

The Tip and electrode need replacing when worn.

Indication of wear are a loss off cutting capacity or that the cut is no longer 90 degrees.

When inspecting the Tip look for erosion of the hole in the centre of the tip or a build up of metal residue.

When inspecting the electrode look for erosion in centre of the electrode

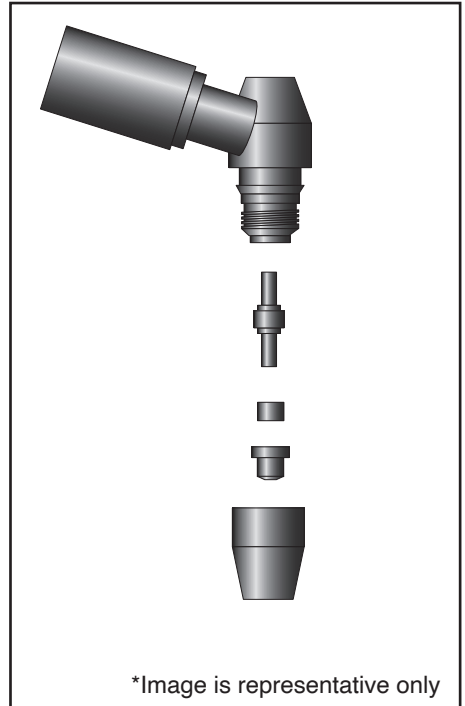

*Image is representative only

FIG.6

9. BASIC PLASMA CUTTER OPERATIONS

9.2 OPERATING INSTRUCTIONS

1. Check all safety instructions have been observed.
2. Check correct air supply is connected.
3. Drain any water from bowl on the filter regulator.
4. Set machine to required current range according to the thickness of metal to be cut.
DO NOT change range while cutting.

Caution: DO NOT attempt to cut material beyond the range specified, as this will damage the torch.

1. Check the torch consumables are in good condition.
2. Check torch and earth lead connections are tight.
3. Connect return lead to the work piece, using an area free of rust and paint, for a good contact.
4. Connect to mains supply and switch on. The green light will come on.
5. Adjust air pressure to 4.5 Bar.
6. Set the cutting current via the current control, an indication of the setting will be shown on the digital display
7. Adjust the post gas control, if cutting at a high current setting or making a long cut set the control near maximum, this will give a longer cool time for the torch.
8. Place the torch at the edge of the work piece with the centre of the tip slightly beyond the edge. Press the torch trigger. The air will flow after a short delay the arc will ignite. The torch should be moved steadily along the work piece at a rate slow enough for the metal to be cut right through in one pass. If the cut penetration is incomplete, then the torch could be damaged. (While the air is flowing, check it is still 4.5 Bar.)
9. When the cut is complete, release the torch trigger button. The arc will immediately extinguish, but air will continue to flow for a short time. DO NOT turn the machine off until this cooling air has stopped flowing as this is necessary to prevent damage to the torch.

PIERCING

When piercing, the torch head should be angled back so as to allow the molten material to escape to one side. The normal angle of cut can be resumed once the metal has been pierced.

Note: Piercing will reduce the life of the torch consumables.

10. MAINTENANCE

Note: Remove the plug from the socket before carrying out adjustment, servicing or maintenance.

1. Clear dust from machine at regular intervals use clean dry compressed air, if use in a dirty environment the machine should be cleaned once a month.
2. Check all connections are clean and tight, if there is any oxidization clean the connection with a mild abrasive or wire brush.
3. If the machine is not to be used for a long time, store it in the original packing a dry place.

11. TROUBLESHOOTING

11.1 TROUBLESHOOTING

WARNING: For your own safety, turn the switch off and remove the plug from the power supply socket.

Problem	Possible Cause	Remedy
Plasma arc will not start.	• Unit not powered up.	• Check mains supply, on/off switch is on.
	• Work clamp connection.	• Check ground clamp has a good connection to the material being cut, clean surface of material if it is dirty or corroded.
	• Air supply is low pressure.	• Check air is flowing from the torch tip with cut switch pressed. Check the compressor is maintaining 60psi at the gauge while cutting is in progress. Check the regulator fittings have been assembled properly using PTFE tape.
		• Check the cutting tip is not blocked by molten metal splatter.
	• OC Light on front panel of unit comes on.	• Switch machine off and wait about 2-3 minutes, Switch machine back on. This can occur if the unit is overheating due to a high ambient temperature. • Use 32A cable for power lead extensions, a standard 13A type is unsuitable if a long extension is required. If the voltage at the unit 'dips' below the minimum value as the arc strikes the unit will turn off and the OC light will come on. • Try operating the cutter at 20A set current, if this is OK then there is a problem with the stability of the mains supply to the unit. Use a different power source or thicker mains cable to connect to the unit mains lead.
	• Torch Assembly / Air flow	• Check the torch has been assembled correctly. Note the presence and position of the swirl ring. • Wait for air flow to finish flowing before operating cutting switch. Plasma will not start if air is already flowing from nozzle when the cutting switch is pressed.

Important: Please note all repairs/service should be carried out by a qualified person.

11. TROUBLESHOOTING

Problem	Possible Cause	Remedy
Plasma arc stops while cutting	• Hand too tense, inadvertently releasing the cut switch	• Hold the torch lightly against the material being cut, don't push down. Try and relax the hand.
	• Cutting speed too slow	• If all material cut from under the arc the arc will extinguish.
	• Torch moved too far away from material	• Move torch closer to the metal to be cut.
	• Compressor unable to keep up with air demand	• Check air pressure gauge reading when cut stops. • Check air pressure gauge is reading 60psi with cut switch pressed. • Check torch lead connections at unit and torch are tight. • Check torch hose is undamaged. • Check compressor, give the compressor time to recover if making long cuts when using a smaller compressor. Check the regulator fittings have been assembled properly using PTFE tape.
Sparks are shooting upward not downward through the material	• Plasma arc not piercing material	• Torch travel speed too fast • Check grounding clamp is making a good connection to the material being cut and is tightly connected at the unit. Clean a patch of material for clamp if rusty
		• Increase current

Important: Please note all repairs/service should be carried out by a qualified person.

12. OPTIONAL ACCESSORIES

12.1 OPTIONAL ACCESSORIES

A full range of accessories are available from Draper Tools.

Please visit our website for details: **www.drapertools.com**

13. DISPOSAL

13.1 DISPOSAL

- At the end of the machine's working life, or when it can no longer be repaired, ensure that it is disposed of according to national regulations.
- Contact your local authority for details of collection schemes in your area.

In all circumstances:

- Do not dispose of power tools with domestic waste.
- Do not incinerate.
- Do not dispose of WEEE* as unsorted municipal waste.



* *Waste Electrical & Electronic Equipment.*

14. EXPLANATION OF SYMBOLS

14.1 EXPLANATION OF SYMBOLS



Read the instruction manual.



Wear face mask and safety glasses.



Wear ear defenders.



Wear protective gloves.



Do not abandon into the environment.



Keep out of the reach of children.



Warning!



Class I construction
(must be earthed).



WEEE –
Waste Electrical &
Electronic Equipment.
*Do not dispose of Waste Electrical
& Electronic Equipment in with
domestic rubbish.*

CONTACTS

Draper Tools Limited, Hursley Road,
Chandler's Ford, Eastleigh, Hampshire. SO53 1YF. U.K.

Draper Tools Europe B.V.
Oude Graaf 8, 6002 NL, Weert, Netherlands

Helpline: (023) 8049 4344

Sales Desk: (023) 8049 4333

Internet: drapertools.com

E-mail: sales@drapertools.com

General Enquiries: (023) 8026 6355

Service/Warranty Repair Agent:

For aftersales servicing or warranty repairs, please contact the
Draper Tools Helpline for details of an agent in your local area.

YOUR DRAPER STOCKIST

KCKC0819

©Published by Draper Tools Limited.

No part of this publication may be reproduced, stored in a retrieval system or transmitted in any form or by any means, electronic, mechanical photocopying, recording or otherwise without prior permission in writing from Draper Tools Ltd.