

UNIVERSAL ROBOTS



Service Manual

"Original instructions"

Revision:

UR3_en_3.2.7

Robot:

UR3 with CB3.1/3.2 - controller

CB3.1 valid from robot s/n 2014330001 to 2019330944 CB3.2 valid from robot s/n 2019330945

Valid from robot s/n: 2014330001

1. Service Manual

The information contained herein is the property of Universal Robots A/S and shall not be reproduced in whole or in part without prior written approval of Universal Robots A/S.

The information herein is subject to change without notice and should not be construed as a commitment by Universal Robots A/S. This manual is periodically reviewed and revised.

Universal Robots A/S assumes no responsibility for any errors or omissions in this document.

Copyright © 2009-2019 by Universal Robots A/S

The Universal Robots logo is a registered trademark of Universal Robots A/S.

2. Content

| 1. Service Manual | 2 |
|--|----|
| 2. Content | 3 |
| 3. General information | 1 |
| 3.1. Purpose | 1 |
| 3.2. Company details | 1 |
| 3.3. Disclaimer | |
| 3.4. Warning Symbols in this Manual | |
| 4. Recommended Inspection Activities | |
| 4.1. Controller | |
| 4.1.1. Inspection plan | |
| 4.1.2. Safety Functions | |
| 4.1.3. Visual inspection | |
| 4.1.4. Cleaning and replacement of filters | |
| 4.2. Robot arm | 10 |
| 4.2.1. Inspection plan | |
| 4.2.2. Functional inspection | |
| 4.2.3. Visual inspection | 11 |
| 5. Service and Replacement of Parts | 12 |
| 5.1. Handling ESD Sensitive Parts | 12 |
| 5.1.1. Recommended Tools | 15 |
| 5.2. Robot Arm | 16 |
| 5.2.1. Before returning any part to Universal Robots | 16 |
| 5.2.2. Robot Arm Configuration | 17 |
| 5.2.3. Brake Release | 17 |
| 5.2.4. General Guidance to Separate Joint from Counterpart | 18 |
| 5.2.5. Torque values | 25 |
| 5.2.6. Base joint – Base mounting bracket | 27 |
| 5.2.7. Shoulder joint – Base joint | |
| 5.2.8. Upper arm – Shoulder joint | |
| 5.2.9. Elbow counterpart – Elbow joint | |
| 5.2.10. Wrist 1 joint – Lower arm | |
| 5.2.11. Wrist 2 joint – Wrist 1 joint | |
| 5.2.13. Tool flange – Wrist 3 joint | |
| 3.2. 10. 1001 hange 111000 joint | |

| | 5.2.14. Instructions for Calibrating a Joint | 40 |
|-----------------|--|----|
| | 5.2.15. Dual Robot Calibration | |
| | 5.2.16. Change joint ID | |
| | 5.2.17. Joint Spare Part Adaptation | 48 |
| | 5.2.18. Modify Wrist 3 to Wrist 1 or Wrist2 | 49 |
| | 5.2.19. Wire bundle installation guide | 51 |
| | 5.3. Controller | 61 |
| | 5.3.1. Replacement of Motherboard 3.1 | 61 |
| | 5.3.2. Replacement of Safety Control Board | 63 |
| | 5.3.3. Replacement of Teach Pendant | 66 |
| | 5.3.4. Replacement of 48V power supply | 70 |
| | 5.3.5. Replacement of 12V power supply | 76 |
| | 5.3.6. Replacement of Current distributor | 77 |
| 6. \$ | Software | 79 |
| | 6.1. Update software | 79 |
| | 6.2. Update joint firmware | |
| | 6.3. Using Magic files | |
| | 6.4. Backup of data | |
| | 6.4.1. Hardware Requirements | |
| | 6.4.2. Software Requirements | |
| | 6.4.3. How to Access Linux Partition from Windows | |
| | 6.4.4. Copy the data from CF-card to UR-USB | |
| 7. ⁻ | Troubleshooting | 93 |
| | 7.1. Error codes | |
| | 7.2. LED indicators and Fuses on Safety Control Board | |
| | 7.3. Normal startup sequence for a CB3.x UR3 | |
| | 7.4. Error phenomena | |
| | · | |
| | 7.4.1. Control Box: NO CONTROLLER displayed in Initializing | |
| | 7.4.2. NO CABLE displayed during power up 7.4.3. Protective stop | |
| | 7.4.4. Power on failure in Initializing | |
| | 7.4.5. Checklist after a collision | |
| | 7.4.6. Communication to joints and tool | |
| | 7.4.7. Complete rebooting sequence. | |
| | 7.5. Electrical drawing | |
| | - | |
| | 7.6. E-Plan diagrams | |

| 8. Spare Parts | 219 |
|---------------------|-----|
| 8.1. Robot arm | 219 |
| 8.2. Controller | 221 |
| 8.3. Tools | 222 |
| 9. Packing of robot | 224 |
| 10. Change log | 225 |



UR3 Service Manual



3. General information

3.1. Purpose

The main purpose of this manual is to help the user safely perform service-related operations and troubleshooting.

Universal Robots industrial robots are designed using high quality components to ensure a long lifetime.

However, any improper use of robot can potentially cause failures. If for example, the robot is overloaded, run with a load not recommended by Universal Robots, dropped during relocation, damaged by collision or any other improper usage, the warranty will be void.

Universal Robots recommends that the user does not attempt repair, adjustment or other intervention in the mechanical or electrical systems of the robot without first consulting a UR certified service engineer. Any unauthorized intervention will void the warranty. Service-related operations and troubleshooting should only be performed by qualified personnel.

Before performing service-related operations, always make sure to stop the robot program and disconnect the main power to any potential dangerous tool on the robot or in the work cell.

In the event of a defect, Universal Robots recommends ordering new parts from the Universal Robot distributor where the robot was purchased from.

Alternatively, parts can be ordered from the nearest distributor, details of which can be obtained from Universal Robots official website at www.universal-robots.com

3.2. Company details

Universal Robots A/S

Energivej 25

DK-5260 Odense Denmark

Tel.: +45 89 93 89 89 Fax: +45 38 79 89 89

3.3. Disclaimer

Universal Robots continues to improve reliability and performance of its products, and therefore reserves the right to upgrade the product without prior warning. Universal Robots takes every care that the contents of this manual are precise and correct, but takes no responsibility for any errors or missing information.

Service Manual 1 UR3

3.4. Warning Symbols in this Manual

DANGER, WARNING, CAUTION, NOTICE and SAFETY INSTRUCTION statements are used throughout this manual to emphasize important and critical information.

You MUST read these statements to help ensure safety and to prevent product damage.

The statements are defined below.

DANGER

These warnings mean a hazardous situation which, if not avoided, will result in death or serious injury.

WARNING

These warnings mean a hazardous situation which, if not avoided, could result in death or serious injury.

CAUTION

These warnings mean a hazardous situation which, if not avoided, could result in minor or moderate injury.

NOTICE

These warnings mean damage to property may occur if no precautions are taken.

CAUTION

This warning sign contain references to safety-relevant information or general safety measures.

This warning sign do not refer to individual hazards or individual precautionary measures.

4. Recommended Inspection Activities

It is recommended to perform preventive maintenance on the control box and robot at least once per year. In case of use in dirty or dusty environments it is recommended to increase the frequency.

In case dust/dirt/oil is observed on the controller or robot arm, it can be wiped away using a cloth with cleaning agent. Cleaning agent: Water, Isopropyl alcohol, 10% Ethanol alcohol or 10% Naphtha.

In very rare cases, very small amounts of grease can seep from the joint. This does not affect the specified function or lifetime of the joint.

NOTICE

Never use compressed air to clean the controller or robot arm as it can damage the seals and internal components

4.1. Controller



4.1.1. Inspection plan

Set forth below is a check list of inspections that Universal Robots recommends be performed according to the marked time interval. If upon inspection, the referenced parts are not in an acceptable state, please rectify immediately.

UNIVERSAL ROBOTS 4. Recommended Inspection Activities

| Use the following sections as guide: 2.1.2 Safety Functional 2.1.3 Visual Inspection 3.2 Control Box | | Monthly | Bi-annually | Annually |
|--|---|---------|-------------|----------|
| Check Emergency stop on Teach Pendant | F | Χ | | |
| Check Backdrive mode | F | Χ | | |
| Check Freedrive mode | F | | Χ | |
| Check safety inputs and outputs (if connected) | F | Х | | |
| Check Teach Pendant cable | ٧ | | Χ | |
| Check and clean air filters on Control Box | ٧ | Χ | | |
| Check terminals in Control Box | F | | Χ | |
| Check electrical grounding 1< Ω to Control Box | F | | | Χ |
| Check main power to Control Box | F | | | X |

V = Visual inspection F = Functional inspection

4.1.2. Safety Functions

The robot safety functions must be tested at least once a year to ensure correct function. The following tests must be performed.

- Backup data from the storage device See section 4.4 Backup of data
- Test that the Emergency Stop button on the Teach Pendant functions:
 - Press the Emergency Stop button on the Teach Pendant.
 - Observe that the robot stops and turns off the power to the joints.
 - · Power on robot again.
- Test Freedrive mode:
 - Unmount attachment or set TCP/Payload/CoG according to tool specifications.
 - · Set the robot in Free drive mode by holding the black Freedrive button on the back of the Teach Pendant.
 - Move the robot to a position stretched out horizontally to the edge of its workspace.
 - Monitor that the robot maintains its position unsupported while the Freedrive button is still pressed.
- · Test Backdrive mode:

If the robot is close to collision, the BACKDRIVE function can be used to move the robot to a safe position before initializing.

- Press ON to enable power, state will change to Idle.
- Press and hold Freedrive -> status will change to BACKDRIVE.
- Move the robot by hand as in Freedrive.

UR3 4 Service Manual



- In BACKDRIVE mode brakes will only be released on individual joints when they are moved, and will remain released as long as the Freedrive button is pushed. Robot will be "heavy" to move around compared to Freedrive mode.
- Be sure to test each joint individually, to ensure the brake release as expected.
- · Verify safety settings:
 - Verify that the safety settings of the robot comply with the Risk Assessment of the robot installation.
- · Test that additional safety inputs and outputs are still functioning:
 - Check which safety inputs and outputs are active and test that they can be triggered.

4.1.3. Visual inspection

- · Disconnect power cable from controller
- Check that the terminals on the Safety Control Board are properly inserted and do not have loose wires
- Check all connections on Motherboard and connection between Safety Control Board and Motherboard
- Check for any dirt/dust inside of controller, clean with ESD vacuum cleaner if needed

NOTICE

Never use compressed air to clean inside the controller as it can damage componentss

4.1.4. Cleaning and replacement of filters

Original control box


Controller box has two filters, one mounted on each side of the box.





- Remove filters from controller box and clean them thoroughly using low pressure air.
 - · Replace filters if necessary.
 - Gently remove the outer plastic frame and maintain the filter.



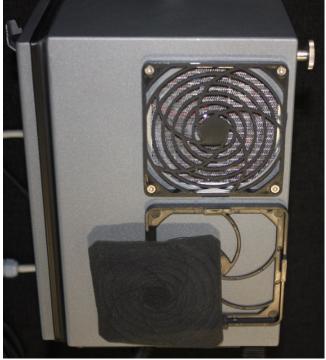

Merge Control Box

• Controller box has two filters, one mounted on each side of the box.







- Remove filters from controller box and clean them thoroughly using low pressure air.
- · Replace filters if necessary.
- Gently remove the outer plastic frame and maintain the filter.





Cleaning the Robot in Relation to COVID


Due to the added focus on cleaning your robot, Universal Robots recommends cleaning with 70% isopropyl alcohol (rubbing alcohol).

- 1. Wipe the robot with a hard twisted micro fiber cloth and 70% isopropyl alcohol (rubbing alcohol).
- 2. Let the 70% isopropyl alcohol dwell on the robot for 5 minutes, and then clean the robot using standard cleaning procedure.

DO NOT USE BLEACH. Do not use bleach in any diluted cleaning solution.

You can wipe away any dust/dirt/oil observed on the robot arm using a cloth and one of the following cleaning agents: Water, Isopropyl alcohol, 10% Ethanol alcohol or 10% Naphtha. In rare cases, very small amounts of grease can be visible from the joint. This does not affect the function, use, or lifetime of the joint.

4.2. Robot arm

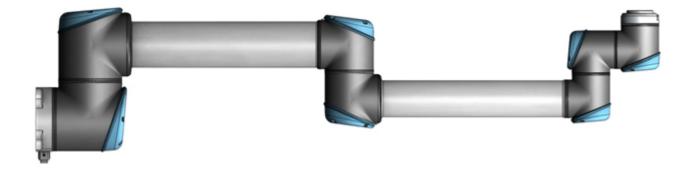

4.2.1. Inspection plan

Set forth below is a check list of inspections that Universal Robots recommends be performed according to the marked time interval. If upon inspection, the referenced parts are not in an acceptable state, please rectify immediately.

| Use the following sections as guide: 2.2.2 Visual Inspection 3.1 Robot Arm | | Monthly | Bi-annually | Annually |
|--|---|---------|-------------|----------|
| Check blue lids* | ٧ | | Χ | |
| Check blue lid screws | F | | Χ | |
| Check flat rings | ٧ | | Χ | |
| Check robot cable | ٧ | | Χ | |
| Check robot cable connection | ٧ | | Χ | |
| Check Robot Arm mounting bolts* | F | Χ | | |
| Check Tool mounting bolts* | F | Χ | | |
| Check screws/bolts that is connecting joints* | F | | Χ | |

V = Visual inspection F = Functional inspection * = Must also be checked after heavy collision

4.2.2. Functional inspection

The purpose of the functional inspection is to ensure that screws, bolts, tools and robot arm are not loose. The screws/bolts mentioned in the inspection plan should be checked with a torque wrench with the correct torque, specified in 5.2.5. Torque values on page 25.

For the robot arm mounting bolts, these specifications can be found in the User Manual under the Mounting section.

UR3 10 Service Manual



For safety reasons confirm that the 4 rubber covers, over the mounting screws, are present on the Base mounting bracket.



NOTICE

Never use compressed air to clean the robot as it can damage the seals and internal components

- · Move robot arm to HOME position (if possible).
- · Turn off and disconnect power cable from controller.
- · Inspect cable between controller and robot arm for any damage.
- Inspect flat rings for wear and damage.
 - Replace flat rings if worn out or damaged.
- Inspect blue lids on all joints for any cracks or damage.
 - · Replace blue lids if cracked or damaged.
- Inspect that screws for blue lids are in place and properly tightened.
 - Replace screws, tighten properly if necessary.
 - Correct torque value for screws on blue lids are 0.4Nm.

If any damage is observed on a robot within the warranty period, contact the distributor from which the robot has been purchased.

5. Service and Replacement of Parts

5.1. Handling ESD Sensitive Parts






To prevent damage to ESD-sensitive parts, follow the instructions below. These are in addition to standard precautions such as turning off power before removing circuit boards.

Keep the ESD-sensitive part in its original shipping container. (a special "ESD bag") until the part is ready to be installed.




Put the ESD wrist strap on your wrist. Connect the wrist band to the system ground point. This discharges any static electricity in your body to ground.

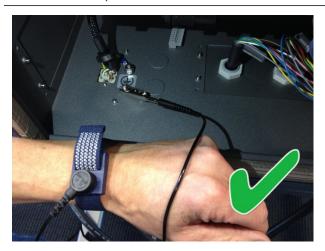


Step 1: Put OLD board into spare ESD bag.



Step 2: Take NEW board out of ESD bag.

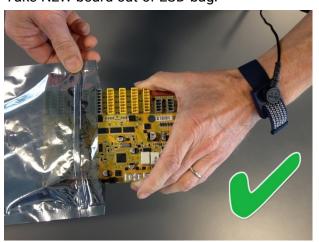

Hold the ESD-sensitive part by its edges. Do not touch its pins!

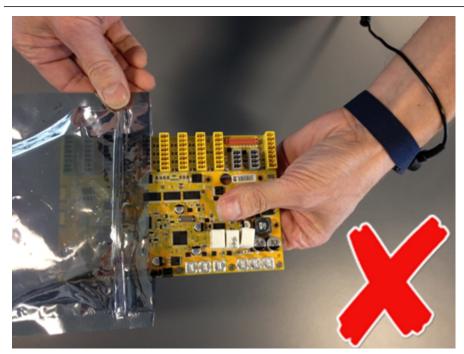





Do not place the ESD-sensitive part on nonconductive material or on a metal table. If the ESD-sensitive part needs to be put down for any reason, then first put it into its special ESD bag








Machine covers and metal tables are electrical grounds. They increase the risk of damage,

because they make a discharge path from your body through the ESD-sensitive part.

(Large metal objects can be discharge paths without being grounded.)

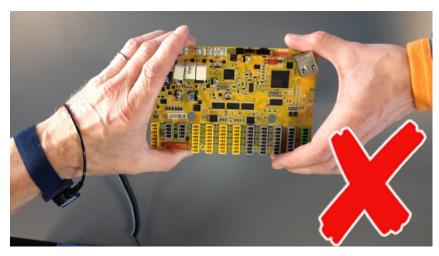

Prevent ESD-sensitive parts from being accidentally touched by other personnel and do not put unprotected ESD-sensitive parts on a table.

Be extra careful in working with ESD-sensitive parts when cold-weather and heating is used, because low humidity increases static electricity.

5.1.1. Recommended Tools

Robot arm:


• Service kit – part no.: 109010.

Control box:

Below tool should be ESD safe tools.



Slotted screwdriver

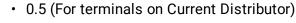



Philips screwdriver

• PH2 (For terminals on power supplies)

Torx screwdriver



- TX10 (For external connections i.e. main power connection)
- TX20 (For shield in front of PCB's)
- TX45 (For Control box handle)



Hex screwdriver

· Size 4 (For Safety Control Board and Motherboard)



Spanner

Size 7 (for energy eater)



Socket screwdriver



- Size 10 (For component bracket and grounding nuts)
- Bit extinction (To access nuts that are hard to reach)

Other



 Flathead Plier (for removing terminals on Safety Control Board and Current Distributor)

5.2. Robot Arm

5.2.1. Before returning any part to Universal Robots

- Remove all external non-UR equipment such as grippers, hoses, cables and so on. Universal Robots cannot be held responsible for damage caused to non-UR equipment mounted on the robot.
- Backup all relevant files before sending the robot/part to UR. Universal Robots cannot be held responsible for loss of programs, data or files stored in the robot.

NOTICE

If the robot/part has been in contact with, or working in environments, where dangerous chemicals or materials are present, the robot must be cleaned before shipment. If this is not possible, the shipment must be accompanied by an MSDA (Material Safety Data Sheet) in English and instructions for cleaning the chemicals. The amount of labor hours needed for cleaning will be billed at the standard rate.

If UR finds the robot/part unsafe to service, UR reserve the right to get the robot/part cleaned or decline the case and send the part back, at customers expense.

Note: Please note that the robot will be updated to newest software/firmware when repaired. New parts will also be updated to newest version (hardware/software). Therefore, updating PolyScope may be necessary when new parts are mounted.

You will find packing down procedure in section - Packing of robot

UR3 16 Service Manual



5.2.2. Robot Arm Configuration

Tool flange
Size 0
Size 0
Size 0
Elbow
Size 1
Size 2
Size 2

Tool flange - Wrist 3 joint

Wrist 3 joint - Wrist 2 joint

Wrist 2 joint - Wrist 1 joint

Wrist 1 joint - Lower arm

5.2.9. Elbow counterpart – Elbow joint on

page 32

Upper arm - Shoulder joint

Upper arm - Shoulder joint

Shoulder joint - Base joint

Base joint - Base mounting bracket

5.2.3. Brake Release

Base

In an urgent situation the brake on Base, Shoulder and Elbow joints can be released without power connected. It is not possible to release the brakes on Wrist 1, 2 and 3 manually.

CAUTION

Before releasing a brake, it is extremely important to dismount any dangerous parts to avoid any hazardous situations.

If releasing the brake on Base joint, Shoulder joint or Elbow joint, it is important to make proper mechanical support prior to releasing the brake.

Always make sure personnel are in no risk when releasing the brake.

Do not move the joint more than is necessary. Not more than 160 degrees to ensure the robot can find its original physical position.

Procedure for releasing the joint

- · Shut down controller.
- Remove blue lid on joint.
- Push brake pin down to release, joint can then be rotated.
 On the Wrist 1, 2 and 3 it is not possible to release the brakes manually.

UNIVERSAL ROBOTS








Brake on Elbow joints

- · Make sure to replace blue lid onto joint correctly and fasten screws before turning on controller.
- · Correct torque value for screws on blue lids are 0.4Nm


5.2.4. General Guidance to Separate Joint from Counterpart

Disassemble:


- 1. Ensure that the necessary tools and documentation are available before starting the repair.
 - 1. Service kit with torque tools, ESD Wristband, etc.
 - 2. If you must disassemble the robot arm you need: new flat rings, M3 and M4 tap tool for threads, pre-coated screws or Loctite.
 - 3. Thoroughly read and understand this guide.
- 2. Move the robot to a comfortable position for disassembly or if necessary dismount entire robot arm from work cell and place on a solid surface.
- 3. Shut down the controller.
- 4. Remove blue lid.
- 5. Reattach one of the screws from the blue lids and connect the Alligator Clip from the ESD wristband to it, as shown below.

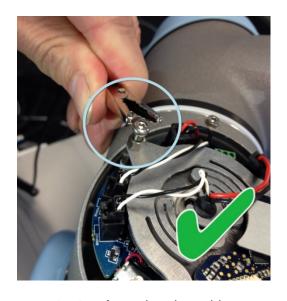



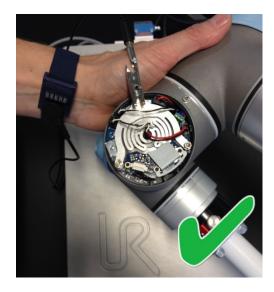

6. **Gently** unplug the cable connectors **without bending the printed circuit board.**Some connectors have a lock that must be engaged before it is pulled out of the printed circuit board. Example below.

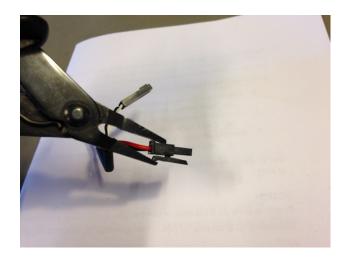



7. After disconnecting the wires gently remove black flexible flat ring with a small flathead screwdriver or similar tool and pull it back over joint housing away from its original position.





8. Slide back the black Teflon ring (Marked with red in the below diagram) now 6, 8 or 10 screws (depending on the joint size) will become visible beneath the ring. Proceed to remove these screws.





9. Pull the two parts gently apart.



Assemble:

After replacing a joint do as follows to assemble the robot arm.

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.




Always use new pre-coated screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

NOTICE

Always replace the black flexible flat ring to maintain the IP classification.


1. Orientate the joints according to the alignment marks and gently push the two joints together.

(In the below drawing the alignment marks are indicated with red)

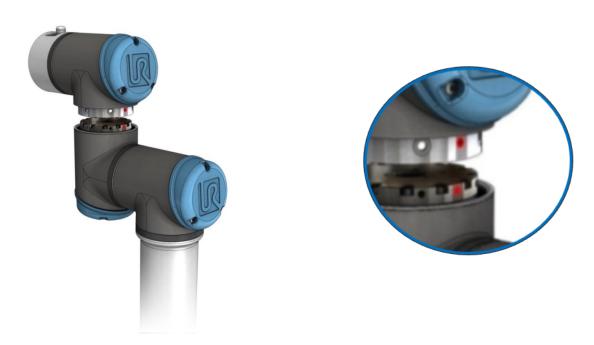

2. Insert and tighten the countersunk hex screws according to below example and with correct torque.


Example: 1, 2, 3

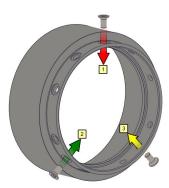

3. Insert and cross tighten the hex screws according to below example and with correct torque.

Example: 1A, 1B, 2A, 2B etc.

UR3 22 Service Manual

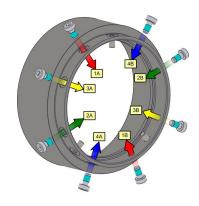

4. Slide the black Teflon ring (Indicated with red) into place and gently put the new flat ring




back on top of the Teflon ring.



5. Connect the cables:

Size 0 joint.



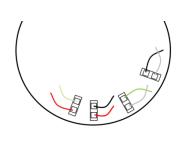


Twist the communication cable 1.5 to 2 full rounds before connection To reduce electrical noise in the system.

Size 1 joint:


6.



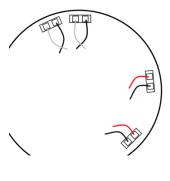

Size 2 joint



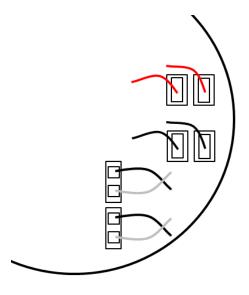

- 7. **Twist the communication cable** 1.5 to 2 full rounds before connection to reduce electrical noise in the system.
- 8. Mount the blue lid on the joint and tighten with **0.4Nm**
- 9. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.5. Torque values

| UR3 torque values | | | |
|-----------------------|-----------------------|--------|-----------|
| CONNECTION | | TORQUE | HEAD SIZE |
| Base mounting bracket | J0 Base | 3.0Nm | Torx T20 |
| [J0] Base | [J1] Shoulder | 3.0Nm | Torx T20 |
| [J1] Shoulder | Upper arm | 3.0Nm | Torx T20 |
| Upper arm | [J2] Elbow | 1.3Nm | Torx T10 |
| [J2] Elbow | Lower arm | 1.3Nm | Torx T10 |
| Lower arm | [J3] Wrist 1 | 1.3Nm | Torx T10 |
| [J3] Wrist 1 | [J4] Wrist 2 | 1.3Nm | Torx T10 |
| [J4] Wrist 2 | [J5] Wrist 3 | 1.3Nm | Torx T10 |
| [J5] Wrist 3 | Tool mounting bracket | 1.3Nm | Torx T10 |




UNIVERSAL ROBOTS

| Blue lid: Base, Shoulder and Elbow | 1.3Nm | Torx T10 |
|--|-------|-------------|
| Blue lid: Wrist 1, Wrist 2 and Wrist 3 | 1.3Nm | Torx T8 |
| Tool Connector | 1.3Nm | Finger/Hand |

NOTE

Click the torque tools 3 times before using to ensure the correct calibrated torque.

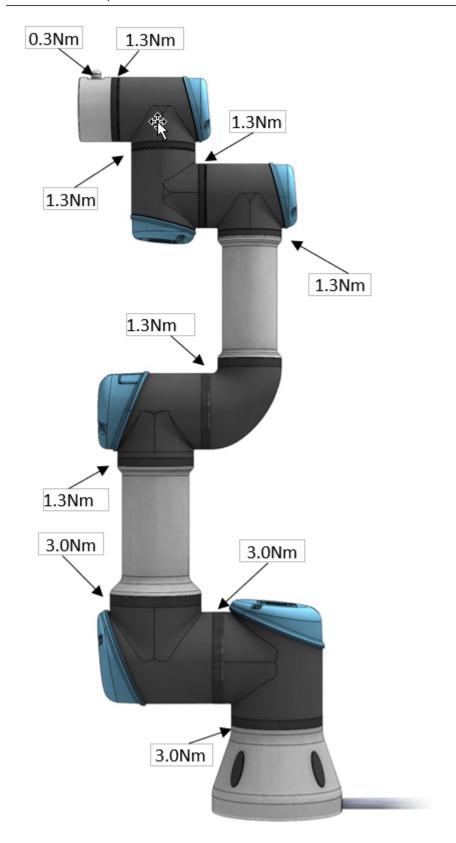

5.2.6. Base joint – Base mounting bracket

Disassemble

Copyright @ 2009-2021 by Universal Robots A/S. All rights reserved.

For details and photos please see: General Guidance to Separate Joint from Counterpart

- 1. Shut down the controller.
- 2. Remove black flexible flat ring with a small flathead screwdriver or similar tool and pull it back over joint housing away from it's original position.
- 3. Slide back the black Teflon ring. Screws become visible. Loosen the screws.
- 4. Pull the Base mounting bracket and Base joint gently apart.
- 5. Disconnect wires from the EMC filter in the Base mounting bracket.

Assemble

For details and photos please see: General Guidance to Separate Joint from Counterpart

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new **pre-coated** screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

1. Replace Base mounting bracket and reconnect wires to the EMC filter.

Twist the communication cable 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

1 x red wire = 48V DC 1 x black wire = GND

White and black = bus connector

2. Orientate the joint and Base mounting bracket according to the alignment marks and gently push them together.

UR3 28 Service Manual

3. Press the base and base mounting bracket together gently to align the screw holes in the two parts before inserting the screws.



- 4. Gently tighten the screws, and then tighten in cross order with 3.0Nm.
- 5. Slide the black Teflon ring into place and gently put the flat ring back on top of the Teflon ring.
- 6. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.7. Shoulder joint – Base joint

Disassemble

For details and photos please see: General Guidance to Separate Joint from Counterpart



- 1. Shut down the controller.
- 2. Remove blue lid on Base joint and connect ESD wristband.
- 3. Disconnect wires between Base joint and Shoulder joint. Without bending the printed circuit board.

Copyright © 2009-2021 by Universal Robots A/S. All rights reserved.

- 4. After disconnecting the wires gently remove black flexible flat ring with a tiny screwdriver and twist it around the joint housing.
- 5. Slide back the black Teflon ring. screws become visible. Loosen the screws.
- 6. Pull the Base joint and Shoulder joint gently apart.

Assemble

For details and photos please see: General Guidance to Separate Joint from Counterpart

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new **pre-coated** screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

- 1. Orientate the Base joint and Shoulder joint according to the marks and gently push them together.
- 2. Gently tighten the screws, and then tighten in cross order with 3.0Nm.
- 3. Slide the black Teflon ring into place and gently put the flat ring back on top of the Teflon ring.



- 4. Connect ESD wristband.
- 5. **Twist the communication cable** 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

1 x red wire = 48V DC 1 x black wire = GND

White and black = bus connector

- 6. After connection of the wires then mount the blue lid and tighten with **0.4Nm**.
- 7. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.8. Upper arm – Shoulder joint

Disassemble

UR3 30 Service Manual



For details and photos please see: General Guidance to Separate Joint from Counterpart

- 1. Shut down the controller.
- 2. Remove blue lid on Shoulder joint and connect ESD wristband.
- 3. Disconnect wires between Shoulder joint and Upper arm. Without bending the printed circuit board.
- 4. After disconnecting the wires gently remove black flexible flat ring with a tiny screwdriver and twist it around the Upper arm. Loosen the screws.
- 5. Pull the Shoulder joint and Upper arm gently apart.

Assemble

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new **pre-coated** screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

NOTICE

Always replace the black flexible flat ring to maintain the IP classification.

- 1. Orientate the Base joint and Shoulder joint according to the marks and gently push them together.
- 2. Gently tighten the screws, and then tighten in cross order with 3.0Nm.
- 3. Slide the black Teflon ring into place and gently put the flat ring back on top of the Teflon ring.



4. Connect ESD wristband.

5. Twist the communication cable 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

1 x red wire = 48V DC 1 x black wire = GND

White and black = bus connector

- 6. After connection of the wires then mount the blue lid and tighten with **0.4Nm**.
- 7. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.9. Elbow counterpart – Elbow joint

Disassemble


For details and photos please see: General Guidance to Separate Joint from Counterpart

- 1. Shut down the controller.
- 2. Remove black flexible flat ring with a tiny screwdriver and twist it around the joint housing.
- 3. Screws become visible. Loosen the screws.
- 4. Pull the Elbow joint and Elbow counterpart gently apart.
- 5. Disconnect wires.

Without bending the printed circuit board.

Some connectors have a lock that must be engaged before it is pulled out of the printed circuit board.

Example below:

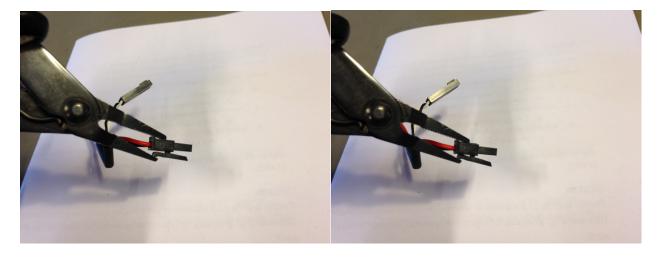

Assemble

For details and photos please see: General Guidance to Separate Joint from Counterpart



Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new **pre-coated** screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

NOTICE

Always replace the black flexible flat ring to maintain the IP classification.

- 1. Reconnect connectors.
- 2. **Twist the communication cable** 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

 $1 \times \text{red wire}$ = 48V DC $1 \times \text{black wire}$ = GND

White and black = bus connector

- 3. Orientate the joint and Elbow counterpart according to the marks and gently push them together.
- 4. Gently tighten the screws, and then tighten in cross order with 1.3Nm.
- 5. Put the flat ring back on top of the screws.
- 6. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.10. Wrist 1 joint – Lower arm

Disassemble

For details and photos please see: General Guidance to Separate Joint from Counterpart






- 1. Shut down the controller.
- 2. Remove blue lid on Wrist 1 joint and connect ESD wristband.
- 3. Disconnect wires between Wrist 1 joint and Lower arm.

Without bending the printed circuit board.

Some connectors have a lock that must be engaged before it is pulled out of the printed circuit board.

Example below.

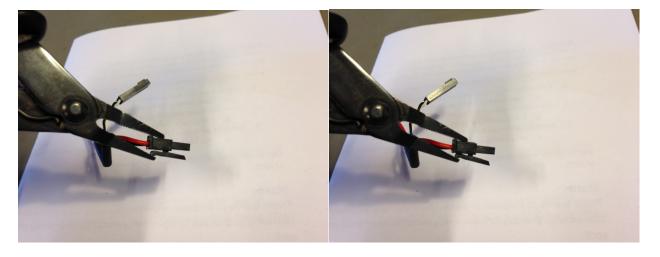

- 4. After disconnecting the wires, gently remove black flexible flat ring with a tiny screwdriver and twist it around the Lower arm.
- 5. Remove the plastic cover ring. screws become visible. Loosen the screws.
- 6. Pull the Wrist 1 joint and Lower arm gently apart.

Assemble

For details and photos please see: General Guidance to Separate Joint from Counterpart

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new **pre-coated** screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

NOTICE

Always replace the black flexible flat ring to maintain the IP classification.



- 1. Orientate the Wrist 1 joint and Lower arm according to the marks and gently push them together.
- 2. Gently tighten the screws, and then tighten in cross order with 1.3Nm.
- 3. Place the plastic cover ring according to the mark on the flange.



4. **Twist the communication cable** 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

1 x red wire = 48V DC 1 x black wire = GND

White and black = bus connector

- 5. After connection of the wires then mount the blue lid and tighten with **0.4Nm**.
- 6. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.11. Wrist 2 joint – Wrist 1 joint

Disassemble


For details and photos please see: General Guidance to Separate Joint from Counterpart



1. Shut down the controller.

UNIVERSAL ROBOTS

- 2. Remove blue lid on Wrist 2 and connect ESD wristband.
- 3. Disconnect wires between Wrist 1 joint and Wrist2 joint without bending the printed circuit board. Some connectors have a lock that must be engaged before it is pulled out of the printed circuit board. Example below.

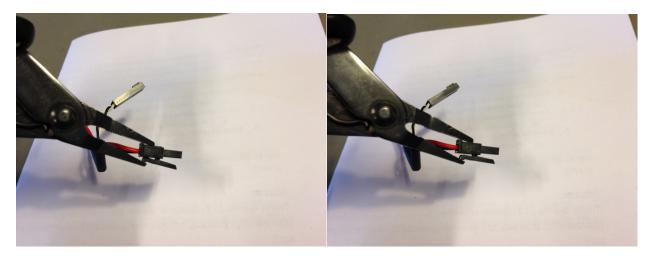

- 4. After disconnecting the wires gently remove black flexible flat ring with a tiny screwdriver and twist it around the joint housing.
- 5. Pull the Wrist 2 joint and Wrist 1 joint gently apart.

Assemble

For details and photos please see: General Guidance to Separate Joint from Counterpart

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new pre-coated screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

NOTICE

Always replace the black flexible flat ring to maintain the IP classification.

Copyright © 2009-2021 by Universal Robots A/S. All rights reserved.

- 1. Orientate the Elbow joint and Upper arm according to the marks and gently push them together.
- 2. Orientate the Wrist 2 joint and Wrist 1 joint according to the marks and gently push them together.
- 3. Gently tighten the screws, and then tighten in cross order with 1.3Nm.
- 4. Place the plastic cover ring according to the mark on the flange.



- 5. Gently put the flat ring back on top of the Teflon ring.
- 6. Connect ESD wristband.
- 7. **Twist the communication cable** 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

1 x red wire = 48V DC 1 x black wire = GND

White and black = bus connector

- 8. After connection of the wires then mount the blue lid and tighten with **0.4Nm**.
- 9. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.12. Wrist 3 joint – Wrist 2 joint

Disassemble and assemble

Procedure for separating Wrist 3 joint from Wrist 2 is similar to separation of Wrist 2 joint and Wrist 1 joint, consult chapter Wrist 2 joint – Wrist 1 joint

5.2.13. Tool flange - Wrist 3 joint

Disassemble

For details and photos please see: General Guidance to Separate Joint from Counterpart

37






- 1. Shut down the controller.
- 2. Remove black flexible flat ring with a tiny screwdriver and twist it around the joint housing.
- 3. Remove the plastic cover ring. screws become visible. Loosen the screws.
- 4. Connect ESD wristband.
- 5. Pull the Tool flange and Wrist 3 joint gently apart.
- 6. Disconnect wires.

without bending the printed circuit board.

Some connectors have a lock that must be engaged before it is pulled out of the printed circuit board.

Example below:

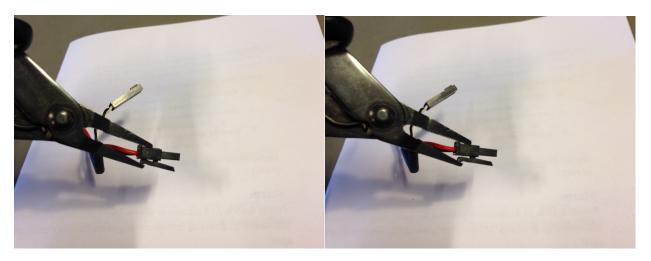

Assemble

For details and photos please see: General Guidance to Separate Joint from Counterpart

WARNING

Remove Loctite residue inform screw holes using an M3 (M4 for Size 2) tap tool for threads before assembling the joint to get the correct torque on the new screws.



Always use new **pre-coated** screws where possible. If you must assemble with old screws carefully clean the screws and apply Loctite 243 to the threads before assembly.

NOTICE

Always replace the black flexible flat ring to maintain the IP classification.



- 1. Orientate the Elbow joint and Upper arm according to the marks and gently push them together.
- 2. Reconnect connectors.
- 3. **Twist the communication cable** 1.5 to 2 full rounds before it is connected to reduce electrical noise in the system.

1 x red wire = 48V DC 1 x black wire = GND

White and black = bus connector





- 4. Orientate the Tool flange and Wrist 3 joint according to the marks and gently push them together.
- 5. Place the plastic cover ring according to the mark on the flange.



- UNIVERSAL ROBOTS
 - 6. Gently tighten the screws, and then tighten in cross order with 1.3Nm.
 - 7. Slide the black Teflon ring into place and gently put the flat ring back on top of the Teflon
 - 8. Proceed to Dual Robot Calibration for instructions on how to calibrate the robot.

5.2.14. Instructions for Calibrating a Joint

After replacement, calibration of the new joint is required in order to find the correct zero position.

If it is possible (a dual robot calibration kit and second robot of the same model are available) and necessary (highest possible positional accuracy, and minimal deviation from positions taught prior to joint replacement are required), perform the Dual Robot Calibration Alternatively perform a simple joint calibration as shown below.

Instructions for calibrating a joint:

1. Jog robot to HOME position


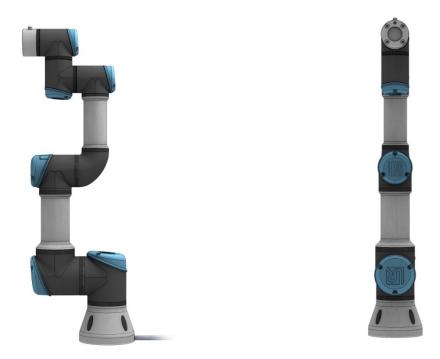


Illustration shows the HOME position, which is defined as zero position of all joints.


2. Swipe from left to right across the UNIVERSAL ROBOTS logo on main screen of PolyScope.



3. Enter password *lightbot* and press *OK*.

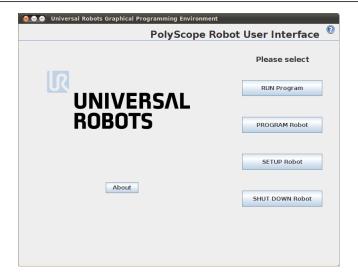

4. You are now in Expert Mode, press Low Level Control.

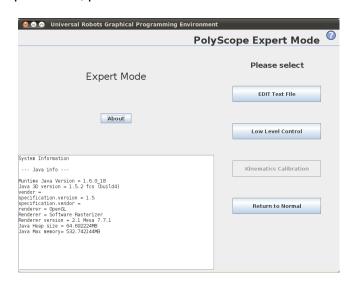




WARNING

In Low Level Control, only the safety settings in the Polyscope Installation tab are active.


The protective stop is NOT active.

Set all safety settings to their lowest settings before moving the robot.


5. Press Turn power on to enable power to joints.

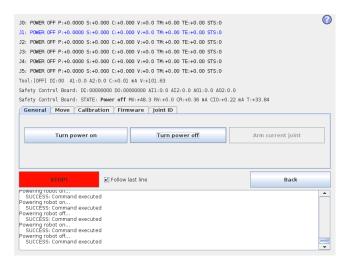


6. Press Go to Idle to put joints into ready mode.

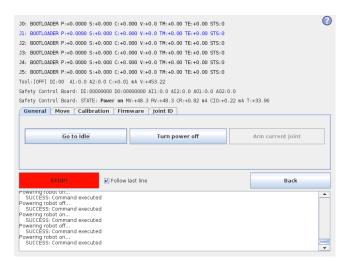

7. Select the desired joint by directly clicking the status line for that joint. Currently selected joint is highlighted in blue.

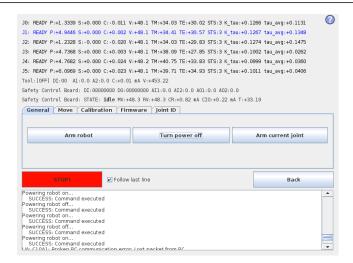


8. Press Arm current joint to release the brake on the selected joint.

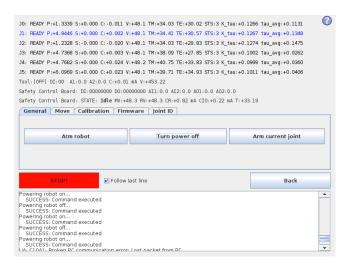

Use the Up and Down buttons in the Move window to rotate the joint to the correct zero position according to the following illustrations.

Press STOP when the joint is in the correct position.

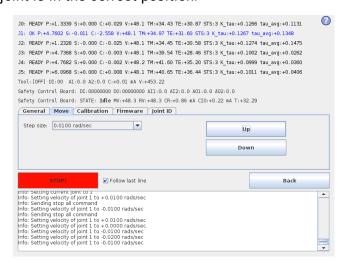

9. Zero position illustrations

Base: Shoulder, Elbow, Wrist 1:





Base zero position is aligned so that the output flange is offset 180 degrees from the cable at the back of the robot base.


Wrist 2:


1 output flange.

Shoulder, Elbow and Wrist 1 zero output flange vertically aligned (assuming Base is horizontal).

Make sure that base of robot is horizontal, use spirit level to align joints.

Wrist 3:

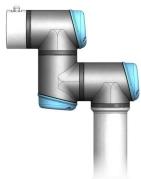


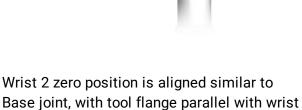




Wrist 3 zero position is aligned so tool connector is pointing upward. Mount two bolts in tool holes and use spirit level to align joint.


10. Select Calibration tab and press Zero current joint position to calibrate the joint.

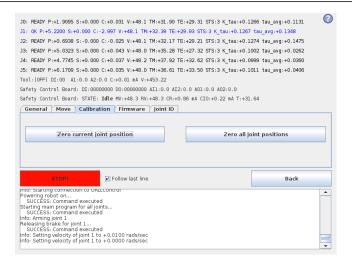

10. Press Back to exit Low Level Control.

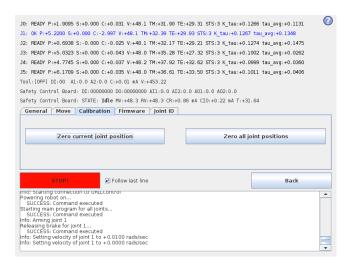

12. Press Return to Normal.

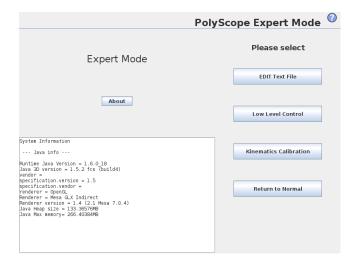

13. Verify zero position by moving the robot to HOME. If not satisfied with the zero position, perform the procedure once again.



5.2.15. Dual Robot Calibration

Dual Robot Calibration kit (Part no: 185500)

The Dual Robot Calibration process calibrates the robot across its full workspace. All robots are Dual Robot Calibrated before leaving the factory.

If a joint has been replaced, then the factory calibration is no longer valid.

There are 2 options:

- Performing a Dual Robot Calibration after replacement of a joint will allow the robot to continue in the production line without modifying waypoints in the robot program. To perform a Dual Robot Calibration, you need: 2 robots (same size and same generation), calibration Horse and calibration tool connector. Go to www.universal-robots.com/support/ration Manual in PDF format.
- Simple Joint calibration (as described in Instructions of calibrating a joint). After replacing a joint the zero position of the joint can be adjusted but the quality of calibration will not be as good as that achieved by the Dual Robot Calibration method. Adjustment of program waypoints will likely be required.

5.2.16. Change joint ID

Each joint has a unique ID no. Having two joints with the same ID on a robot will cause communication problems and the robot will not be able to operate.

| ID | Joint |
|----|----------|
| J0 | Base |
| J1 | Shoulder |
| J2 | Elbow |
| J3 | Wrist 1 |
| J4 | Wrist 2 |
| J5 | Wrist 3 |

Example:

Wrist 1 (J3) needs to be replaced. Spare joint is a Wrist 3 (J5)

UR3 46 Service Manual

- 1. Disconnect the joint with correct ID no.
- 2. Enter Low Level Control
- 3. Press Turn power on and the connected joints enter BOOTLOADER mod



4. Press Go to Idle and the connected joints enter READY mode



- 5. Select Joint ID tab
- 6. Select J5 (The one to be changed)
- 7. Uncheck "Exchange IDs" box
- 8. In dropdown box, select ID no. 3
- 9. Press Set it





10. Confirm Change ID



11. When the robot is powered on again, J5 will be displayed as J3.




5.2.17. Joint Spare Part Adaptation

The UR3 consist of three different joint sizes:

Recommended spare joints for UR3 are marked with:

To use a wrist 3 joint as wrist 1 or wrist 2 it is necessary to modify the joint. See Modify Wrist 3 to Wrist 1 or Wrist2

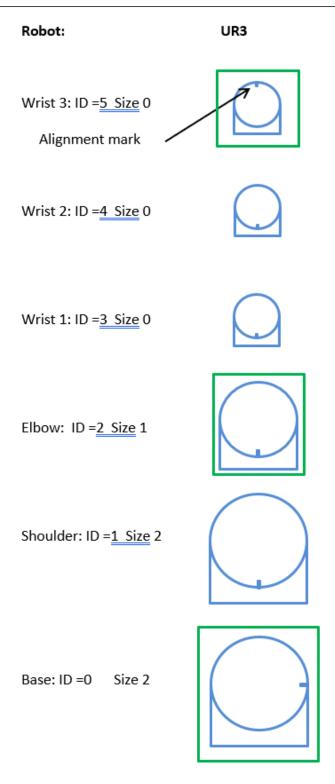

5.2.18. Modify Wrist 3 to Wrist 1 or Wrist2

- 1. Mechanical parts must be replaced.
- 2. The orientation of the output flange must be changed
- 3. The joint ID must be modified.

Use the ESD guidelines for the modification of the wrist see: 3.0.0 Handling ESD-sensitive parts















The Wrist 3 has the slipring for infinite turning of the tool mounting bracket.

Cut the wires for the slipring

Unscrew the Slipring (Use a T8 screwdriver)

Remove the Slipring gently

The removed slipring with screws Parts for wrist 1 and wrist 2

Attach the plastic protection. (Use a T6 screwdriver, Torque 0,32Nm)

Put the wires through the joint and attach and assemble the connectors for the communication and power. There is no cable tie for this joint. NB! Pull gently in each wire to be sure the connector is attached correct in the plastic part of the connector.

Adjust the joint orientation. See: Instructions for Calibrating a Joint Changing the joint ID See Change joint ID

5.2.19. Wire bundle installation guide

General

As well as the Wire bundle kit for the correct joint size, the Following ESD approved tools are recommended for this replacement:

- · Tool for pressing in the pins
- · Small flat nose plier
- · Cable tie tension and cutting tool
- · Small flathead screwdriver
- Tweezers
- · Crimping tool for cable shoes


Time expected: 20min (joint disassembly time not included)

Size 0 - part number: 103500

Note: wrist 3 needs to be send to UR for repair




Inset wire bundle as shown on photo

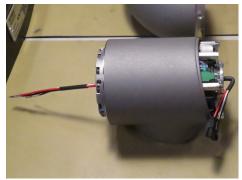


Should look like the photo when done



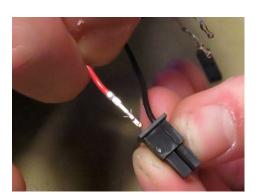

Inset the power and communications plug - see photo example


- Take the power connector.
- · When inserting the connector pins, make sure the barbs, shown with green arrows, are located as shown on the photo. If not, they will not hook inside the connector and will fall out.
- · Insert the black connector pin into the plug hole marked with a line also shown with red arrow. Remember to orientate the barbs as described above.
- · Insert the red into the other plug hole.
- · When done, check that the connector pins are firmly hooked inside the plug by pulling gently in the wires.
- · If not, check that the orientation of the barbs is correct. If they are correctly inserted, use a tool to press on the pins to ensure they are pushed all the way in.

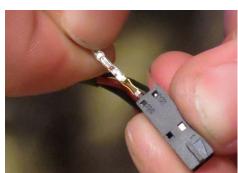




- · Take the communication connector.
- · When inserting the connector pins, make sure the barbs, shown with green arrows, are located as shown on the photo. If not, they will not hook inside the connector and will fall out.
- · Inset the black connector pin into the plug hole marked "MX". Remember to orientate the barbs as described above. A "click" will be heard when inserted correctly.
- Inset the white pin in the other plug hole.
- · When done, check that the connector pins are firmly hooked inside the plug by pulling gently in the wires.
- · If not, check that the orientation of the barbs is correct. If inserted correctly, use a tool to press on the pins to ensure they are pushed all the way in

Size 1 - part number: 103501

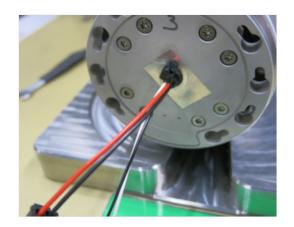


· Inset wire bundle as shown on photo, with the cable tie towards the flange.

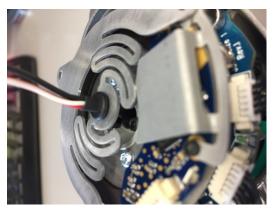


 Mount the grommet into the flex plate with the tweezers or the small flat nose screwdriver.




 Hold the heat shrink with tweezers while sliding down the grommet.

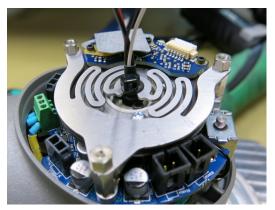

- Mount a cable tie on top of the grommet.
- Tighten and cut it off with the cable tie tool.

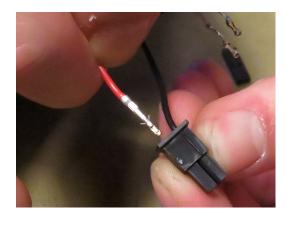

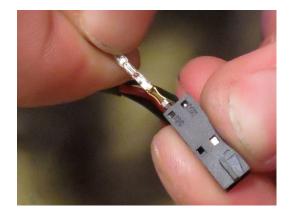


- · Take the power connector:
- When inserting the connector pins, make sure the barbs, shown with green arrows, are located as shown on the photo. If not, they will not hook inside the connector and will fall out.
- Insert the black connector pin into the plug hole marked with a line – also shown with red arrow. Remember to orientate the barbs as described above.
- · Insert the red into the other plug hole.
- When done, check that the connector pins are firmly hooked inside the plug by pulling gently in the wires.
- If not, check that the orientation of the barbs is correct. If they are correctly inserted, use a tool to press on the pins to ensure they are pushed all the way in.
- · Take the communication connector:
- When inserting the connector pins, make sure the barbs, shown with green arrows, are located as shown on the photo. If not, they will not hook inside the connector and will fall out.
- Inset the black connector pin into the plug hole marked "MX". Remember to orientate the barbs as described above. A "click" will be heard when inserted correctly.
- · Inset the white pin in the other plug hole.
- When done, check that the connector pins are firmly hooked inside the plug by pulling gently in the wires.
- If not, check that the orientation of the barbs is correct. If inserted correctly, use a tool to press on the pins to ensure they are pushed all the way in.




 When connecting to the tool flange, you will need to tighten a loose knot, on the communication wire, in order to shorten it. This will minimize the risk of squeezing the wire.

Size 2 - part number: 103502

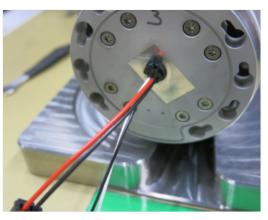


 Inset wire bundle as shown on photo, with the cable tie towards the flange.

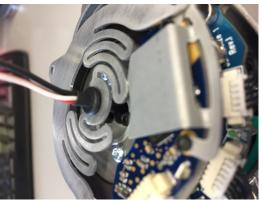

 Mount the grommet into the flex plate with the tweezers or the small flat nose screwdriver.




• Hold the heat shrink with tweezers while sliding down the grommet.

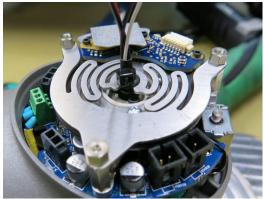


- Mount a cable tie on top of the grommet.
- Tighten and cut it off with the cable tie tool.



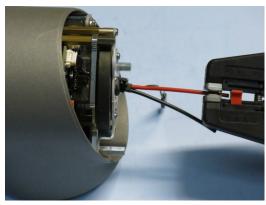



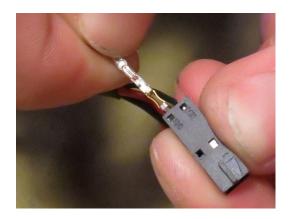

- · Take the power connector:
- When inserting the connector pins, make sure the barbs, shown with green arrows, are located as shown on the photo. If not, they will not hook inside the connector and will fall out.
- Insert the black connector pin into the plug hole marked with a line – also shown with red arrow. Remember to orientate the barbs as described above.
- · Insert the red into the other plug hole.
- When done, check that the connector pins are firmly hooked inside the plug by pulling gently in the wires.
- If not, check that the orientation of the barbs is correct. If they are correctly inserted, use a tool to press on the pins to ensure they are pushed all the way in.
- · Take the communication connector:
- When inserting the connector pins, make sure the barbs, shown with green arrows, are located as shown on the photo. If not, they will not hook inside the connector and will fall out.
- Inset the black connector pin into the plug hole marked "MX". Remember to orientate the barbs as described above. A "click" will be heard when inserted correctly.
- · Inset the white pin in the other plug hole.
- When done, check that the connector pins are firmly hooked inside the plug by pulling gently in the wires.
- If not, check that the orientation of the barbs is correct. If inserted correctly, use a tool to press on the pins to ensure they are pushed all the way in.

Lower arm - part number: 103508

NOTICE

The lower arm wire bundle kit contains wire bundle for multiple robot types. Please be sure use the correct length.







- In order to mount a new wire bundle in the UR3 lower arm, it is recommended to remove the elbow. This should make the job easier.
- The wire bundle is different in each end and need to be inserted correct.
- It is important that the long wire section after the small grommet must be as shown on the photo.
- With the elbow unmounted, the large grommet needs to be placed in the end shown on the photo, if not already mounted

 Slide the long end of wires down the lower arm



Connect the elbow and lower arm –
please see Service manual for full
details how this is done.




 The small grommet now need to be pressed onto the bracket.

Upper arm - part number: 103509

NOTE

The lower arm wire bundle kit contains wire bundle for multiple robot types. Please be sure use the correct length.

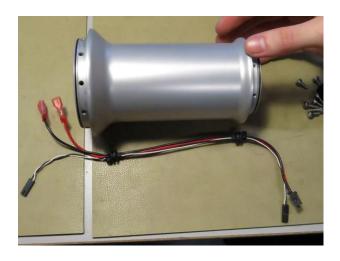

 Slide the wire bundle through the upper arm with the two red cable shoes towards the small diameter end of the upper arm.



· Push the grommet onto the bracket

5.3. Controller

5.3.1. Replacement of Motherboard 3.1

Replace Motherboard

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.


Follow the first 3 steps in section Complete rebooting sequence.

When completing the following replacement, please follow the guidelines laid out in section Handling ESD-sensitive parts



How to replace motherboard 3.1

1. Shut down the controller and disconnect the power cable, open the controller cabinet, and remove the 3 torx screws (4 screws on Merge Control Box)

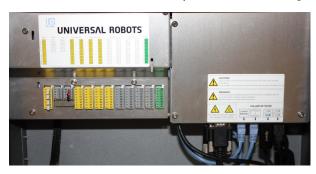



2. Remove the aluminum cover plate



- 3. Disconnect cable connections from motherboard
 - 1. White plug with white, brown, yellow and green wires, 12 V Power
 - 2. DVI-cable for TP screen
 - 3. Ethernet cable to Safety Control Board SCB
 - 4. Ethernet cable to external connector

- 5. Black USB cable for TP USB connector
- 6. Grey flat cable for RS232-connection for TP touch



4. Remove the 4 screws from the 2 holding brackets



- 5. Replace Motherboard.
- 6. Insert the 6 cables in correct connectors. Pay special attention to the Ethernet cable to the Safety Control Board. It must be connected to the right connector on the mother board
- 7. Re-install USB stick for UR system Software.
- 8. Carefully put back the aluminum cover plate, make sure to mount it correctly and fix it with the 3 screws

5.3.2. Replacement of Safety Control Board

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.

When completing the following replacement, please follow the guidelines laid out in section Handling ESD-sensitive parts




To replace Safety Control Board in Controller box:


Check that the software on the robot is not older than the firmware version on the SCB.
 If the software on the robot is older, error C203A0 will be displayed.
 The SCB firmware version can be found on the Ethernet connector.



This can also be found in the "About" menu. Shortcut to "About", by clicking on the UR logo in the top right corner of the screen is available from software version 3.2.18642

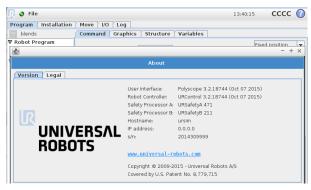


2. Shut down the controller and disconnect the power cable, open the controller cabinet then carefully remove all plugs and connectors.

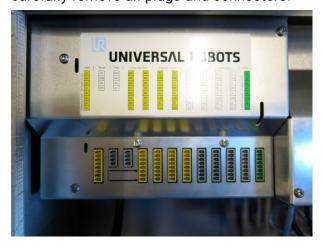

3. Remove the 5 torx screws and followed by the aluminum cover.




4. Carefully remove all plugs and connectors from the Safety Control Board.

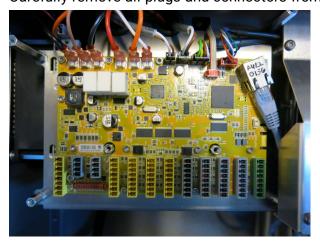



5. Remove the 14 screws holding the board in place.

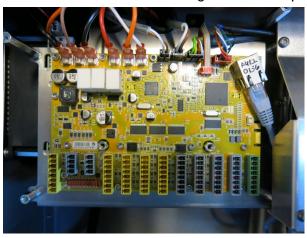

- 6. Replace Safety Control Board with new one and tighten the 14 screws to fasten the board in place.
- 7. Insert all connectors and plugs back into their correct positions.
- 8. Carefully attach the aluminum cover, making sure to mount it correct and fix it with the 5 screws.

If unsure of the correct positions consult.

5.3.3. Replacement of Teach Pendant

Original Control Box

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.

When completing the following replacement, please follow the guidelines laid out in section 3.0 Handling ESD-sensitive parts





Use the same procedure for power down and removing the aluminum cover plates as in chapter, Replacement of Motherboard 3.1 or Replacement of Safety Control Board

- 1. Disconnect 4 cables:
 - 1. Red plug with black cable 12 V Power
 - 2. Black DVI cable for the TP screen
 - 3. Black USB cable For the TP USB connector
 - 4. Black cable for RS232-connection for the TP touchscreen



2. Remove the bracket (foot of the controller box) that holds the cable inlet and pull out the cables and plugs through this hole.



- 3. To install new teach pendant, thread cables through inlet, plug connectors into correct positions, then mount aluminum cover into place.
- 4. Connect power and verify that teach pendant functions correctly.

See diagram:



Merge Control Box

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.



When completing the following replacement, please follow the guidelines laid out in section 3.0 Handling ESD-sensitive parts

NOTE

Use the same procedure for power down and removing the aluminum cover plates as in chapter, 3.2.1 Replacement of Motherboard 3.1 or 3.2.2 Replacement of Safety Control Board

- 1. Disconnect 4 cables:
 - 1. Red plug with black cable
 - 2. Black DVI cable
 - 3. Black USB cable
 - 4. Black cable for RS232-connection to touchscreen




2. Remove the bracket by removing the 8 torx screws and that hold it in place.



3. Pull the two plates apart



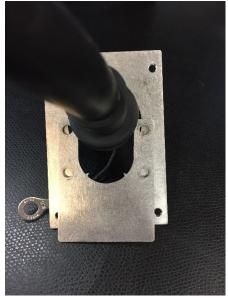



- 4. To install new teach pendant, thread cables through inlet, plug connectors into correct positions, then mount aluminum cover into place.
- 5. Connect power and verify that teach pendant functions correctly.

See diagram: Schematic overview

5.3.4. Replacement of 48V power supply

Original Control Box

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.



When completing the following replacement, please follow the guidelines laid out in section 3.0 Handling ESD-sensitive parts

NOTE


Use the same procedure for power down and removing the aluminum cover plates as in chapter, 3.2.1 Replacement of Motherboard 3.1 or 3.2.2 Replacement of Safety Control Board

To replace 48V power supply in controller box:

- 1. Remove teach pendent cable see previous section
- 2. Detach the controller box handle by removing the 2 screws holding it in place.




3. Disconnect the 2 wires for the energy eater and fan.

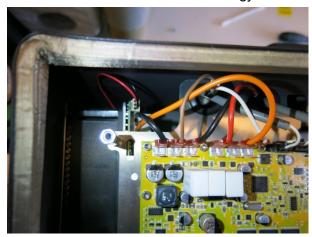

4. Remove the 2 nuts (M6) in the bottom of controller module.



- 5. Gently take out the controller module from the controller box.
- 6. Turn the module 90° counterclockwise and place it on the controller edge.
- 7. Cut the cable tie that tied to the robot cable, unplug the connectors from the Safety Control Board and remove the cable.

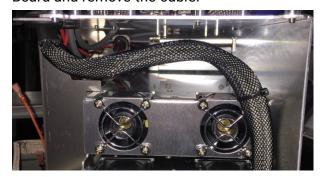

8. Turn the module 180° clockwise and place it on the controller edge.

UNIVERSAL ROBOTS

9. Remove the power connection on the current distributor. The module is not loose from the controller.



- 10. Power supplies are located in the rack under the controller module, the two 48V power supplies are the lower ones in the rack (UR3 and UR5 has one and UR10 has two 48V power supplies).
 - Before removing the 48V power supply, label the wires then disconnect them from that supply.
- 11. Remove the screws keeping the defective 48V power supply in place from the side of the rack.





- 12. Replace the defect 48V power supply with the new one.
- 13. Reconnect the wires for the 48V power supply.
- 14. Reinstall controller module in reverse order and reconnect the 2 wires for the fan and cables for the teach pendant.
- 15. Carefully put back the aluminum cover plate, making sure to mount it correctly and fix into place with the screws.
- 16. Connect power and verify that teach pendant works properly.

Merge Control Box

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.



When completing the following replacement, please follow the guidelines laid out in section 3.0 Handling ESD-sensitive parts


NOTE

Use the same procedure for power down and removing the aluminum cover plates as in chapter, 3.2.1 Replacement of Motherboard 3.1 or 3.2.2 Replacement of Safety Control Board


To replace 48V power supply in controller box:




- 1. Remove teach pendent cable see previous section
- 2. Disconnect all the marked wires from the SCB.

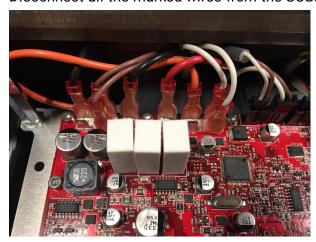


3. Remove the 4 nuts (M6) in the top and bottom of controller module.

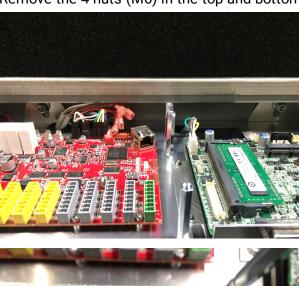

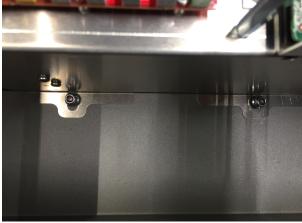

- 4. Gently take out the controller module from the controller box.
- 5. Turn the module 90° counterclockwise and place it on the controller edge.

6. Cut the cable tie that ties the robot cable, unplug the connectors from the Safety Control Board and remove the cable.

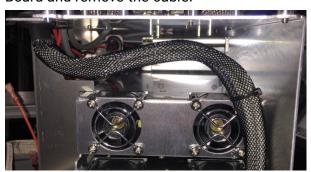

- 7. Turn the module 180° clockwise and place it on the controller edge.
- 8. Remove the power connection on the current distributor. The module is now loose from the controller.



- 9. Power supplies are located in the rack under the controller module, the two 48V power supplies are the lower ones in the rack (UR3 and UR5 has one and UR10 has two 48V power supplies).
 - Before removing the 48V power supply, label the wires then disconnect them from that supply.

UNIVERSAL ROBOTS

10. Remove the screws keeping the defective 48V power supply in place from the side of the rack.





- 11. Replace the defect 48V power supply with the new one.
- 12. Reconnect the wires for the 48V power supply.
- 13. Reinstall controller module in reverse order attached all wire and mount the 4 bolts with 2,25 Nm.
- 14. Carefully put back the aluminum cover plate, making sure to mount it correctly and fix into place with the screws.
- 15. Connect power and verify that teach pendant works properly.

5.3.5. Replacement of 12V power supply

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.




When completing the following replacement, please follow the guidelines laid out in section Handling ESD-sensitive parts

NOTE

use the same procedure for power down and removing the aluminum cover plate and cables for teach pendant as in chapter Replacement of Teach Pendant

To replace the 12V power supply follow the same steps as for the procedure in chapter Replacement of 48V power supply

1. The 12V power supply is placed in the top of the rack. The screws holding it in the frame are at the sides.

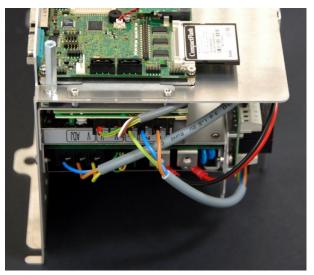

- 2. Replace 12V power supply with new one.
- 3. Reconnect the wires for the 12V power supply.
- 4. Re-install controller module in reverse order and connect the 2 wires for the fan and cables for the teach pendant.
- 5. Carefully put back the aluminum cover plate, make sure to mount it correctly and fix it in place with the 5 screws.
- 6. Connect power and verify that teach pendant functions correctly.

5.3.6. Replacement of Current distributor

WARNING

Before replacing ANY components inside the control box, it is IMPORTANT to do a complete shutdown.

Follow the first 3 steps in section Complete rebooting sequence.





Take care of ESD handling 3.0 Handling ESD-sensitive parts

NOTE

Use the same procedure for power down and removing the aluminum cover and cables for teach pendant as in chapter Replacement of teach pendant

How to replace current distributor in controller box:

1. Current distributor is placed on top of the rack.



2. Before dismounting the current distributor, mark and disconnect the cables from the circuit board.



- 3. Replace current distributor with new one.
- 4. Reconnect the wires for the current distributor.
- 5. Re-install controller module in reverse order and connect the 2 wires for the fan and cables for the teach pendant.
- 6. Carefully put back the aluminum cover plate, make sure to mount it correctly and fix it in place with the 5 screws.
- 7. Connect power and verify that teach pendant functions correctly.



6. Software

6.1. Update software

Universal Robots software is named PolyScope.

NOTICE

Read the complete section prior to updating your software. Controller power MUST NOT be turned off during software update process. Universal Robots assume no responsibility for any failed update caused by improper operation.

Updating the software may cause changes to some functionality. Always check with the release notes on the Universal Robots support site.www.universal-robots.com/support/


- 1. Do not downgrade the software to earlier version than the version the robot was produced with.
- 2. We advise you only to update, if you can benefit from the new features or the fixed issues.
- 3. We advise you to thoroughly read the release notes before performing an update, to avoid unexpected behavior, caused by changed or added functionality.
- 4. In case of concerns related to your actual or planned applications, please contact your supplier for advice and assistance.

Instructions to update software:

- 1. Download software update. When updating, it must be done in steps i.e. from 3.3 to 3.4 to 3.5.
- 2. Save it in the root folder on a USB-stick.
- 3. Insert USB-stick into USB-connector on right-hand side of teach pendant.

UNIVERSAL ROBOTS 6. Software

4. Go to main screen of PolyScope.

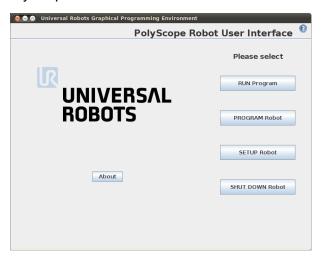

- 5. Press SETUP Robot.
- 6. In left side menu, select Update Robot.



7. Press button Search to search for software update files on USB-stick.



8. Select the desired software update and press UPDATE.

- 9. Press YES to update the software.
- 10. Wait for update too complete, after successful update controller will automatically reboot.
- 11. Remove USB-stick and initialize the robot.

6.2. Update joint firmware

NOTICE

Read the complete section prior to updating your firmware. Controller power MUST NOT be turned off during firmware update process. Universal Robots assume no responsibility for any failed update caused by improper operation.

Software version 3.1.16828 and newer:

When the software is updated on a robot the firmware is automatically updated.

After replacement of a joint on a robot the firmware is automatically updated.

Software version before 3.1.16828:

Instructions for updating firmware:

Prior to updating firmware, robot software must be updated.

Please refer to chapter Update software. When updating robot software, the firmware will automatically be copied to a folder on the controller.




1. Swipe from left to right across the UNIVERSAL ROBOTS logo on main screen of PolyScope.



2. Enter password lightbot and press OK.



3. You are now in Expert Mode, press Low Level Control.

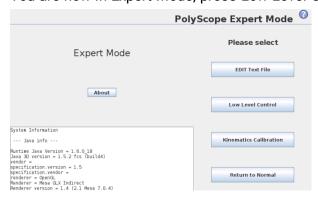

4. Press Turn power on to go into BOOTLOADER



5. Select the Firmware tab, mark All joints and press UPDATE Firmware.



- 6. Firmware update is being processed, await message that robot firmware updated successfully.
 - Controller MUST NOT be powered off during this update.
- 7. After successful update, press Back.
- 8. Back in Expert Mode, press Return to Normal.



9. Firmware has now been updated

6.3. Using Magic files

For easy backup, Universal Robots provides Magic files to automatically copy data from controller to USB-stick.

UNIVERS∧L ROBOTS 6. Software

| These files are available | Function |
|-----------------------------|---|
| URmagic log file | Copies the entire log history file to USB-stick |
| URmagic backup programs | Copies all programs and installation files to USB-stick |
| URmagic configuration files | Copies all configuration files to USB-stick |
| URmagic upload programs | Copies all programs and installation files from USB-stick |
| URmagic screenshot | Generates a screenshot of GUI when USB-stick is inserted |

Go to www.universal-robots.com/support/ to download Magic files.

Instruction for using Magic files.

- 1. Download Magic file.
- Save it in the root folder on a USB-stick.
 If more than one Magic file is on USB-stick, they will be run in sequence; the warnings will then appear for each file. Do not remove the USB-stick until after the last file has been run. Multiple folders will be created and named with serial number plus a sequential no, e.g. 201430xxxx_0, 201430xxxx_1etc.
- 3. Insert USB-stick into USB-connector on right-hand side of teach pendant.
- 4. After a few seconds a red ! USB! -sign will appear on the screen, this is a warning not to remove the USB-stick, while the file will do its magic.
- 5. Await a green <- USB -sign appears on the screen, if there is more than one Magic file on the USB-stick then go to step 4.
- 6. After the last Magic file is completed the USB-stick can be safely removed.
- 7. Remove USB-stick and the process is complete.

The Magic file creates a folder on USB-stick named with the serial number of the robot.

6.4. Backup of data

NOTICE

When copying/moving files and folders, incorrect action might corrupt the file system.

This section explains the process of moving required files when upgrading from motherboard with compact flashcard to motherboard with USB.

6.4.1. Hardware Requirements

Compact Flash Card from the old motherboard

A standard flash card reader that can read the CF-card (not included in motherboard upgrade kit).



The USB stick from the motherboard upgrade kit

Part no. 122430 (CB3.0 to CB3.1 upgrade kit)




6.4.2. Software Requirements

A Linux software file system driver is required; Universal robots recommend the free Linux-partition driver Ext2Fsd but other windows Linux reader can be used as well (these are however not tested by Universal Robots).

6.4.3. How to Access Linux Partition from Windows

Download and install Ext2Fsd.

Ensure to enable Read and Write Support for Ext2 and Ext3.

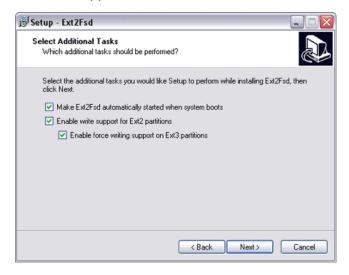


Reboot the computer to allow the changes to take effect.

6.4.4. Copy the data from CF-card to UR-USB

Take CF-card from control box and insert the CF-card in card reader and the UR-USB in one
of the computers USB ports.


2. CB3:

Open windows explorer navigate to the CF-card open the folder "programs", select all the files in the folder, right click and select Copy.

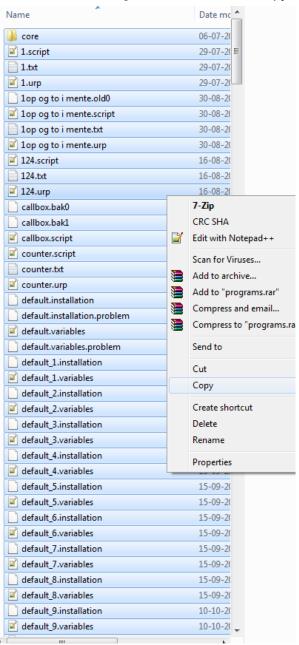

Copyright © 2009-2021 by Universal Robots A/S. All rights reserved.

3. Navigate to the UR-USB right-click on the folder "programs" and select Paste.

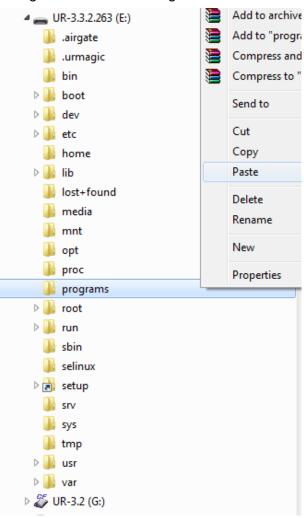




UNIVERSAL ROBOTS 6. Software

4. Navigate to the root folder on the CF-Card


UR3

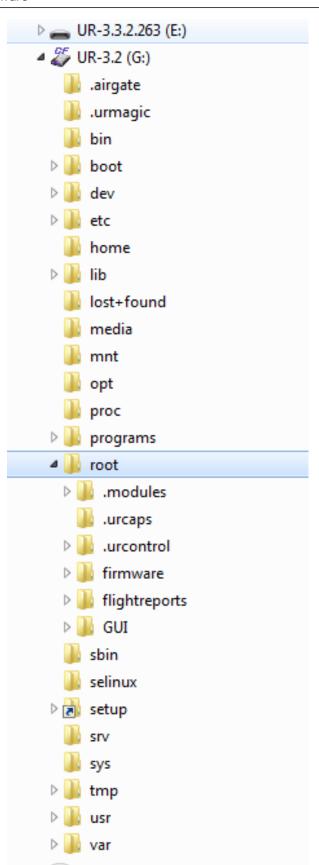





5. In the root folder view select the folders and files highlighted in yellow, then right-click and select Copy.

If the .urpass.file or .ursafetypass.file is not visible on the CF-card, then the files don't need to be saved

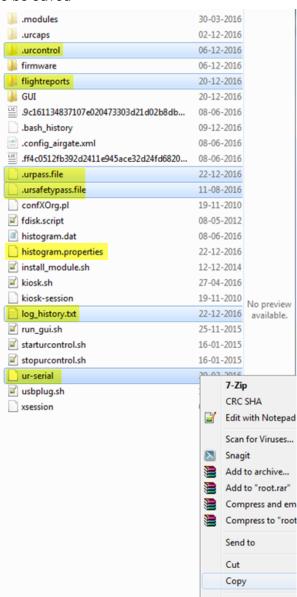

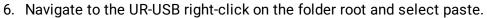

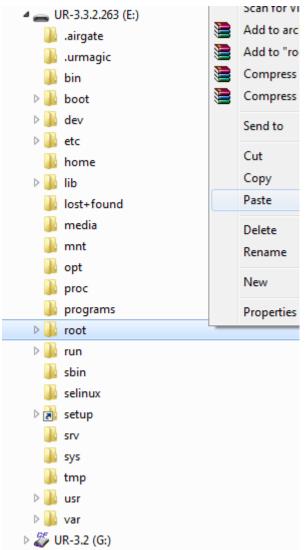


7. A prompt will popup when the files are being copied, in the prompt choose Copy and replace.

UNIVERSAL ROBOTS

6. Software

8. Check the checkbox marked yellow.

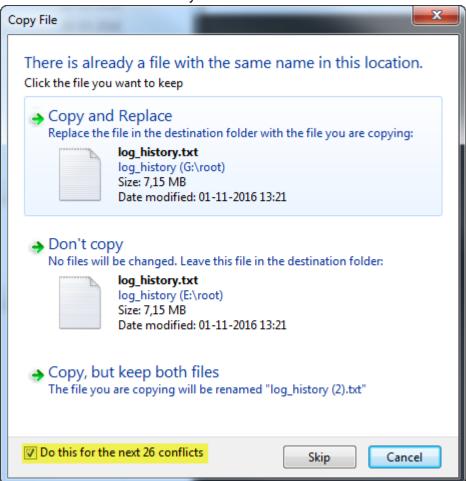

9. All required files are copied. UR-USB can now be inserted in new motherboard and booted

7. Troubleshooting

In the error codes, different words have been used for the same thing:

- On the Safety Control Board: Processor A = A uP = SafetySys1
- On the Safety Control Board: Processor B = B uP = SafetySys2

Abbreviations in the troubleshooting chapter:

PSU = Power Supply

PC = Controller

Open log files with Support Log Reader(SLR).

Go to www.universal-robots.com/support/ to download Support Log Reader

7.1. Error codes

- On the Safety Control Board: Processor A = A uP = SafetySys1
- On the Safety Control Board: Processor B = B uP = SafetySys2
- PSU = Power Supply
- PC = Controller
- LVD = Low Voltage Detected

| Error code | Description | Explanation | Suggestion |
|------------|--|---------------------------|--|
| C0A | No error | Communication established | Log entry only, no issue |
| C1A1 | Buffer of stored warnings overflowed | | |
| C1A2 | Outbuffer to RS485 overflowed (problem with Controller message) | | |
| C2A | Inbuffer overflow | | |
| СЗА | Processor overloaded | | Review program or remove some external controls and communications |



| C4A1 | Lost communication with Controller | Communication is being interfered | a) Check Ethernet cable between Control Board and Motherboard, check that a script or UR+ software is not overloading the communication between the Control Board and Motherboard. b) Check cable between controller and robot b) Do a Complete rebooting sequence. c) Update the software |
|------|--|-----------------------------------|--|
| C4A2 | Lost communication with Safety Control Board A uP | | a) Check TCP/IP connectionbetween Motherboard andControl Board.b) Do a Complete rebootingsequence.c) Replace Safety ControlBoard |
| C4A3 | Communication with Safety Control Board B uP lost | | Same as C4A2 |
| C4A4 | Communication with primary Teach Pendant uP lost | | a) Check RS485-12V connection between Motherboard and Teach Pendant. b) Do a Complete rebooting sequence. c) Replace Teach Pendant |
| C4A5 | Communication with secondary Teach Pendant uP lost | | Same as C4A4 |
| C4A6 | Communication with primary EUROMAP67 uP lost | | a) Check Euromap67 connection between Motherboard and Teach Pendant. b) Do a Complete rebooting sequence. c) Replace Teach Pendant |
| C4A7 | Communication with secondary EUROMAP67 uP lost | | Same as C4A6 |

| C4A8 | Primary EUROMAP67 uP present, but euromap67 is disabled | Incorrect safety configuration | a) Update the miscellaneous settings in the SafetyConfiguration.b) Do a Complete rebooting sequence |
|-------|---|--------------------------------|---|
| C4A9 | Secondary EUROMAP67 uP present, but euromap67 is disabled | Incorrect safety configuration | Same as C4A8 |
| C4A10 | Primary Teach Pendant present, but Teach Pendant safety is disabled | Incorrect safety configuration | Same as C4A8 |
| C4A11 | Secondary Teach Pendant uP present, Teach Pendant safety is disabled | Incorrect safety configuration | Same as C4A8 |
| C4A12 | Communication with joint 0 lost | More than 1 package lost | a) Verify that the communication cables are connected properly.b) Do a Complete rebooting sequence |
| C4A13 | Communication with joint 1 lost | More than 1 package lost | Same as C4A12 |
| C4A14 | Communication with joint 2 lost | More than 1 package lost | Same as C4A12 |
| C4A15 | Communication with joint 3 lost | More than 1 package lost | Same as C4A12 |
| C4A16 | Communication with joint 4 lost | More than 1 package lost | Same as C4A12 |
| C4A17 | Communication with joint 5 lost | More than 1 package lost | Same as C4A12 |
| C4A18 | Communication with tool lost | More than 1 package lost | Same as C4A12 |
| C4A65 | Lost package from Primary Teach Pendant | 1 package lost | Same as C4A12 |
| C4A66 | Lost package from Secondary Teach Pendant | 1 package lost | Same as C4A12 |



| C4A67 | Lost package from Primary Euromap67 | 1 package lost | Same as C4A12 |
|-------|--|---|---------------|
| C4A68 | Lost package from Secondary Euromap67 | 1 package lost | Same as C4A12 |
| C4A69 | Lost package from Secondary Masterboard | 1 package lost | Same as C4A12 |
| C4A70 | Lost package from joint 0 | Serial communication problem with one or more joints | Same as C4A12 |
| C4A71 | Lost package from joint 1 | Serial communication problem with one or more joints | Same as C4A12 |
| C4A72 | Lost package from joint 2 | Serial communication problem with one or more joints | Same as C4A12 |
| C4A73 | Lost package from joint 3 | Serial communication problem with one or more joints | Same as C4A12 |
| C4A74 | Lost package from joint 4 | Serial communication problem with one or more joints | Same as C4A12 |
| C4A75 | Lost package from joint 5 | Serial communication problem with one or more joints | Same as C4A12 |
| C4A76 | Lost package from tool | Serial communication problem with one or more joints | Same as C4A12 |
| C4A77 | Lost package from uPA to joints | 1 package lost | Same as C4A12 |
| C4A78 | Lost package from uPA to teach pendant | 1 package lost | Same as C4A12 |
| C4A79 | Lost package from uPA to uPB | 1 package lost | Same as C4A12 |
| C4A80 | Lost package from uPB | 1 package lost | Same as C4A12 |
| C4A81 | Packet counter disagreement in packet from Primary Screen | Safety processor 1 in Teach Pendant has a packet disagreement | Same as C4A12 |

| 7 | - |
|---|---------------------------|
| • | , |
| • | D |
| - 3 | • |
| - | 2 |
| 1 | _ |
| - | i |
| | u |
| • | ^ |
| ٠, | 4 |
| c | D |
| - 6 | - |
| - | = |
| | _ |
| C | p |
| + | _ |
| - | - |
| - | = |
| τ | |
| | = |
| | |
| | |
| _ | _ |
| - | - |
| - | ۲ |
| _ | • |
| | |
| | - |
| Ú | О |
| < | 5 |
| | 2 |
| < | ĺ |
| - | ٦ |
| | _ |
| C | p |
| + | _ |
| • | ٦ |
| • | _ |
| • | 7 |
| - | = |
| C | _ |
| _ | 2 |
| ш | |
| | |
| _ | - |
| • | п |
| • | v |
| C | ת |
| ú | |
| - 2 | |
| | |
| - (| U |
| ٤ | Ų |
| | 2 |
| | 2 |
| | 2 |
| 2 | 2 |
| la i | ב |
| Ilain | |
| , IIniv | |
| Ni III | |
| by Haive | 2 |
| hyllhiy | 2 |
| hyllhiy | |
| 1 hy Inive | 2 |
| 21 hv Hnive | 2 |
| 101 hy Haive | |
| 021 hv Hnive | |
| 2021 hv Ilnive | |
| 2021 hy Haive | |
| -2021 by Haive | 207 0 0 0 |
| -2021 by Haive | 207 0 0 0 |
| 2-2021 hv 1 ln ive | 207 0 0 0 0 |
| 0-2021 hv 1 ln ive | 207 00 00 00 00 |
| 00-2021 by 11bive | 202 00 0110 |
| 200_200 | 2021 00 01110 |
| 000-000 hv Inivo | 202 202 000 |
| 2000-2021 by Hnive | 2002 202 00 011 |
| 2000-2021 hv 1lhive | 2002 2021 07 011175 |
| 2000_2001 by Haive | 2002 2021 00 01102 |
| 0 2000 - 2021 hy Unive | 9 2009 202 DV OIIVE |
| @ 2000_2001 hv Haive | © 2009 202 DV UIIVE |
| - 0 2000 - 2021 by Haive | |
| 1+ @ 2000_20021 by Haive | 1 @ 2003 2021 DV UIIVE |
| 2000-2021 by Unive | |
| h+ @ 2000_2001 hv Ilnive | 111 @ 2003 2021 DV 0111VE |
| 2000-2001 by This | |
| 12h+ @ 2000_2001 hv Inive | |
| right @ 2000_2001 hv Ilnivo | 110 Kg 702 707 011 Kg |
| viah+ @ 2000_2001 by Ilnive | |
| wright @ 2000-2001 by Hnive | |
| 2000-2001 by Unive | |
| 2000 - 11nivo | |
| 2000-2004 © 2000-2001 hv Hnive | |
| 2000 - 2000 - 2000 - 4 Liniva | |
| Convigat @ 2000-2021 by Haivereal Bohote A /C All rights recognised | |

| C4A82 | Packet counter disagreement in packet from Secondary Screen | Safety processor 2 in Teach Pendant has a packet disagreement | Same as C4A12 |
|-------|--|---|---------------|
| C4A83 | Packet counter disagreement in packet from Primary Euromap67 | More than 1 package lost | Same as C4A12 |
| C4A84 | Packet counter disagreement in packet from Secondary Euromap67 | More than 1 package lost | Same as C4A12 |
| C4A85 | Packet counter disagreement in packet from Safety Control Board B | More than 1 package lost | Same as C4A12 |
| C4A86 | Packet counter disagreement in packet from joint 0 | More than 1 package lost | Same as C4A12 |
| C4A87 | Packet counter disagreement in packet from joint 1 | More than 1 package lost | Same as C4A12 |
| C4A88 | Packet counter disagreement in packet from joint 2 | More than 1 package lost | Same as C4A12 |
| C4A89 | Packet counter disagreement in packet from joint 3 | More than 1 package lost | Same as C4A12 |
| C4A90 | Packet counter disagreement in packet from joint 4 | More than 1 package lost | Same as C4A12 |
| C4A91 | Packet counter disagreement in packet from joint 5 | More than 1 package lost | Same as C4A12 |
| C4A92 | Packet counter disagreement in packet from tool | More than 1 package lost | Same as C4A12 |
| C4A93 | Packet counter disagreement in packet from processor A to joints | More than 1 package lost | Same as C4A12 |



| C4A94 | Packet counter disagreement in packet from processor A to B | More than 1 package lost | Same as C4A12 |
|---------|--|---|--|
| C4A95 | Packet counter disagreement in packet from processor A to Teach Pendant and EUROMAP | More than 1 package lost | Same as C4A12 |
| C4A100 | Communication lost due to Packet counter disagreements | More than 1 package lost | Same as C4A12 |
| C5A | Heavy processor load warning | Too much instructions being sent at the same time | Review communication frequency between robot and external equipment |
| C10A | Controller communication issue | | |
| C10A1 | Lost packet from Controller | | |
| C10A101 | Controller packet received too early | | |
| C10A102 | Packet counter does not match | | |
| C10A103 | Controller is sending packets too often | | |
| C11A | Bad CRC | Serial communication problem with joint | Check black 2-wire connectors and wires in joints |
| C12A | Unknown message error | | |
| C14A1 | Debug message | | |
| C14A2 | Debug message | | |
| C14A3 | Debug message | | |
| C17A | Communication error between Safety Control Board and Motherboard | | a) Check Ethernet connectionbetween circuit boardsb) Do a Complete rebootingsequencec) Update the software |

| C25A | Motor Encoder index missing | Joint's encoder system mechanical problem | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace jointc) Contact your local UR provider |
|-------|--|---|---|
| C26A | Motor Encoder index drift detected | Joint's encoder system mechanical problem | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace jointc) Contact your local UR provider |
| C27A | Calibration data is invalid or does not exist. | Calibration needed | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace joint |
| C29A | Online Calibration data checksum failed | | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace joint |
| C30A | Master received data from too many joints | | |
| C31A | Caught wrong message (not from master) | Serial communication problem with joint | Check black 2-wire connectors and wires on joints |
| C32A | Flash write verify failed | | |
| C33A | Calibration flash checksum failed | | |
| C34A | Program flash checksum failed | | Update Firmware |
| C34A0 | Program flash checksum failed during bootloading | | Update Firmware |
| C34A1 | Program flash checksum failed at runtime | | Update Firmware |
| C35A | Joint ID is undefined | | |



| C36A | Illegal bootloader command | | |
|---------|---|---|---|
| C37A | Inbuffer parse error | Serial communication problem with joint | Check black 2-wire connectors and wires on joints |
| C38A | Online RAM test failed | | Check the log file for what item is reporting this error. Replace the reported item |
| C38A1 | Data-bus test failed | | |
| C38A2 | Address-bus stuck- high test failed | | |
| C38A3 | Address-bus stuck- low test failed | | |
| C38A4 | Address-bus shorted test failed | | |
| C38A5 | Memory-cell test failed | | |
| C39A | Logic and Temporal Monitoring Fault | | |
| C39A1 | Max current deviation failure | | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace joint |
| C39A2 | Max joint-encoder speed exceeded | | Same as C39A1 |
| C39A3 | Max motor-encoder speed exceeded | | Same as C39A1 |
| C39A4 | Illegal state change in joint detected | | Same as C39A1 |
| C39A5 | A timing issue occurred during startup. | Too fast state change in joint detected | Same as C39A1 |
| C39A6 | 5V regulator voltage too low | | Same as C39A1 |
| C39A7 | 5V regulator voltage too high | | Same as C39A1 |
| C39A100 | Watchpoint fault: ADC task timeout | | Same as C39A1 |

| C39A101 Watchpoint fault: Motor-Control task timeout C39A102 Watchpoint fault: Motor-encoder task timeout C39A103 Watchpoint fault: Joint-encoder task timeout C39A104 Watchpoint fault: Joint-encoder task timeout C39A105 Watchpoint fault: Communication task timeout C39A106 Watchpoint fault: RAM-test task timeout C39A107 Watchpoint fault: CalVal-test task timeout C39A108 Watchpoint fault: RAM-test task timeout C39A109 Watchpoint fault: RAM-test task timeout C39A100 Watchpoint fault: ROM-test task timeout C39A107 Watchpoint fault: ROM-test task timeout C40A AD-Converter hit register hit high limit point C41A RC Oscillator Trim register hit high limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus C44A0 RSC Check failure on problem with joint or secondary bus node C44A0 Base C44A0 Base C44A1 Shoulder | | | | |
|--|---------|---------------------|-----------------------|---|
| Motor-encoder task timeout C39A103 Watchpoint fault: Joint-encoder task timeout C39A104 Watchpoint fault: Communication task timeout C39A105 Watchpoint fault: RAM-test task timeout C39A106 Watchpoint fault: CalVal-test task timeout C39A107 Watchpoint fault: ROM-test task timeout C40A AD-Converter hit high limit joint electronics internal C41A RC Oscillator Trim register hit low limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C44A CRC check failure on primary bus C44A CRC oscondary bus node C44A CRC oscondary bus node C44A CRC oscondary bus node C44A CAS Complete rebooting sequence. C.) If this happens more than two times in a row, contact your local service provider for assistance. | C39A101 | Motor-Control task | | Same as C39A1 |
| Joint-encoder task timeout | C39A102 | Motor-encoder task | | Same as C39A1 |
| Communication task timeout C39A105 Watchpoint fault: RAM-test task timeout C39A106 Watchpoint fault: CalVal-test task timeout C39A107 Watchpoint fault: ROM-test task timeout C40A AD-Converter hit high limit joint register hit high limit C41A RC Oscillator Trim register hit high limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node C44A CRC check failure on primary bus Same as C39A1 Check grounding and shielding for EMC problems Check grounding and shielding for EMC problems Check grounding and shielding for EMC problems C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64AB CRC check failure on problem with joint or secondary bus node C64B CRC check failure on problem with joint or secondary bus node | C39A103 | Joint-encoder task | | Same as C39A1 |
| RAM-test task timeout C39A106 Watchpoint fault: CalVal-test task timeout C39A107 Watchpoint fault: ROM-test task timeout C40A AD-Converter hit high limit joint C41A RC Oscillator Trim register hit high limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node Serial communication problem sequence. c) If this happens more than two times in a row, contact your local service provider for assistance. C44A0 Base | C39A104 | Communication task | | Same as C39A1 |
| CalVal-test task timeout C39A107 Watchpoint fault: ROM-test task timeout C40A AD-Converter hit high limit joint C41A RC Oscillator Trim register hit high limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node C44A CRC check failure on primary bus on problem with joint or secondary bus node C44A Base C44A0 Base | C39A105 | RAM-test task | | Same as C39A1 |
| ROM-test task timeout C40A | C39A106 | CalVal-test task | | Same as C39A1 |
| high limit joint electronics internal shielding for EMC problems C41A RC Oscillator Trim register hit high limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node a) Check black 2-wire connectors and wires in joints. b) Do a Complete rebooting sequence. c) If this happens more than two times in a row, contact your local service provider for assistance. C44A0 Base | C39A107 | ROM-test task | | Same as C39A1 |
| register hit high limit C42A RC Oscillator Trim register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node 3) Check black 2-wire connectors and wires in joints. b) Do a Complete rebooting sequence. c) If this happens more than two times in a row, contact your local service provider for assistance. C44A0 Base | C40A | | | - |
| register hit low limit C43A Change in invariant memory detected C43A1 Current sensor gain C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN Serial Communication problem with joint or secondary bus node OCMAN SERIAL SERIA | C41A | | | |
| C43A1 Current sensor gain C44A CRC check failure on primary bus Cecondary bus node CRC check failure on problem with joint or secondary bus node Connectors and wires in joints. Cecondary bus node Do a Complete rebooting sequence. Cecondary bus node Cecondary | C42A | | | |
| C44A CRC check failure on primary bus Serial communication problem with joint or secondary bus node CRC check failure on problem with joint or secondary bus node Serial communication connectors and wires in joints. b) Do a Complete rebooting sequence. c) If this happens more than two times in a row, contact your local service provider for assistance. C44A0 Base | C43A | _ | | |
| primary bus problem with joint or secondary bus node primary bus problem with joint or secondary bus node problem with joint or joints. b) Do a Complete rebooting sequence. c) If this happens more than two times in a row, contact your local service provider for assistance. C44A0 Base | C43A1 | Current sensor gain | | |
| | C44A | | problem with joint or | connectors and wires in joints. b) Do a Complete rebooting sequence. c) If this happens more than two times in a row, contact your local service provider for |
| C44A1 Shoulder | C44A0 | Base | | |
| | C44A1 | Shoulder | | |



| C44A2 | Elbow | | |
|---------|--|--|--|
| C44A3 | Wrist 1 | | |
| C44A4 | Wrist 2 | | |
| C44A5 | Wrist 3 | | |
| C44A6 | Tool | | |
| C44A80 | CRC Check failure on primary bus. | Interference on the communication field bus. | |
| C45A | AD-Converter error | | |
| C46A | Loose gearbox or bad encoder mounting | Mechanical problem in gear related to encoder mounting | a) Do a Complete rebooting sequenceb) If this happens more than two times in a row, replace joint |
| C47A | AD-Converter hit low limit | EMC issue external or electronics internal | Check grounding and shielding for EMC problems |
| C49A | RS485 receive warning | | |
| C49A200 | Secondary RS485 bus is down | Bus for: Teach Pendant, Processor A and Processor B on Control Board | Check TCP/IP-12V cable to Teach Pendant |
| C50A | Robot powerup issue | Electrical error control box | Remove all external connections to I/O-interface of Safety Control Board. Check for short circuit |
| C50A1 | Voltage detected at 24V rail before startup | | |
| C50A2 | Voltage present at unpowered robot | | |
| C50A5 | Powersupply voltage too low | | Check 48 V cable between power supply and Control Board |
| C50A6 | Powersupply voltage too high | | |
| C50A11 | Voltage not detected at 24V rail after startup | | |
| C50A15 | Warning, waiting for SafetySYS2 | | |

| $\overline{}$ |
|---|
| ĕ |
| > |
| ē |
| Ö |
| Ģ |
| |
| 半 |
| 듶 |
| ₽ |
| _ |
| $\overline{}$ |
| _ |
| S |
| \geq |
| ٦ |
| 2 |
| Ö |
| ∽ |
| × |
| Ξ |
| a |
| S |
| ē |
| .≥ |
| |
| \supset |
| > |
| 9 |
| Copyright © 2009–2021 by Universal Robots A/S. All rights reserved. |
| \simeq |
| \sim |
| ì |
| 6 |
| 9 |
| \sim |
| |
| 0 |
| Ħ |
| To |
| ·Ξ |
| > |
| 2 |
| ŏ |
| |

| C50A16 | The Teach Pendant does not respond | Loose wire or incorrect safety configuration | a) Check the Teach Pendant cable and connections.b) Check the settings in the miscellaneous tab in the Safety menu |
|--------|---|---|---|
| C50A17 | The Euromap67 interface does not respond | Loose wire or incorrect safety configuration | a) Check the Euromap67cable and connections.b) Check the settings in the miscellaneous tab in the Safety menu |
| C50A18 | Warning, waiting for SafetySYS1 | SafetySYS1 = Processor A on Safety Control Board | |
| C50A19 | Warning, Waiting for a valid "euromap67 activated" status bit from secondary Safety Control Board | | |
| C50A20 | 5V, 3V3 or ADC error (5V too high) | | |
| C50A21 | 5V, 3V3 or ADC error (5V too low) | | |
| C50A22 | Robot current sensor reading too high | | |
| C50A23 | Robot current sensor reading too low | | |
| C50A24 | 48V not present (Check internal connection) | | |
| C50A25 | Robot voltage present at 48V PSU powereup | | |
| C50A26 | Voltage present on unpowered 48V power supply | | |
| C50A27 | 12V, 3V3 or ADC error (12V too high) | | |
| C50A28 | 12V, 3V3 or ADC error (12V too low) | | |
| C50A29 | Analog I/O error (- 12V too high) | | |
| C50A30 | Analog I/O error (- 12V too low) | | |



| C50A31 | The other safetySYS do not initialize | | |
|--------|--|--|--|
| C50A40 | Wrong voltage from PSU1 | | |
| C50A41 | Wrong voltage from PSU2 | | |
| C50A42 | Voltage will not disappear from PSU | | |
| C50A43 | Warning, waiting for CB2 type answer from primary processor | | |
| C50A50 | Processor A 3.3V supply voltage out of bounds | | |
| C50A51 | Robot voltage below threshold | | |
| C50A52 | Robot voltage above threshold | | |
| C50A53 | 58V generator deviation error | | |
| C50A54 | 5V regulator too low | | |
| C50A55 | 5V regulator too high | | |
| C50A56 | -4V generator too low | | |
| C50A57 | -4V generator too high | | |
| C50A80 | Last CPU reset caused by Low- Power-Reset | | |
| C50A81 | Last CPU reset caused by Window- Watchdog-Reset | | |
| C50A82 | Last CPU reset caused by Independent- Watchdog-Reset | | |
| C50A83 | Last CPU reset caused by Software- Reset | The Control Board was reset on explicit request. | |

| _ |
|---|
| 0 |
| جّ |
| ē |
| S |
| ē |
| S |
| Ħ |
| ₽ |
| Ξ. |
| = |
| ⋖ |
| S |
| > |
| ۹ |
| ţ2 |
| 2 |
| 겅 |
| ĕ |
| = |
| (U |
| ဟ |
| Siz |
| Vers |
| nivers |
| Univers |
| v Univers |
| by Univers |
| 21 by Univers |
| 021 by Univers |
| 2021 by Univers |
| 3-2021 by Univers |
| 09-2021 by Univers |
| 009-2021 by Univers |
| 2009-2021 by Univers |
| © 2009-2021 by Univers |
| nt © 2009–2021 by Univers |
| aht © 2009–2021 by Univers |
| riaht © 2009–2021 by Univers |
| ovright © 2009-2021 by Univers |
| opvright © 2009-2021 by Univers |
| Copyright © 2009–2021 by Universal Robots A/S. All rights reserved. |

| C50A84 | Last CPU reset caused by External- Pin-Reset | | |
|---------|---|--|---|
| C50A85 | Last CPU reset caused by Brown- Out-Reset | | |
| C50A99 | Wrong software on PCB | | |
| C50A100 | Cable not connected | | Check cable and connections between robot and control box |
| C50A101 | Short circuit in robot detected or wrong robot connected to control box | | Check robot type. Look for short circuit in cable and in robot arm |
| C50A102 | Voltage rising too slowly | | |
| C50A103 | Voltage failed to reach acceptable level | | |
| C50A104 | The IMMI module does not respond | | |
| C51A | CRC check failure on secondary bus | | |
| C51A0 | Processor B | | |
| C51A1 | Primary screen processor | CRC check failure on safety processor 1 in Teach Pendant | |
| C51A2 | Secondary screen processor | CRC check failure on safety processor 2 in Teach Pendant | |
| C51A3 | Primary E67 | | |
| C51A4 | Secondary E67 | | |
| C53A | IO overcurrent detected | Control Board error | Remove all external connections to I/O-interface of Safety Control Board. Check for short circuit |
| C53A1 | IO Overcurrent detected. Max is 800mA | | |
| | | | |



| C53A2 | IO Overcurrent detected. Max is 600mA | | |
|--------|---|---------------------------------------|---|
| C55A | Safety system error | Safety system malfunction | a) Check Motherboard, Control Board, Screenboard, Current distributor (Euromap, if installed). b) Check safety devices and cables/connections to these devices. c) Do a Complete rebooting sequence |
| C55A23 | Safety relay error (minus connection) | Current distributor error | a) Check cable from Control Board to Current distributor or 48V Power supply and Current distributor for issues b) Do a Complete rebooting sequence |
| C55A24 | Safety relay error (plus connection) | Current distributor error | a) Check cable from Control Board to Current distributor or 48V Power supply and Current distributor for issues b) Do a Complete rebooting sequence |
| C55A33 | Safety relay error (a relay is stuck) | Current distributor error | a) Check cable from Control Board to Current distributor or 48V Power supply and Current distributor for issues b) Do a Complete rebooting sequence |
| C55A34 | Safety relay error (relays are not on) | Current distributor error | a) Check cable from Control Board to Current distributor or 48V Power supply and Current distributor for issues b) Do a Complete rebooting sequence |
| C55A50 | Voltage present at unpowered robot | Safety Control Bord hardware fault | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Control Board |

| ö |
|--------------|
| ě |
| ē |
| es |
| 2 |
| Ĭ |
| .0 |
| All rights r |
| ٦. |
| 8 |
| ۷, |
| Stc |
| ĕ |
| Robots |
| a |
| iversal |
| .≝ |
| 느 |
| ov Unive |
| 2021 by |
| ž |
| 2009-202 |
| 9 |
| 8 |
| 2 |
| (C) |
| 듬 |
| Ē |
| ŏ |
| ပ္ပ |
| |

| C55A51 | Voltage will not disappear from robot | Safety Control Bord hardware fault | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Control Board |
|---------|---|---------------------------------------|---|
| C55A52 | 5V, 3V3 or ADC error (5V too low) | Safety Control Bord hardware fault | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Control Board |
| C55A53 | 5V, 3V3 or ADC error (5V too high) | Safety Control Bord hardware fault | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Control Board |
| C55A90 | Bootloader error, robot voltage too low or current too high | | |
| C55A91 | Bootloader error, robot voltage too high | | |
| C55A100 | Safety violation | | |
| C55A101 | Safety Channel Error In Safety Control Board | | |
| C55A102 | Safety Channel Error In Screen | | |
| C55A103 | Safety Channel Error In Euromap67 Interface | | |
| C55A109 | Received fault message from Controller | | |
| C55A110 | Safety State is changing too often | | |
| C55A111 | On/Off State is changing too often | | |
| C55A112 | Robot current sensors readings differ | | |



| C55A120 | Robot current is too high while emergency stopped | | |
|---------|--|---|---|
| C55A121 | Robot current is too high while safeguard stopped | | |
| C56A | Overvoltage shutdown | Voltage exceeded 55V | a) Check Energy Eaters cable and connections.b) Check Energy.c) Replace Energy Eater |
| C57A | Brake release failure | | a) Check Brake, solenoid.b) Check TCP configuration, payload and mounting settings |
| C57A1 | Joint did not move or motor encoder is not functioning | | |
| C57A2 | Large movement detected during brake release | | |
| C57A3 | Robot was not able to brake release, see log for details | | |
| C58A | Motor encoder not calibrated | | |
| C59A | Overcurrent shutdown | Overcurrent in joint. Argument = Current in Amps | a) Check for short circuit.b) Do a Complete rebooting sequence.c) If this happens more than two times in a row, replace joint |
| C60A | Energy surplus shutdown | The power supply is sending energy to the energy eater | a) Ensure power grid is not delivering more than 48V b) Measure robot energy input c) Contact your local Universal Robots service provider for assistance. |
| C61A | Idle power consumption to high | The system is drawing more power than expected while idle | a) Check Energy Eaterscables and connectionsb) Check Energy Eaterc) Replace Energy Eater |

| C62A | Thermal issue | | a) Check nothing is hindering free movement of the joints.b) Check TCP configuration, payload and mounting settings |
|--------|--|--|---|
| | Joint temperature: High (80 C) | | |
| | Warning: Static load too high | | |
| | Joint temperature: Shut down (85 C) | | |
| | Shutdown: Static oad too high | | |
| C63A N | Motor test failed | Joint motor has a failure in a step | |
| | nterface connection error | | |
| C65A F | PSU voltage to high | The power supply output voltage is above 48.7V | a) Ensure supply is not delivering more than 48Vb) Contact support |
| C68A S | SPI error | Joint: Absolut encoder on joint communication error | a) Check for short circuit.b) Do a Complete rebooting sequence.c) If this happens more than several times in a row, replace joint |
| | Close to gearbox shear limit | Acceleration / deceleration to high. Mechanical problem in gear related to encoder mounting | a) Reduce acceleration in user program.b) Do a Complete rebooting sequence.c) If this happens more than several times in a row, replace joint |
| C71A S | Startup check error | | Check for the phases of motor in the joint. Update firmware |
| V | Hardware is size0, wrong firmware at the joint | | Update firmware |
| | Hardware is size1, wrong firmware at | | Update firmware |



| C71A2 | Hardware is size2, wrong firmware at the joint | | Update firmware |
|--------|---|--|---|
| C71A3 | Hardware is size3, wrong firmware at the joint | | Update firmware |
| C71A4 | Hardware is size4, wrong firmware at the joint | | Update firmware |
| C71A5 | Invalid hardware revision | | |
| C71A6 | ADC calibration failed | | |
| C71A7 | Unknown error result | The motor wires are damaged, bad connection in screw terminals or defect PCB | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A8 | Motor short circuit to ground or H-bridge problems | The motor wires are damaged, bad connection in screw terminals or defect PCB | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A9 | Motor indication signal does not work | The motor wires are damaged, bad connection in screw terminals or defect PCB | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A10 | Phase 1 is unconnected or not working | The motor wires are damaged, bad connection in screw terminals or defect PCB | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A11 | Phase 2 is unconnected or not working | The motor wires are damaged, bad connection in screw terminals or defect PCB | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A12 | Phase 3 or multiple phases is unconnected or not working | The wire is (1) damaged or (2) has been disconnected from the PCB (not likely) or (3) defect PCB | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A50 | Current sensor test failed | Sensor reported wrong current when probed | a) Check joint for damaged or loose connections.b) Replace the joint |

| C71A51 | Current sensor test failed | Sensor reported wrong current when probed | a) Check joint for damaged or loose connections.b) Replace the joint |
|---------|---|--|---|
| C71A52 | Current sensor test failed | Sensors reported different currents when probed | a) Check joint for damaged or loose connections.b) Replace the joint |
| C71A101 | Wrong firmware on RLS encoder | | |
| C72A | Power Supply Unit failure | | |
| C72A1 | 0 PSUs are active | Power Supply was not able to deliver 48V | Check power connection between power supply and Control Board |
| C72A2 | 1 PSU active, but we expect 2 (UR10) | Power Supply was not able to deliver 48V or UR10 flash card in UR5 robot | Check power connection between power supply and Control Board and check that the flash card and robot match |
| C72A3 | 2 PSUs active, but we expect 1 (UR5) | UR5 flash card in UR10 robot | Check that the flash card and robot match |
| C74A | Joint encoder warning | Magnetic encoder error (absolute encoder). Argument = sum of C74 errors | |
| C74A1 | Invalid decode: Readhead misalignment, ring damaged or external magnetic field present. | | Check grounding and shielding for EMC problems |
| C74A2 | Speed reading is not valid | | |
| C74A4 | System error=malfunction or inconsistent calibration detected | | |
| C74A8 | Supply voltage is out of range | | |
| C74A16 | Temperature is out of range | | |



| C74A32 | Signal lost =Misaligned readhead or damaged ring | | |
|---------|--|--|--|
| C74A64 | Signal low =Too far from magnetic ring | | |
| C74A128 | Signal saturation =Too close to magnetic ring | | |
| C75A | Joint encoder error | Magnetic encoder error (absolute encoder). Argument = sum of C75 errors | Check encoder connections |
| C75A1 | Invalid decode: Readhead misalignment, ring damaged or external magnetic field present. | | a) Do a Complete rebooting sequence.b) Check grounding and shielding for EMC problems.c) If this happens more than two times in a row, replace joint |
| C75A2 | Speed reading is not valid | | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace joint |
| C75A4 | System error=malfunction or inconsistent calibration detected | | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace joint |
| C75A8 | Supply voltage is out of range | | |
| C75A16 | Temperature is out of range | | |
| C75A32 | Signal lost =Misaligned readhead or damaged ring | | a) Do a Complete rebooting sequence.b) Check grounding and shielding for EMC problems.c) If this happens more than two times in a row, replace joint |

| C75A64 | Signal low =Too far from magnetic ring | | a) Do a Complete rebooting sequence.b) Check grounding and shielding for EMC problems.c) If this happens more than two times in a row, replace joint |
|---------|---|--|--|
| C75A128 | Signal saturation =Too close to magnetic ring | | a) Do a Complete rebooting sequence.b) Check grounding and shielding for EMC problems.c) If this happens more than two times in a row, replace joint |
| C75A200 | Position from joint encoder does not change while motor is running | | |
| C76A | Joint encoder communication CRC issue | Error between sensor and joint circuit | Check connections or very heavy electrical noise |
| C77A | Sudden position change detected on the joint-encoder | The position reading from the encoder was different than expected. | |
| C78A | Large sudden position change detected on the joint-encoder | The position reading from the encoder was severely different than expected, the latest measurement was discarded. The argument relates to the size of the position change. | |
| C85A200 | Position from motor encoder does not change while motor is running | | |
| C85A | Motor encoder error | | |
| C100A | Robot changed mode | Status warning, general mode change | Check preceding errors in log history |
| C101A | Real Robot Connected | | |
| C102A | Real Robot not connected – Simulating Robot | | |



| C103A | Communication issue | | |
|--------|---|---|--|
| C103A1 | Connection to Safety Control Board lost | PC did not receive 3 packets in a row | a) Check that the Ethernet cable between Motherboard and Control Board is connected.b) Do a Complete rebooting sequence |
| C103A2 | Package lost from Safety Control Board | | |
| C103A3 | Ethernet connection initialization with Safety Control Board failed | | |
| C104A | Error=Empty command sent to robot | | |
| C111A | Something is pulling the robot | | Check TCP configuration, payload and mounting settings |
| C115A | Unknown robot type | The robot type specified in the configuration is unknown | |
| C116A | Realtime part warning | Possible CPU-overload due to structure of user program | Restructure user program |
| C117A | Restart SCB failed | The Control Board couldn't be rebooted from the controller. | Do a Complete rebooting sequence |
| C150A | Protective Stop: Position close to joint limits | | |
| C151A | Protective Stop: Tool orientation close to limits | | |
| C152A | Protective Stop: Position close to safety plane limits | | |
| C153A | Protective Stop: Position deviates from path | | |

| reserved. |
|-----------------------------------|
| I riahts |
| A/S. Al |
| Robots, |
| -2021 by Universal Robots A/S. Al |
| 2021 by I |
| 2009-202 |
| opyriaht © |
| Ö |

| C153A0 | (base). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | Check payload, center of gravity and acceleration settings. |
|--------|--|---|
| C153A1 | (shoulder). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | Check payload, center of gravity and acceleration settings. |
| C153A2 | (elbow). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | Check payload, center of gravity and acceleration settings. |
| C153A3 | (wrist 1). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | Check payload, center of gravity and acceleration settings. |
| C153A4 | (wrist 2). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | Check payload, center of gravity and acceleration settings. |



| C153A5 | (wrist 3). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Check payload, center of gravity and acceleration settings. |
|--------|--|---|---|
| C154A | Protective Stop: Position in singularity | Robot cannot move linear near a singularity | Use MoveJ or change the motion |
| C155A | Protective Stop: Robot cannot maintain its position, check if payload is correct | | |
| C156A | Protective Stop: Wrong payload or mounting detected, or something is pushing the robot when entering Freedrive mode | The robot may move unexpected due to wrong settings | Verify that the TCP configuration and mounting in the used installation is correct |
| C157A | Protective Stop: Collision detected by joint | | |
| C157A0 | (base). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Make sure no objects are in the path of the robot and resume the program. |
| C157A1 | (shoulder). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Make sure no objects are in the path of the robot and resume the program. |

| C157A2 | (elbow). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Make sure no objects are in the path of the robot and resume the program. |
|--------|---|---|---|
| C157A3 | (wrist 1). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Make sure no objects are in the path of the robot and resume the program. |
| C157A4 | (wrist 2). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Make sure no objects are in the path of the robot and resume the program. |
| C157A5 | (wrist 3). Check payload, center of gravity and acceleration settings. Log screen may contain additional information. | | Make sure no objects are in the path of the robot and resume the program. |
| C158A | Protective Stop: Collision detected by joint | | |
| C158A0 | (base). The user specified payload is 0kg, please make sure this is correct. | Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. | Make sure the specified payload mass and center of gravity are correctly specified. |



| C158A1 (shoulder). The user specified payload is 0kg, please make sure this is correct. C158A2 (elbow). The user specified payload is 0kg, please make sure this is correct. C158A3 (wrist 1). The user specified payload is 0kg, please make sure this is correct. C158A4 (wrist 2). The user specified payload is 0kg, please make sure this is correct. C158A5 (wrist 2). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is 0kg, please make sure this is correct. C159A7 (base). The user specified payload is 0kg, please make sure this is correct. C159A8 (c159A0 (base). The user specified payload is 0kg, please make sure this is correct. C159A1 (shoulder). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A2 (e1bow). The user specified payload is 0kg, please make sure this is correct. C159A3 (preferent mance and/or protective stops. C159A4 (preferent mance and/or protective stops. C159A5 (preferent manc | | | | |
|--|--------|--|---|--|
| Specified payload is Okg, please make sure this is correct. C158A3 (wrist 1). The user specified payload is Okg, please make sure this is correct. C158A4 (wrist 2). The user specified payload is Okg, please make sure this is correct. C158A5 (wrist 3). The user specified payload is Okg, please make sure this is correct. C158A5 (wrist 3). The user specified payload is Okg, please make sure this is correct. C158A6 (wrist 3). The user specified payload is Okg, please make sure this is correct. C159A Protective Stop: Position deviates from path C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct | C158A1 | specified payload is 0kg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| specified payload is Okg, please make sure this is correct. C158A4 (wrist 2). The user specified payload is Okg, please make sure this is correct. C158A5 (wrist 3). The user specified payload is Okg, please make sure this is correct. C159A Protective Stop: Position deviates from path C159A0 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A1 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. Specifying an incorrect payload mass and center of gravity are correctly specified. Make sure the specified payload mass and center of gravity are correctly specified. Make sure the specified payload mass and/or center of gravity are correctly specified. Specifying an incorrect payload mass and center of gravity are correctly specified. Specifying an incorrect payload mass and center of gravity are correctly specified. Make sure the specified payload mass and center of gravity are correctly specified. Make sure the specified payload mass and center of gravity are correctly specified. Specifying an incorrect payload mass and center of gravity are correctly specified. Specifying an incorrect payload mass and center of gravity are correctly specified. Make sure the specified payload mass and/or center of gravity are correctly specified. Make sure the specified payload mass and center of gravity are correctly specified. | C158A2 | specified payload is 0kg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| specified payload is Okg, please make sure this is correct. C158A5 (wrist 3). The user specified payload is Okg, please make sure this is correct. C159A Protective Stop: Position deviates from path Okg, please make sure this is correct. C159A (shoulder). The user specified payload is Okg, please make sure this is correct. C159A1 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. Specifying an incorrect payload mass and center of gravity are correctly specified. Make sure the specified payload mass and/or center of gravity are correctly specified. Make sure the specified payload mass and/or center of gravity are correctly specified. Specifying an incorrect payload mass and center of gravity are correctly specified. Specifying an incorrect payload mass and center of gravity are correctly specified. Specified payload is of gravity may cause poor robot performance and/or protective stops. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. Specifying an incorrect payload mass and center of gravity are correctly specified. Make sure the specified payload mass and center of gravity are correctly specified. Make sure the specified payload mass and center of gravity are correctly specified. | C158A3 | specified payload is 0kg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| specified payload is Okg, please make sure this is correct. C159A Protective Stop: Position deviates from path C159A0 (base). The user specified payload is Okg, please make sure this is correct. C159A1 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A3 (elbow). The user specified payload is Okg, please make sure this is correct. C159A3 (elbow). The user specified payload is Okg, please make sure this is correct. C159A3 (elbow). The user specified payload is Okg, please make sure this is correct. C159A3 (elbow). The user specified payload is Okg, please make sure this is correct. C159A3 (elbow). The user specified payload is Okg, please make sure this is correct. C159A4 (elbow). The user specified payload is Okg, please make sure this is correct. C159A5 (elbow). The user specified payload is Okg, please make sure this is correct. C159A6 (elbow). The user specified payload is Okg, please make sure this is correct. C159A6 (elbow). The user specified payload is Okg, please make sure this is correct. C159A6 (elbow). The user specified payload is Okg, please make sure this payload mass and center | C158A4 | specified payload is Okg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| Position deviates from path C159A0 (base). The user specified payload is Okg, please make sure this is correct. C159A1 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A1 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload mass and/or center of gravity may cause poor gravity are correctly specified payload mass and center of gravity may cause poor gravity are correctly specified. | C158A5 | specified payload is 0kg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| specified payload is Okg, please make sure this is correct. C159A1 (shoulder). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload mass and/or center payload mass and center of of gravity may cause poor gravity are correctly specified. | C159A | Position deviates | | |
| specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload is Okg, please make sure this is correct. C159A2 (elbow). The user specified payload mass and/or center of of gravity may cause poor gravity are correctly specified. | C159A0 | specified payload is 0kg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| specified payload is payload mass and/or center payload mass and center of of gravity may cause poor gravity are correctly sure this is correct. | C159A1 | specified payload is Okg, please make | payload mass and/or center of gravity may cause poor robot performance and/or | payload mass and center of gravity are correctly |
| protective stops. | C159A2 | specified payload is 0kg, please make | payload mass and/or center of gravity may cause poor | payload mass and center of gravity are correctly |

| ved. |
|--|
| It @ 2009-2021 by Universal Robots A/S. All rights reserved. |
| |
| ahts |
| Ξ. |
| ₹ |
| Ś |
| Α, |
| bots |
| 8 |
| _ |
| erss |
| Jni |
| by I |
| _ |
| 202 |
|) |
| ĕ |
| 2 |
| 0 |
| Ħ |
| Sopyright © 2009 |
| > |
| do |
| Ö |

| C159A3 | (wrist 1). The user specified payload is 0kg, please make sure this is correct. | Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. | Make sure the specified payload mass and center of gravity are correctly specified. |
|--------|---|---|--|
| C159A4 | (wrist 2). The user specified payload is 0kg, please make sure this is correct. | Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. | Make sure the specified payload mass and center of gravity are correctly specified. |
| C159A5 | (wrist 3). The user specified payload is 0kg, please make sure this is correct. | Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. | Make sure the specified payload mass and center of gravity are correctly specified. |
| C160A | Protective stop: The robot was powered off last time due to a joint position disagreement | | a) Verify that the robot position in the 3D graphics matches the real robot, to ensure that the encoders function before releasing the brakes. Stand back and monitor the robot performing its first program cycle as expected. b) If the position is not correct, the robot must be repaired. In this case, click Power Off Robot. c) If the position is correct, please tick the check box below the 3D graphics and click Robot Position Verified |



| C161A | Protective stop: Large movement of the robot detected while it was powered off. The joints were moved while it was powered off, or the encoders do not function | | a) Verify that the robot position in the 3D graphics matches the real robot, to ensure that the encoders function before releasing the brakes. Stand back and monitor the robot performing its first program cycle as expected. b) If the position is not correct, the robot must be repaired. In this case, click Power Off Robot. c) If the position is correct, please tick the check box below the 3D graphics and click Robot Position Verified |
|--------|---|---|--|
| C162A | The protective stop was likely caused by incorrectly specified payload mass and/or center of gravity. | Specifying an incorrect payload mass and/or center of gravity may cause poor robot performance and/or protective stops. | Make sure the specified payload mass and center of gravity are correct. |
| C171A | Issue with blends | | |
| C171A0 | A MoveC-waypoint were skipped due to a blend. | The value for the blend radius is too large compared to the distance between the waypoints. | Decrease the blend radius or choose waypoints that are further apart. |
| C171A1 | Blend radius too small in a MoveC | | Increase blend in MoveC |
| C171A3 | A ServoC-waypoint were skipped due to a blend. | The value for the blend radius is too large compared to the distance between the waypoints. | Decrease the blend radius or choose waypoints that are further apart. |
| C171A4 | Overlapping Blends in a MoveJ, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
| C171A5 | Overlapping Blends in a MoveJ, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |

| C171A6 | Overlapping Blends in a MoveJ, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
|---------|--|---|--|
| C171A7 | Overlapping Blends in a MoveJ, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
| C171A9 | A MoveP-waypoint were skipped due to a blend. | The value for the blend radius is too large compared to the distance between the waypoints. | Decrease the blend radius or choose waypoints that are further apart. |
| C171A10 | Blend radius too small error in a MoveP | | |
| C171A11 | Overlapping Blends in a MoveL, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
| C171A12 | Overlapping Blends in a MoveL, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
| C171A13 | Overlapping Blends in a MoveL, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
| C171A14 | Overlapping Blends in a MoveL, a waypoint was skipped | | Decrease the blend radius or choose waypoints that are further apart. |
| C172A | Illegal control mode | | |
| C173A0 | Robot motion causes too high joint torques on Base. | | Review your accelerations, blends and if there are collisions or excessive torques in the joint, adjust accordingly. |
| C173A1 | Robot motion causes too high joint torques on Shoulder. | | Same as C173A0 |



| C173A2 | Robot motion causes too high joint torques on Elbow. | Same as C173A0 |
|---------|---|----------------|
| C173A3 | Robot motion causes too high joint torques on Wrist 1. | Same as C173A0 |
| C173A4 | Robot motion causes too high joint torques on Wrist 2. | Same as C173A0 |
| C173A5 | Robot motion causes too high joint torques on Wrist 3. | Same as C173A0 |
| C173A6 | Robot motion causes too high joint torques on Base. Problem identified in program | Same as C173A0 |
| C173A7 | Robot motion causes too high joint torques on Shoulder. Problem identified in program | Same as C173A0 |
| C173A8 | Robot motion causes too high joint torques on Elbow. Problem identified in program | Same as C173A0 |
| C173A9 | Robot motion causes too high joint torques on Wrist 1. Problem identified in program | Same as C173A0 |
| C173A10 | Robot motion causes too high joint torques on Wrist 2. Problem identified in program | Same as C173A0 |
| C173A11 | Robot motion causes too high joint torques on Wrist 3. Problem identified in program | Same as C173A0 |

| ∺ |
|---------------------|
| ě |
| 2 |
| Se |
| ē |
| S |
| ahts |
| .2 |
| = |
| ⋖ |
| δį |
| ₹ |
| S |
| ŏ |
| Rob |
| ~ |
| a |
| S |
| Š |
| Ξ |
| $\overline{}$ |
| 2021 by Universal F |
| $\overline{}$ |
| 6 |
| -2 |
| © 2009-202 |
| 8 |
| S |
| 0 |
| Ħ |
| .0 |
| Σ |
| ŏ |
| S |
| |

| C174A0 | Robot motion causes too high jump in joint torques on Base. | |
|--------|--|--|
| C174A1 | Robot motion causes too high jump in joint torques on Shoulder. | |
| C174A2 | Robot motion causes too high jump in joint torques on Elbow. | |
| C174A3 | Robot motion causes too high jump in joint torques on Wrist 1. | |
| C174A4 | Robot motion causes too high jump in joint torques on Wrist 2. | |
| C174A5 | Robot motion causes too high jump in joint torques on Wrist 3. | |
| C174A6 | Base. Problem identified when executing program on a specified line. | |
| C174A7 | Shoulder. Problem identified when executing program on a specified line. | |
| C174A8 | Elbow. Problem identified when executing program on a specified line. | |
| C174A9 | Wrist 1. Problem identified when executing program on a specified line. | |



| C174A10 | Wrist 2. Problem identified when executing program on a specified line. | | |
|---------|---|---|--|
| C174A11 | Wrist 3. Problem identified when executing program on a specified line. | | |
| C187A1 | Temperature sensor test failed | Starting temperature were lower than expected | Make sure that the robot is running on the allowed range of temperature. |
| C187A2 | Temperature sensor test failed | Starting temperature were higher than expected | Same as C187A1 |
| C187A3 | Temperature sensor test failed | Temperature increased less than expected during warm up | Same as C187A1 |
| C187A4 | Temperature sensor test failed | Temperature increased more than expected during warm up | Same as C187A1 |
| C191A | Safety system violation | | |
| C191A1 | Joint position limit violated | The maximum range has been exceeded | |
| C191A2 | Joint speed limit violated | The maximum speed has been exceeded | |
| C191A3 | TCP speed limit violated | The maximum speed has been exceeded | |
| C191A4 | TCP position limit violated | The maximum range has been exceeded | |
| C191A5 | TCP orientation limit violated | The maximum orientation has been exceeded | |
| C191A6 | Power limit violated | The maximum power has been exceeded | |
| C191A7 | Joint torque window violated | The maximum torque has been exceeded | |
| C191A8 | Joint torque window too large | The maximum torque has been exceeded | |
| C191A9 | Reduced mode output violation | | |
| C191A10 | Safeguard stop output violation | | |

| 7 | - |
|---|--|
| | ĭ |
| - | 3 |
| 1 | _ |
| i | 1) |
| i | 7 |
| ď | 1 |
| ı, | ۳ |
| ľ | |
| 1 | S |
| 7 | = |
| 7 | = |
| | _ |
| 1 | _ |
| _ | _ |
| - | 7 |
| ٠ | 4 |
| | |
| c | n |
| ` | ` |
| < | 1 |
| | |
| 8 | 1 |
| 7 | ╮ |
| 1 | ≍ |
| - | = |
| Ľ | _ |
| C | r |
| _ | _ |
| 1 | τ |
| | 'n |
| 1 | _ |
| 1 | U |
| | |
| | > |
| ٠ | ≧ |
| - | \geq |
| - | 5 |
| - | |
| | |
| 1 | |
| 7 | |
| 7 7 7 | |
| 7.7 1.7 | |
| 7.7 7.7 | |
| 2007 | VIUO VO 1202- |
| | 1-202 DV UNIV |
| | 3-707 DV UNIV |
| | 0.00 VO 1.202-60 |
| | 008-2021 By UNIV |
| | 7003-6007 pv Ullvi |
| | VIUO VO 1202-6002 V |
| | 0 Z009-Z0Z DV UNIV |
| | NIUO AG 707_6007 |
| 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | |
| 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | NIUO AO 1707-6007 ⊚ 1UI |
| 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | MIND VO 1202-8002 © 100 |
| 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | VIII @ 2009-2021 DV UNIV |
| © 0000 0001 F | WIID W 2009-2021 DV UNIV |
| 1 | 0/110 V0 1202-2002 © 10011V0 |
| 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | 00VF10H1 @ 2009-2021 DV UHIV |
| 0.2 | CODVII 0 2009-2021 DV UNIV |
| C. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. | CODVII @ 2009-2021 by Universal Robols A/S. All rights reserved. |
| 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | Copyright @ 2009-2021 by Univ |

| C191A11 | Emergency stop output violation | | |
|---------|--|--|---|
| C191A12 | Momentum limit violation | | |
| C191A13 | Robot moving output violation | | |
| C191A14 | Robot is not braking in stop mode | During the braking process, the safety system monitors if the robot brakes as expected. If this is not the case, this error is generated | Check TCP configuration, payload and mounting settings |
| C191A15 | Robot is moving in stop mode | When the robot is stopped due to a safety violation or a safeguard stop, the safety system generates this error, if the robot moves while in this mode | a) Check if the robot is physically pushed while safeguard stopped.b) Check TCP configuration, payload and mounting settings |
| C191A16 | Robot did not stop in time | | |
| C191A17 | Received a null vector for TCP orientation | | |
| C191A18 | Robot not stopping output violation | | |
| C191A19 | Invalid safety IO configuration | | |
| C191A20 | Configuration information or limit sets not received | | |
| C191A21 | The other safety processor detected a violation | | |
| C191A22 | Received unknown command from Controller | | |
| C191A23 | Invalid setup of safety limits | | a) Check Firmware/updatefirmware.b) Do a Complete rebootingsequence |



| C191A24 | Reduced Mode Output set, while it should not be | a) Check Firmware/updatefirmware.b) Do a Complete rebootingsequence |
|---------|---|---|
| C191A25 | Reduced Mode Output not set, while it should be | a) Check Firmware/updatefirmware.b) Do a Complete rebootingsequence |
| C191A26 | Not Reduced Mode Output set, while it should not be | a) Check Firmware/updatefirmware.b) Do a Complete rebootingsequence |
| C191A27 | Not Reduced Mode Output not set, while it should be | a) Check Firmware/update firmware.b) Do a Complete rebooting sequence |
| C191A28 | Robot Emergency Stop exceeded maximum stop time | a) Check that max payload of the robot has not been exceeded.b) Check TCP configuration, payload and mounting settings |
| C191A29 | System Emergency Stop exceeded maximum stop time | a) Check that max payload of the robot has not been exceeded.b) Check TCP configuration, payload and mounting settings |
| C191A30 | Safeguard Stop exceeded maximum stop time | a) Check that max payload of the robot has not been exceeded.b) Check TCP configuration, payload and mounting settings |
| C191A31 | Operation mode switch is present while the three position switch is missing | |
| C191A32 | Joint speed limit violated – Base | |
| C191A33 | Joint speed limit violated – Shoulder | |

| C191A34 | Joint speed limit violated – Elbow | | |
|---------|---|---|--|
| C191A35 | Joint speed limit violated – Wrist 1 | | |
| C191A36 | Joint speed limit violated – Wrist 2 | | |
| C191A37 | Joint speed limit violated – Wrist 3 | | |
| C192A | Safety system fault | | |
| C192A1 | Robot still powered in emergency stop | When the emergency stop is active, the robot arm powers off. The controller is responsible for sending the power off command. This error is generated if the safety system detects that the robot arm still has power | |
| C192A2 | Robot emergency stop disagreement | E-stop in teach pendant or in robot E-stop circuit problem | Check safety devices and cables/connections to these devices. |
| C192A3 | System emergency stop disagreement | System E-stop circuit problem | Check safety devices and cables/connections to these devices. |
| C192A4 | Safeguard stop disagreement | Safeguard circuit problem | Check safety devices and cables/connections to these devices. |
| C192A5 | Euromap safeguard stop disagreement | Euromap circuit problem | Check cables from Control Board to Euromap and to external machine |
| C192A6 | Joint position disagreement | | a) Check TCP configuration, payload and mounting settings.b) Check that safety settings respected |
| C192A7 | Joint speed disagreement | | a) Check TCP configuration, payload and mounting settings.b) Check that safety settings respected |



| C192A8 | Joint torque disagreement | | a) Check TCP configuration, payload and mounting settings.b) Check that safety settings respected |
|---------|--|--|--|
| C192A9 | TCP speed disagreement | | a) Check TCP configuration, payload and mounting settings.b) Check that safety settings respected |
| C192A10 | TCP position disagreement | | a) Check TCP configuration, payload and mounting settings.b) Check that safety settings respected |
| C192A11 | TCP orientation disagreement | | a) Check TCP configuration, payload and mounting settings.b) Check that safety settings respected |
| C192A12 | Power disagreement | Power calculation: uP-A and uP-B disagreement | |
| C192A13 | Joint torque window disagreement | | |
| C192A14 | Reduced mode input disagreement | Safety I/O uP-A and uP-B disagreement | Check safety devices and cables/connections to these devices |
| C192A15 | Reduced mode output disagreement | Safety I/O uP-A and uP-B disagreement | Check safety devices and cables/connections to these devices |
| C192A16 | Safety output failed | The safety output did not reach the correct value in the expected time | Check for short circuit on I/O or for wrong connection to output. |
| C192A17 | Safeguard stop output disagreement | Safety I/O uP-A and uP-B disagreement | Check safety devices and cables/connections to these devices |
| C192A18 | The other safety processor is in fault | | |
| C192A19 | Emergency stop output disagreement | Safety I/O uP-A and uP-B disagreement | Check safety devices and cables/connections to these devices |

| C192A20 | SPI output error detected | Power supply for the I/O is not detected | Check if the connection to the internal power supply is correct. If an external power supply is being used, check if it is powered on and at the correct voltage. |
|---------|---|--|--|
| C192A21 | Momentum disagreement | | |
| C192A22 | Robot moving output disagreement | | Check safety devices and cables/connections to these devices |
| C192A23 | Wrong processor ID | | |
| C192A24 | Wrong processor revision | | |
| C192A25 | Potential brownout detected | Voltage drop on Control Board or defect Safety Control Board | |
| C192A26 | Emergency stop output disagreement | | Check safety devices and cables/connections to these devices |
| C192A27 | Safeguard stop output disagreement | | Check safety devices and cables/connections to these devices |
| C192A28 | Robot not stopping output disagreement | | Check safety devices and cables/connections to these devices |
| C192A29 | Safeguard reset input disagreement | | Check safety devices and cables/connections to these devices |
| C192A30 | Safety processor booted up in fault mode | | |
| C192A31 | Reduced Mode Output disagreement | | Check safety devices and cables/connections to these devices |
| C192A32 | Not Reduced Mode Output disagreement | | Check safety devices and cables/connections to these devices |
| C192A33 | A timing issue occurred during startup. Please restart to proceed | Checksum disagreement between safety processors uA and uB | |



| C192A34 | User safety config checksum disagreement between uA and GUI | |
|---------|--|---|
| C192A35 | Robot config checksum disagreement between uA and GUI | |
| C192A36 | Online RAM test failed | |
| C192A37 | Not all safety related functionalities are running | |
| C192A38 | Package too short for CRC calculation | |
| C192A39 | Three position switch input disagreement | |
| C192A40 | Operation mode switch input disagreement | |
| C193A | One of the nodes is in fault mode | |
| C193A0 | Base Joint | a) See previous error.b) Update the firmware on the joint.c) Do a Complete rebooting sequence |
| C193A1 | Shoulder Joint | a) See previous error.b) Update the firmware on the joint.c) Do a Complete rebooting sequence |
| C193A2 | Elbow Joint | a) See previous error.b) Update the firmware on the joint.c) Do a Complete rebooting sequence |

| þ |
|------------|
| چ |
| ē |
| S |
| _ |
| 22 |
| 듬 |
| ·Ξ |
| = |
| ⋖ |
| S |
| ₹ |
| S |
| to |
| چ |
| ž |
| = |
| iversal Ro |
| - |
| .≝ |
| _ |
| ب |
| 2021 by L |
| _ |
| 2009-202 |
| 2 |
| Ţ |
| 8 |
| 2 |
| |
| 9 |
| 프 |
| ٥. |
| ≥ |
| 0 |
| Ö |
| |
| |

| C193A3 | Wrist 1 Joint | | a) See previous error.b) Update the firmware on the joint.c) Do a Complete rebooting sequence |
|---------|---|--|---|
| C193A4 | Wrist 2 Joint | | a) See previous error.b) Update the firmware on the joint.c) Do a Complete rebooting sequence |
| C193A5 | Wrist 3 Joint | | a) See previous error.b) Update the firmware on the joint.c) Do a Complete rebooting sequence |
| C193A6 | Tool | | a) See previous error.b) Do a Complete rebooting sequence |
| C193A7 | Screen 1 | Control Board has detected an error on Safety processor 1 in Teach pendant | a) See previous error.b) Do a Complete rebooting sequence |
| C193A8 | Screen 2 | Control Board has detected an error on Safety processor 2 in Teach pendant | a) See previous error.b) Do a Complete rebooting sequence |
| C193A9 | Euromap 1 | | a) See previous error.b) Do a Complete rebooting sequence |
| C193A10 | Euromap 2 | | a) See previous error.b) Do a Complete rebooting sequence |
| C194A | One of the nodes is not booted or not present | | |
| C194A0 | Base Joint | | |
| C194A1 | Shoulder Joint | | |
| C194A2 | Elbow Joint | | |
| C194A3 | Wrist 1 Joint | | |
| C194A4 | Wrist 2 Joint | | |
| C194A5 | Wrist 3 Joint | | |
| C194A6 | Tool | | |



| C194A7 | Screen 1 | Control Board has detected an error on Safety processor 1 in Teach pendant | |
|----------|--|--|---|
| C194A8 | Screen 2 | Control Board has detected an error on Safety processor 2 in Teach pendant | |
| C194A9 | Euromap 1 | | |
| C194A10 | Euromap 2 | | |
| C194A128 | Base not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C194A129 | Shoulder not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C194A130 | Elbow not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C194A131 | Wrist 1 not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C194A132 | Wrist 2 not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C194A133 | Wrist 3 not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C194A134 | Tool not ready while brake release requested | Must be at least in IDLE mode when the brake release is requested | Check for loose communication cable |
| C195A | Conveyor speed too high | Conveyor speed higher than robot can run | Make sure that conveyor tracking is set up correctly |
| C195A1 | for joint speed safety limit | | |
| C195A2 | for TCP speed safety limit | | |
| C195A3 | for momentum safety limit | | |
| C196A | MoveP speed too high | Too high speed in relation to blend radius | Reduce speed or increase blend radius in user program |
| C197A | Blend overlap warning | | Review blend values in the program |

| C200A | Safety Control Board hardware error | | Check Safety Control Board functionality |
|--------|-------------------------------------|--|--|
| C200A1 | Hardware ID is wrong | Safety Control Board: uP-A has detected an error: Wrong Safety Control Board | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A2 | MCU type is wrong | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A3 | Part ID is wrong | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A4 | RAM test failed | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A5 | Register test failed | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A6 | pRom Crc test failed | Safety Control Board: uP-A has detected an error: firmware error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A7 | Watchdog reset the processor | Safety Control Board: uP-A has detected an error | |
| C200A8 | OVG signal test not passed | Safety Control Board: uP-A has detected an error: over voltage generator | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |



| C200A9 | 3V3A power good pin is low | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
|---------|----------------------------|---|---|
| C200A10 | 3V3B power good pin is low | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A11 | 5V power good is low | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A12 | 3V3 voltage too low | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A13 | 3v3 voltage too high | Safety Control Board: uP-A has detected an error | a) Do a Complete rebooting sequence.b) If this happens more than two times in a row, replace Safety Control Board |
| C200A14 | 48V input is too low | | a) Do a Complete rebooting sequence.b) Check 48 V Power supply, current distributer, energy eater and Control Board for issues |
| C200A15 | 48V input is too high | | a) Do a Complete rebooting sequence.b) Check 48 V Power supply, current distributer, energy eater and Control Board for issues |
| C200A16 | 24V IO short circuited | Too high current | a) Do a Complete rebooting sequence.b) Disconnect external I/O connections and check external power supply if connected |

| C200A17 | PC current is too high | Motherboard takes too high current | a) Do a Complete rebooting sequence. b) Check cable between Control Board and Motherboard and check all connections to Motherboard. Also check for short circuit |
|---------|--------------------------------------|------------------------------------|--|
| C200A18 | Robot voltage is too low | | a) Do a Complete rebooting sequence.b) Check for short circuit in robot arm.c) Check 48 V Power supply, current distributer, energy eater and Control Board for issues |
| C200A19 | Robot voltage is too high | | a) Do a Complete rebooting sequence.b) Check 48 V Power supply, current distributer, energy eater and Control Board for issues |
| C200A20 | 24V IO voltage is too low | | a) Do a Complete rebooting sequence.b) Disconnect I/O, check external power supply if connected and check Control Board for issues |
| C200A21 | 12V voltage is too high | | a) Do a Complete rebooting sequence.b) Check 12 V Power supply, cables and Control Board for issues |
| C200A22 | 12V voltage is too low | | a) Do a Complete rebooting sequence.b) Check 12 V Power supply, cables and Control Board for issues |
| C200A23 | It took too long to stabilize 24V | | a) Do a Complete rebooting sequence.b) Check 24 V and Control Board for issues |



| C200A24 | It took too long to stabilize 24V IO | | a) Do a Complete rebooting sequence.b) Check 24 V and Control Board for issues |
|---------|--|---|--|
| C200A25 | 24V voltage is too high | | a) Check external 24 V and Control Board for issues.b) Do a Complete rebooting sequence.c) If this happens more than two times in a row, replace Safety Control Board. |
| C200A26 | 24V IO voltage is too high | | a) Disconnect I/O's.b) Do a Complete rebooting sequence.c) Check external 24 V and Control Board for issues |
| C201A | Setup of Safety Control Board failed | | |
| C201A0 | Setup of Safety Control Board failed | No data was received from the Control Board at initialization or invalid safety parameters have been received | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C201A1 | SCB uA is not responding | No data or invalid data was received from the Control Board uA at initialization | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C201A2 | SCB uB is not responding | No data or invalid data was received from the Control Board uB at initialization | Do a Complete rebooting sequence. |
| C201A3 | SCB is not responding | No data or invalid was received from Control Board when requested for configuration parameters | Do a Complete rebooting sequence. |
| C202A | SCE configuration was illegal, after applying tolerances | | |

| C203A | PolyScope detected a mismatch between the shown and (to be) applied safety parameters | PolyScope continuously verifies that the shown safety parameters are equal to the running parameters | a) Check that the software version is the same or newer than the firmware on the Safety Control Board.b) Reload the installation.c) Do a Complete rebooting sequence |
|--------|---|--|--|
| C204A | Protective Stop: Path sanity check failed | | |
| C204A1 | Sudden change in target position | | |
| C204A2 | Inconsistency between target position and speed | Controller is detecting that position in current cycle has changed much more than it should based on expected joint speed. | a) Either an incorrect payload is mounted, or an external force is pushing the robot.b) Check TCP configuration, payload and mounting settings. |
| C204A3 | Sudden stop | The program contains motions that are not ramped correctly down | To abort a motion, use \stopj\" or \"stopl\" script commands to generate a smooth deceleration before using \"wait\". Avoid aborting motions between waypoints with blend" |
| C204A4 | Robot has not stopped in the allowed reaction and braking time | | |
| C204A5 | Robot program resulted in invalid setpoint | | Review waypoints in the program |
| C204A6 | Blending failed and resulted in an invalid setpoint | | Try changing the blend radius or contact technical support |
| C204A7 | Robot approaching singularity – Acceleration threshold failed | | Review waypoints in the program, try using MoveJ instead of MoveL in the position close to singularity |
| C205A | Target speed does not match target position | | |



| C205A0 | Inconsistency between target position and speed | | |
|--------|--|---|---|
| C206A | Sanity check failed | | |
| C206A0 | Target joint speed does not match target joint position change – Base | | |
| C206A1 | Target joint speed does not match target joint position change – Shoulder | | |
| C206A2 | Target joint speed does not match target joint position change – Elbow | | |
| C206A3 | Target joint speed does not match target joint position change – Wrist 1 | | |
| C206A4 | Target joint speed does not match target joint position change – Wrist 2 | | |
| C206A5 | Target joint speed does not match target joint position change – Wrist 3 | | |
| C207A | Fieldbus input disconnected | | Check fieldbus connections (RTDE, ModBus, EtherNet/IP and Profinet) or disable the fieldbus in the installation. Check RTDE watchdog feature. Check if a URCap is using this feature. |
| C208A | Debug Assertion failed | An assert was executed. Notice: The functionality is exclusively used for testing purposes. | |
| C209A | A protective stop was triggered (for test purposes only) | A protective stop was triggered. Notice: The functionality is exclusively used for testing purposes. | |

| C210A | Socket is read-only when the robot is in local (Teach pendant) control | | Set the robot in remote control in PolyScope to enable receiving scripts in the controller |
|--------|---|---|---|
| C211A | Operational mode changed | | |
| C211A0 | Disabled | | |
| C211A1 | Automatic | | |
| C211A2 | Manual | | |
| C212A | Name conflict in loaded program | | |
| C212A1 | Name conflict(s) occurred between feature names and program variables | Some feature names and program variables share the same name, which may cause confusion. | Rename the program variables. |
| C213A | No Kinematic Calibration found (calibration.conf file is either corrupt or missing) | Calibration.conf file is either corrupt or missing | A new kinematics calibration may be needed if the robot needs to improve its kinematics, otherwise, ignore this message. |
| C214A | Kinematic Calibration for the robot does not match the joint(s) | The calibration checksum stored in the calibration.conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |
| C214A1 | The Kinematic Calibration checksum does not match the Base checksum | The calibration checksum stored in the calibration.conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |
| C214A2 | The Kinematic Calibration checksum does not match the Shoulder checksum | The calibration checksum stored in the calibration.conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |



| C214A3 | The Kinematic Calibration checksum does not match the Elbow checksum | The calibration checksum stored in the calibration.conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |
|--------|--|---|---|
| C214A4 | The Kinematic Calibration checksum does not match Wrist 1 checksum | The calibration checksum stored in the calibration conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |
| C214A5 | The Kinematic Calibration checksum does not match for Wrist 2 checksum | The calibration checksum stored in the calibration.conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |
| C214A6 | The Kinematic Calibration checksum does not match for Wrist 3 checksum | The calibration checksum stored in the calibration.conf does not match the values from the joint(s) | If moving a program from a different robot to this one, re-kinematic calibrate the second robot to improve kinematics, otherwise ignore this message. |
| C215A | Kinematic Calibration does not match the robot | The calibration checksum stored in the calibration.conf does not match the values from the joints | Check if the serial number of the robot arm matches the Control Box |
| C216A | The offset of the joint has changed | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |
| C216A1 | Base | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |
| C216A2 | Shoulder | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |

| rved. |
|------------------|
| reser |
| |
| riahts |
| |
| ₹ |
| A/S |
| ts' |
| I Robots |
| - - |
| Universal R |
| J. |
| þ |
| 3 2009-2021 by L |
| 9- |
| 1ht © 200 |
| (O |
| pyriahi |
| ပိ |

| C216A3 | Elbow | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |
|--------|---|--|---|
| C216A4 | Wrist 1 | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |
| C216A5 | Wrist 2 | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |
| C216A6 | Wrist 3 | | The joint has been zeroed by the user. Perform a kinematic calibration to improve kinematics if needed. |
| C217A | Blank space detected at the beginning of a string | Leading blank spaces in strings are ignored in this version | Make sure that these leading blank spaces are intentional otherwise remove them |
| C218A | A thread used a lot of time | There may be an infinite loop or other command that does not move the robot, this can cause program overload | Add a Wait command or sync () script to split long program sequences and have sequenced processing time |
| C218A0 | Main Robot Program used a lot of time | | Use a wait command or sync () script |
| C218A1 | A thread used a lot of time | | Use a wait command or sync () script |
| C219 | Change in offset is too high | Following the specified offsets would result in the robot exceeding safety limits | |
| C219A1 | Close to joint speed safety limit | | Review program speed and acceleration |
| C219A2 | Close to tool speed safety limit | | Review program speed and acceleration |
| C219A3 | Close to momentum safety limit | | Review program speed and acceleration |
| | | | |



| C220A1 | Kinematic Calibration | Actual version on the robot arm is not supported | Update Software |
|-------------------------|--------------------------|--|--|
| C220A2 | Kinematic Calibration | Kinematic Calibration file was replaced with file from the arm | Update Software |
| C220A3 | Kinematic Calibration | Kinematic Calibration uploaded to the arm | Update Software |
| C220A4 | Kinematic Calibration | Kinematic Calibration reuploaded to the arm | Update Software |
| C257A | Unknown message | | |
| C258A | Invalid Payload | | Please insert a valid payload |
| C259A | Filesystem related issue | | |
| C259A0 to C259A81 | Critical error | A critical error occurred in the filesystem | a) Do a Complete rebooting sequence b) Update robot Software c) Reimage SD card d) Contact your local Universal Robots service provider for assistance. |
| C260A | Brake Release | Brake release not responding properly | a) Check the brake release system b) Do a Complete rebooting sequence c) Contact your local Universal Robots service provider for assistance. |
| C260A0 | Critical error | A critical error occurred during Brake Release | a) Do a Complete rebooting sequence b) Ensure the mounted payload, TCP and CoG matches your configuration. c) Update robot software d) For further assistance, contact your local Universal Robots service provider. |
| C260A1 to C260A21 | Brake Release | Motor moved only | |
| C261A | Temperature Sensor | | |
| | | | |

| C261A0 to C261A3 | Critical error | A critical error occurred in the temperature sensor | a) Do a Complete rebooting sequenceb) Contact your local Universal Robots service provider for assistance. |
|-------------------------|---|---|---|
| C261A4 to C261A15 | Temperature is too high (degrees Celsius) | Ambient temperature is too high or low. Temperature sensor read a temperature outside the allowed range. | a) Check robot's environment and make sure the robot is operating within recommended limits.b) Do a Complete rebooting sequence |
| C262A | Communication | | |
| C262A0 to C262A18 | Critical error | A critical error occurred in the communication framework | a) Check communications external and internal b) Do a Complete rebooting sequence c) Check for ESD noise d) Update software e) Contact your local Universal Robots service provider for assistance. |
| C263A | Motor Encoder | | |
| C263A0 to C263A31 | Critical error on Motor Encoder | A critical error occurred in the Motor Encoder. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C264A | Task Manager | | |
| C264A0 to C264A11 | Critical error on Task Manager | A critical error occurred in the task manager. Overload of the task manager. | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots serviceprovider for assistance. |
| C265A | Joint Encoder | | |
| C265A0 to C265A30 | Critical error on Joint encoder | A critical error occurred in the Joint Encoder | a) Do a Complete rebooting sequence b) Update robot's software c) Check for ESD noise d) Update software e) Contact your local Universal Robots service provider for assistance. |



| C267A | Bootloader error | Corrupted firmware | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|-------------------------|---|---|--|
| C267A0 to C267A11 | Critical error on Bootloarder | A critical error occurred during Firmware upgrade. Hardware configuration mismatch. | Check your image, SCB, MB or TP for bootloader fixes. Update software. |
| C268A0 | Special Command | Received unhandled command cmd | |
| C268A1 | Special Command | Recieved Set Zero Command at too high speed | |
| C269A | Transceiver | Fieldbus transmitting and receiving of information failed | |
| C269A0 to C269A70 | Transceiver | | |
| C271 | Low-level runtime thread | Process running behind | a) Check that the program and client interface is not taking unnecessary resources. |
| C271A1 to C271A5 | Runtime is too much behind | One of the threads might be using too much time | Consider using a Wait or sync() to split long program sequences that do not move the robot. |
| C272A | Missing joint calibration | | |
| C272A0 to C272A6 | Critical error – the calibration is missing | calibration could not be loaded | a) Update softwareb) Contact your localUniversal Robots serviceprovider for assistance. |
| C273A | Cross monitoring | | |
| C273A0 | Critical error | A critical disagreement error occurred in the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |

| C273A1 | Cross monitoring | Float value on A-side | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
|--------|--|--|--|
| C273A2 | Cross monitoring | Float value on B-side | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A3 | Cross monitoring | Unsigned value on A-side | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A4 | Cross monitoring | Unsigned value on B-side | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A5 | Disagreement on Safety Control Board State | A critical disagreement occurred within the safety system. | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A6 | Disagreement on Robot State | A critical disagreement occurred within the safety system. | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A7 | Disagreement on Safety State | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |



| C273A8 | Disagreement on position | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|--|---|--|
| C273A9 | Disagreement on velocity | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A10 | Disagreement on current | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A11 | Disagreement on temperature | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A12 | Disagreement on Teach Pendant State | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A13 | Disagreement on Teach Pendant Emergency Stop | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A14 | One processor entered Fault State | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| C273A15 | One processor entered Violation State | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|---|---|--|
| C273A16 | Joint State disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A17 | Joint Constant Data CRC disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A18 | Joint target current disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A19 | Torque Window disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A20 | Torque Error disagreement | A critical disagreementoccurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A21 | Target Velocity disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |



| C273A22 | Target Acceleration disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|--|---|--|
| C273A23 | Recovery Mode CRC disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A24 | Robot Configuration CRC disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A25 | User Configuration CRC disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A26 | Maximum stopping time disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A27 | Stopping Time Torque Overload disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A28 | Disagreement error on a specific joint | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| C273A29 | Tool speed disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
|---------|---|---|--|
| C273A30 | Safety Mode Limit disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A31 | Hand Protection Distance disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A32 | Elbow Sphere speed disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A33 | Momentum disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A34 | Power disagreeement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A35 | Elbow position disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |



| C273A36 | Workpiece Rotation disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|---|---|--|
| C273A37 | Disagreement on Workpiece Position | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A38 | Disagreement on motor parameter (R_ pp) | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A39 | Disagreement on motor parameter (L_ pp) | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A40 | Disagreement on motor parameter (Kb) | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A41 | Disagreement on motor parameter (Kt) | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A42 | Disagreement on motor parameter (T) | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| C273A43 | Disagreement on the Teach Pendant's Three-Position Enabling Device | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
|---------|---|---|--|
| C273A44 | Disagreement on the active status of the Teach Pendant's Three-Position Enabling Device | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A45 | Cross monitoring | Disagreement on user safety configuration version, major | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A46 | Cross monitoring | Disagreement user safety configuration version, minor | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A47 | Disagreement on state | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C273A48 | Disagreement on Injection-Molding- Machine-Interface Emergency Stop input | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A49 | Disagreement on Injection-Molding- Machine-Interface Emergency Stop output | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |



| C273A50 | Disagreement on Injection-Molding- Machine-Interface Safeguard input | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|---|---|--|
| C273A51 | Disagreement on Injection-Molding- Machine-Interface type | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A52 | Disagreement on Torque Parameters CRC | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A53 | Target Torque disagreement | A critical disagreement occurred within the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A54 | Cross monitoring | Disagreement on hardware configuration CRC | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A55 | Cross monitoring | Disagreement on compensation current | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C273A56 | Cross monitoring | Disagreement on external torque target | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C274A1 | Control box fan error | Fan is not running | |
| C274A2 | Control box fan error | Monitoring data timed out | |

| C274A3 | Control box fan error | Check Fan speed | |
|-------------------------|-----------------------------|---|--|
| C275A0 to C275A6 | Brake release | | Check payload settings. Check for robot stuck. |
| C276A | Uart between microprocessor | | |
| C276A0 to C276A14 | Critical error | A critical error occurred in the UART driver | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots serviceprovider for assistance. |
| C277A1 to C277A11 | Memory | Memory allocation | Release some memory from the programs or check URCap or too much files in the robot |
| C278A | Servo in Joint A processor | | |
| C278A0 to C278A13 | Critical error | A critical error occurred in the servo module | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C279A | Flash in joint | | |
| C279A0 to C279A20 | Critical error | A critical error occurred in the flash driver | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C280A | Real-time error | | |
| C280A0 to C280A9 | Critical error | A critical real-time error occurred | a) Do a Complete rebooting sequence b) Update software c) Check communication between joints d) Contact your local Universal Robots service provider for assistance. |
| C281A | Robot State Machine | | |
| | | | |



| C281A0 | Critical error | A critical State Machine error occurred | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|--------|--------------------------------------|---|--|
| C281A1 | Robot State Machine | An invalid transition occurred in the code | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C281A2 | Robot State Machine | An invalid Robot State occured | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C281A3 | Joint entered the Fault State | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C281A4 | Joint entered the Violation State | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C281A5 | Robot State Machine | Shutdown took too long, check robot voltage | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C281A6 | Robot State Machine | Moved to an unhandled state | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| 0 |
|--------------------------|
| rvec |
| > |
| 6 |
| ő |
| ä |
| _ |
| S |
| ≅ |
| aht |
| .≌ |
| _ |
| = |
| ⋖ |
| |
| S |
| > |
| obots A |
| ဟ |
| pots |
| \simeq |
| $\stackrel{\prec}{\sim}$ |
| ≈ |
| ш |
| $\overline{\epsilon}$ |
| 100 |
| ~ |
| Ð |
| iversal F |
| = |
| $\overline{}$ |
| 9-2021 by Universal |
| ≥ |
| |
| $\overline{}$ |
| 2021 |
| 0 |
| Ċ |
| 1 |
| ō |
| 9 |
| \sim |
| 0 |
| 0 |
| $\stackrel{\smile}{}$ |
| Ξ |
| ō |
| - |
| 5 |
| Q |
| 0 |
| C |
| |
| |
| |

| C281A7 | Teach Pendant entered the Fault State | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|--|--|---|
| C281A8 | Teach Pendant entered the Violation State | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C281A9 | Joint moved too far before robot entered RUNNING State | A Joint moved more than the permissible range during the Brake Release procedure. | a) Do a Complete rebooting sequence b) Ensure the mounted payload, TCP and CoG matches your configuration. c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C281A10 | Robot State Machine | Failed to power on the Robot arm | a) Do a Complete rebooting sequence b) Ensure the mounted payload, TCP and CoG matches your configuration. c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C281A11 | Robot State Machine | Caused by specified joint | a) Do a Complete rebooting sequence b) Ensure the mounted payload, TCP and CoG matches your configuration. c) Update software d) Contact your local Universal Robots service provider for assistance. |



| C281A12 | Robot State Machine | Caused by specified state | a) Do a Complete rebooting sequence b) Ensure the mounted payload, TCP and CoG matches your configuration. c) Update software d) Contact your local Universal Robots service provider for assistance. |
|---------|-------------------------------------|--|---|
| C281A13 | Robot State Machine | Check aggregate joint mode status | a) Do a Complete rebooting sequence b) Ensure the mounted payload, TCP and CoG matches your configuration. c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C281A14 | IMMI entered the Fault State | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C281A15 | IMMI entered the Violation State | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A1 | Systick | Systick Sync: SoC frequency synchronization started | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C282A2 | Systick | Systick Sync: SoC frequency synchronization in progress, sample number x of 16 unexpected | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| C282A3 | Systick | Systick Sync: SoC frequency synchronization in progress, received 'SoC period' unexpected sample | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
|--------|---------|---|--|
| C282A4 | Systick | Systick Sync: SoC frequency synchronization in progress, received 'SoC ISR Latency' unexpected sample | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A5 | Systick | Systick Sync: unexpected SoC period | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A6 | Systick | Systick Sync: unexpected SysTick timer LOAD value [cpu-clock-cycles] | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A7 | Systick | Systick Sync: SoC frequency synchronization finished | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A8 | Systick | Systick Sync: SoC Phase synchronization started | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A9 | Systick | Systick Sync: SoC Phase error | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |



| C282A10 | Systick | Systick Sync: unexpected estimated Systick counter value at SoC | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|--|---|--|
| C282A11 | Systick | Systick Sync: unexpected estimated Systick counter ticks to next SoC | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C282A12 | Systick | Systick Sync: SoC Phase synchronization finished | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A13 | Systick | The internal SoC count value has been resynchronized with the FPGA SoC count. | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C282A14 | Systick | SOC status data failed to update in a timely manner | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A | Safety system | | |
| C283A0 | Critical error | A critical error occurred in the safety system | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A1 | Robot is not braking when in Stop Mode | | |
| C283A2 | Robot is moving when in Stop Mode | | |

| ö |
|-----------------------------|
| rved |
| se |
| reserve |
| iahts re |
| _ |
| ₹ |
| Ś |
| ₹ |
| ğ |
| Š |
| a |
| 39-2021 by Universal Robots |
| Ě |
| \supset |
| Þ P |
| 02 |
| 1-2 |
| 2009- |
| 2 |
| ht |
| <u>rial</u> |
| S O |
| ŏ |

| C283A3 | Power not removed from the motors while in Emergency Stop | | |
|---------|---|--|--|
| C283A4 | Failed to power on the Robot arm | | |
| C283A5 | Invalid pin- configuration received | | |
| C283A6 | Trying to reassign pin configuration with specified configuration | | |
| C283A7 | Joint exceeded the velocity limit | | |
| C283A8 | The System Emergency Stop Output is not active | Failed to activate the System Emergency Stop Output. The output is active when voltage is low | a) Make sure output is not short circuited to a power supply |
| C283A9 | System Emergency Stop Output disagreement within the safety system | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |
| C283A10 | Robot Emergency Stop Input disagreement within the safety system | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |
| C283A11 | System Emergency Stop Input disagreement within the safety system | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |
| C283A12 | Safeguard Stop Input disagreement within the safety system | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |



| C283A13 | Safeguard Reset Input disagreement within the safety system | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connected b) Contact your local Universal Robots service provider for assistance. |
|---------|--|---|--|
| C283A14 | Operation Mode input disagreement within the safety system. | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |
| C283A15 | Three-Positional Enabling Device Input disagreement within the safety system | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |
| C283A16 | Safety system | Operation Mode Switch is defined and no Three- Positional Device is defined. | a) Ensure both inputs are properly connectedb) Contact your localUniversal Robots service provider for assistance. |
| C283A17 | Lost several Teach Pendant safety packages in a row | | a) Check that the teach pendant is proper connected b) Do a Complete rebooting sequence c) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A18 | Lost too many Joint safety packages in a row. | | a) Check that the joints are proper connected b) Do a Complete rebooting sequence c) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A19 | Safety system | Incorrect gravity vector sent from the controller | a) Check that the joints are proper connected b) Do a Complete rebooting sequence c) Update software c) Contact your local Universal Robots service provider for assistance. |

| 7 | ֝֝֝֝֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜֜ |
|---|---------------------------------------|
| > | |
| ā |) |
| Ü | 9 |
| ā | ر |
| - | 7 |
| Ť | - |
| ₹ | |
| .= | |
| = | |
| ◁ | |
| " | i |
| Š | : |
| < | Ļ |
| ٢ | 3 |
| Š | 2 |
| ÷ | |
| δ | 2 |
| _ | |
| ď | 9 |
| ž | _ |
| | ١ |
| > | |
| n ive | |
| II n | |
| VIInive | |
| hyllnive | ב ב |
| 21 hy Unive | ב ב |
| 021 hy Unive | |
| -2021 hv IInive | 202 |
| 3-2021 hv Hnive | 20110 |
| 09-2021 by Universal Robots A/S All rights reserved | |
| 2009-2021 hv Ilnive | 201707 |
| 2009-2021 hv Unive | 20110 |
| @ 2009-2021 hy Unive | @ 2007 CO2 DV |
| 1 @ 2009-2021 hv Hnive | 202 202 0111 |
| aht @ 2009-2021 hy Unive | 0 1 1 2 2 2 2 2 1 1 1 C |
| right @ 2009-2021 by Unive | 110 10 202 202 |
| nyright @ 2009-2021 by Hnive | |
| onvright @ 2009-2021 by Unive | 2001 202 2001 202 |
| Convright @ 2009-2021 by Unive | 2007 1011 (0 2007) 2007 101 101 |

| C283A20 | Safety system | Wrong payload mass sent from the controller | a) Check that the joints are proper connected b) Do a Complete rebooting sequence c) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|---|---|--|
| C283A21 | Safety system | Wrong payload center of gravity sent from the controller | a) Check that the joints are proper connected b) Do a Complete rebooting sequence c) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A22 | Teach Pendant is connected while it is disabled in robot configuration | If the Teach Pendant is enabled, it is connected. If it is disabled, it is not connected. | Disconnect the Teach Pendant or enable it in the configuration. |
| C283A23 | Safety system | Lost several safety packages in a row from other safety processor | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A24 | Safety system | Got several safety packages too early in a row from other safety processor | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A25 | Safety system | Got a ready message from an unexpected source | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A26 | Force limitation: exceeded torque window | | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Contact your local Universal Robots service provider for assistance. |



| C283A27 | Mismatch on Robot Configuration CRC between the safety system and PolyScope | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|---|--|--|
| C283A28 | Mismatch on User Configuration CRC between the safety system and PolyScope | | a) Do a Complete rebooting sequence b) Make new .installation c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C283A29 | Safety system | Trying to reapply a part of the User Configuraton. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A30 | Safety system | Trying to reapply a part of the Robot Configuration, | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A31 | Safety system | Trying to reapply normal limits | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A32 | Safety system | Trying to reapply reduced limits | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C283A33 | Safety system | Trying to reapply safety CRC | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| C283A34 | Error while trying to apply safety configuration | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|--|--|--|
| C283A35 | Reduced Mode Output disagreement within the safety system | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A36 | Not Reduced Mode Output disagreement within the safety system | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A37 | Robot Moving Output disagreement within the safety system | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A38 | Robot Not Stopping Output disagreement within the safety system | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A39 | Safety system | Several safety packages were received too late from the SCB processor | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A40 | Reduced Mode Input disagreement within the safety systems | The input signals are not switching simultaneously or are incorrectly connected. | a) Ensure both inputs are correctly connected.b) Contact your local Universal Robots service provider for assistance. |



| C283A41 | TCP Velocity violates limits of maximum stopping time | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
|---------|--|---|
| C283A42 | TCP Velocity violates limits of maximum stopping distance | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A43 | Joint moved too quickly toward a Joint position limit | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A44 | The tool moved too fast towards an orientation limit | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A45 | The Elbow moved too fast towards a safety plane | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |

| Copyright © 2009-2021 by Universal Robots A/S. All rights reserved. | |
|---|-----------|
| Copyright © 2009-2021 by Universal Robots A/S. All rights rese | rved. |
| Copyright © 2009-2021 by Universal Robots A/S. All right | s rese |
| Copyright © 2009-2021 by Universal Robots A/S. A | II right |
| Copyright © 2009-2021 by Universal Robots | A/S. A |
| Copyright © 2009-2021 by Universal | Robots |
| Copyright © 2009-2021 by L | Iniversal |
| Copyright © 2009-202 | l by L |
| Copyright © 200 | 19-202 |
| Copyrighi | : © 200 |
| | Copyright |

| C283A46 | The tool moved too fast towards a safety plane | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
|---------|--|---|
| C283A47 | Joint position limit exceeded | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A48 | Tool position limit exceeded | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A49 | Tool orientation limit exceeded | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A50 | Elbow position limit exceeded | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |



| C283A51 | Tool moved with a speed which exceeds the speed limit | | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
|---------|---|---|---|
| C283A52 | Elbow moved with a speed of which exceeds the speed limit | | a) Ensure the mounted payload, TCP and CoG matches your configuration. b) Slow down movements c) Check safety setting d) Contact your local Universal Robots service provider for assistance. |
| C283A53 | Maximum Tool Center Point Speed in Reduced Mode is invalid | | Ensure the Reduced Mode Limit is less than or equal to the Normal Mode limit. |
| C283A54 | Maximum Elbow Speed in Reduced Mode is invalid | | Ensure the Reduced Mode limit is less than or equal to the Normal Mode Limit. |
| C283A55 | Maximum Joint Speed of a specified joint in Reduced Mode is invalid | | Ensure the Reduced Mode Limit is less than or equal to the Normal Mode Limit. |
| C283A56 | Maximum Momentum in Reduced Mode is invalid | | Ensure the Reduced Mode Limit is less than or equal to the Normal Mode Limit. |
| C283A57 | Maximum stopping time in Reduced Mode is invalid | | Ensure the Reduced Mode Limit is less than or equal to the Normal Mode Limit. |
| C283A58 | Maximum stopping distance in Reduced Mode is invalid | | Ensure the Reduced Mode Limit is less than or equal to the Normal Mode Limit. |
| C283A59 | Reduced Mode Output is not active | Failed to activate the Reduced Mode Output. The output is active when voltage is low | Make sure output is not short circuited to a power supply |

| C283A60 | Reduced Mode Output is not inactive | Failed to deactivate the Reduced Mode Output. The output is inactive when voltage is high | Make sure output is not short circuited to ground |
|---------|--|--|--|
| C283A61 | Not Reduced Mode Output is not active | Failed to activate the Not Reduced Mode Output. The output is active when voltage is low | Make sure output is not short circuited to a power supply |
| C283A62 | Not Reduced Mode Output is not inactive | Failed to deactivate the Not Reduced Mode Output. The output is inactive when voltage is high | Make sure output is not short circuited to ground |
| C283A63 | Robot is moving while Robot Moving Output is not active | Failed to activate the Robot Moving Output. The output is active when voltage is low | Make sure output is not short circuited to a power supply |
| C283A64 | Tool Direction Vector Length for Normal Mode is not 1.0 | | Reconfigure Tool orientation |
| C283A65 | Tool Direction Vector Length for Reduced Mode is not 1.0 | | Reconfigure Tool orientation |
| C283A66 | Robot Momentum exceeds the Momentum limit | | |
| C283A67 | Robot Power exceeds the Power limit | | |
| C283A68 | Error caused by a specified joint | A critical safety error | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C283A69 | Safety system | Float value | |
| C283A70 | Safety system | Unsigned value | |
| C283A71 | Safety system | Safety is disabled but the app type is not MAIN-NS (No Safety) | |
| | | | |



| C283A72 | The motor configuration sent by the Control Box is invalid | The motor configuration sent is unusable with this firmware revision. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|---------|--|--|--|
| C283A73 | Safe Home Position Output disagreement within the safety system | | Review your home position |
| C283A74 | The Safe Home Position Output is active while not allowed | The Safe Home Position Output is active while the robot is not in Safe Home Position | Make sure output is not short circuited to power supply or ground |
| C283A75 | Safety system | The user config versions received differ | |
| C283A76 | Safety system | Controller reported a fault | |
| C283A77 | Safety system | The user config versions is higher than supported | |
| C283A78 | Safety system | The user config versions is lower than supported | |
| C283A79 | Safety system | Safe home position out of range | |
| C283A80 | Safety system | Force limit calculation got an unsupported joint size | |
| C283A81 | The robot configuration specifies an unsupported joint size | The safety system is not certified to work with the specified joint size | Upgrade to a newer software version |
| C283A82 | The connected Teach Pendant type does not match the configuration | The connected Teach Pendant is not the same type as the one selected in the safety configuration | a) Check that the Teach Pendant is properly connected and matches the one in the safety configuration b) Conduct a complete rebooting sequence c) Update software d) Contact your local Universal Robots technical support |

| ਰਂ |
|--|
| ĕ |
| 2 |
| ĕ |
| ĕ |
| _ |
| 똳 |
| ᇊ |
| Ξ |
| . All rights reserved. |
| ⋖ |
| S) |
| ≶ |
| `` |
| 羟 |
| 8 |
| ਰ |
| ~ |
| Jniversal Robots A |
| တ |
| ē |
| ≥ |
| 5 |
| ≺ |
| <u>6</u> , |
| _ |
| \simeq |
| -2021 |
| Ţ |
| 5 |
| Ō. |
| \sim |
| (|
| Copyright © 2009-2021 by Universal Robots A/S. |
| Ď |
| Ę |
| Ö. |
| 2 |
| _ |
| |

| C283A83 | The configured Teach Pendant has no Three-Positional Enabling Device | The safety configuration enables the Teach Pendant's Three-Positional Enabling Device, but the configured Teach Pendant does not have a Three- Positional Enabling Device | a) Check that the correct Teach Pendant is selected in the safety configuration b) Conduct a complete rebooting sequence c) Update software d) Contact your local Universal Robots technical support |
|---------|---|---|--|
| C283A84 | Safety system | Received an invalid Teach Pendant type in the user configuration | |
| C283A85 | Automatic Safeguard Stop Input disagreement within the safety system | The input signals are not switching simultaneously, or are incorrectly connected | a) Ensure both inputs are properly connected b) Contact your local Universal Robots service provider for assistance |
| C283A86 | Automatic Safeguard Reset Input disagreement within the safety system | The input signals are not switching simultaneously, or are incorrectly connected | a) Ensure both inputs are properly connected b) Contact your local Universal Robots service provider for assistance |
| C283A87 | Injection-Molding- Machine-Interface is connected while it is disabled in the robot configuration | If the Injection-Molding- Machine-Interface is enabled, it must be connected. If it is disabled, it must be disconnected | Disconnect the Injection- Molding-Machine-Interface or enable it in the configuration |
| C283A88 | Lost more than allowed Injection- Molding-Machine- Interface safety packages in a row | | a) Check that the Injection-Molding-Machine-Interface is properly connected b) Conduct a complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance |



| C283A89 | The connected Injection-Molding- Machine-Interface type does not match the configuration | The connected Injection-Molding-Machine-Interface is not the same type as the one selected in the safety configuration | a) Check that the Injection-Molding-Machine-Interface is properly connected and matches the one in the safety configuration b) Conduct a complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance |
|---------|--|--|--|
| C283A90 | Invalid Injection- Molding-Machine- Interface type in the user configuration | The configuration provided by the user safety configuration is invalid | a) Ensure the correct IMMI type is selected in the Safety Configuration b) Conduct a complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance |
| C283A91 | The Injection- Molding-Machine- Interface System Emergency Stop Output is not active | Failed to activate the System Emergency Stop Output on the Injection- Molding-Machine-Interface. The output is active when voltage is high | Make sure output is not short circuited to ground |
| C283A92 | Safety system | Target torque is outside the allowed range | |
| C283A93 | Safety system | Sanity check of target torque is outside the allowed range | |
| C283A94 | Automatic Safeguard Stop input is configured but no Three-Position Enabling device is configured | | a) Ensure that a Three- Positional Device is enabled in the Safety Configuration b) Conduct a complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance |
| C283A95 | IO Data has not been updated before latching it | | |

| C283A96 Received an invalid IMMI type in the user configuration C283A97 Safety system C283A98 Safety system C283A98 Safety system C283A99 Safety system C283A99 Safety system C284A Brake Release C284A0 Critical error during Brake Release C284A20 C284A20 C384A20 C | | | | |
|--|---------|---------------------|-----------------------------|---|
| sent from the controller must be non-negative C283A98 Safety system The payload inertia sent from the controller must be within valid range C283A99 Safety system Received an invalid value as part of the runtime safety configuration C284A Brake Release C284A0 Critical error A critical error occurred during Brake Release C284A20 Brake Release C284A0 Critical error A critical error occurred payload, TCP, and CoG matches your configuration c) Check if there is no interference with the joints d) Contact your local Universal Robots service provider for assistance C285A Joint Keep-Alive System C285A0 Critical error A critical error occurred in the Joint Keep-Alive System sequence | C283A96 | IMMI type in the | | |
| from the controller must be within valid range C283A99 Safety system Received an invalid value as part of the runtime safety configuration C284A Brake Release C284A0 Critical error A critical error occurred during Brake Release C284A20 Brake Release C284A0 Critical error A critical error occurred payload, TCP, and CoG matches your configuration c) Check if there is no interference with the joints d) Contact your local Universal Robots service provider for assistance C285A Joint Keep-Alive System C285A0 Critical error A critical error occurred in the Joint Keep-Alive System a) Do a Complete rebooting sequence | C283A97 | Safety system | sent from the controller | |
| part of the runtime safety configuration C284A Brake Release C284A0 Critical error A critical error occurred during Brake Release C284A20 Brake Release C284A20 A critical error occurred during Brake Release C284A20 Brake Release A critical error occurred payload, TCP, and CoG matches your configuration c) Check if there is no interference with the joints d) Contact your local Universal Robots service provider for assistance C285A Joint Keep-Alive System C285A0 Critical error A critical error occurred in the Joint Keep-Alive System a) Do a Complete rebooting sequence | C283A98 | Safety system | from the controller must be | |
| C284A0 Critical error during Brake Release C284A20 A critical error occurred during Brake Release C284A20 A critical error occurred by Ensure the mounted payload, TCP, and CoG matches your configuration c) Check if there is no interference with the joints d) Contact your local Universal Robots service provider for assistance C285A Joint Keep-Alive System C285A0 Critical error A critical error occurred in the Joint Keep-Alive System A critical error occurred in the Joint Keep-Alive System a) Conduct a complete rebooting sequence | C283A99 | Safety system | part of the runtime safety | |
| to C284A20 during Brake Release rebooting sequence b) Ensure the mounted payload, TCP, and CoG matches your configuration c) Check if there is no interference with the joints d) Contact your local Universal Robots service provider for assistance C285A Joint Keep-Alive System C285A0 Critical error A critical error occurred in the Joint Keep-Alive System a) Do a Complete rebooting sequence | C284A | Brake Release | | |
| System C285A0 Critical error A critical error occurred in the Joint Keep-Alive System sequence c285A0 Critical error A critical error occurred in the Joint Keep-Alive System sequence | to | Critical error | | rebooting sequence b) Ensure the mounted payload, TCP, and CoG matches your configuration c) Check if there is no interference with the joints d) Contact your local Universal Robots service |
| to the Joint Keep-Alive System sequence | C285A | · | | |
| c) Contact your local Universal Robots service provider for assistance. | to | Critical error | | sequence b) Update software c) Contact your local Universal Robots service |
| C286A Motor Controller | C286A | Motor Controller | | |
| C286A1 ME Index seen and to PWM margin too C286A2 small | to | PWM margin too | | |
| C287A Saved files in tool | C287A | Saved files in tool | | |
| C287A0 Critical error A critical error occurred a) Do a Complete rebooting sequence C287A3 b) Update software c) Contact your local Universal Robots service provider for assistance. | to | Critical error | | sequence b) Update software c) Contact your local Universal Robots service |
| C288A IO Control | C288A | IO Control | | |



| C288A1 to C288A3 | Wrong control mode | | Check for configuration under installation window |
|------------------------|--|--|---|
| C289A | Tool Connector | | |
| C289A1 | Short circuit detected on Digital Output: high side | Tool Digital Output pin has been turned off due to either a short-circuit or an overload was detected. | Check connections to make sure Tool Digital Output currents are within specified limits. |
| C289A2 | Short circuit detected on Digital Output: low side | Tool Digital Output pin has been turned off due to either a short-circuit or an overload was detected. | Check connections to make sure Tool Digital Output currents are within specified limits. |
| C289A4 | 10 second Average tool IO Current is outside of the allowed range. | The average current sum of the Tool Connector Power and Digital Output pins is outside of the allowed range. | Check connections to make sure tool Digital Output currents are within specified limits. |
| C289A5 | Unable to remove tool Digital Output fault. | Unable to remove the overload on tool Digital Output, therefore the robot powered down. | Check connections to make sure the Tool Digital Output currents are within specified limits. |
| C289A6 | Current on the POWER pin is outside of the allowed range. | Too high current on tool connector power pin | Check connections to make sure the Tool Digital Output currents are within specified limits. |
| C289A7 | Current on the Digital Output pins is outside of the allowed range. | Too high current on tool connector Digital Output pins. | Check connections to make sure the Tool Digital Output currents are within specified limits. |
| C289A8 | Current on the ground pin is outside of the allowed range. | Too high current on tool ground pin | Check connections to make sure the Tool Digital Output currents are within specified limits. |
| C289A9 | Maximum current on the POWER pin is outside of the allowed range | Too high current on tool power pin | Check connections to make sure the Tool Digital Output currents are within specified limits. |
| C290A1 | I2C | The I2C bus was busy too long | |
| C290A2 | I2C | Function called too early after last call or the slave chip did not answer | |

| C290A3 | I2C | A peripheral unit has set the alert pin | |
|-------------------------|--------------------------------|---|--|
| C290A4 | I2C | Communication timeout detected | |
| C290A6 | 12C | An error was detected in the i2c acknowledge handshake | |
| C290A7 | 12C | I2C detected arbitration loss | |
| C290A8 | 12C | I2C detected error on the I2C-bus | |
| C290A9 | 12C | I2C error interrupt called with unhandled error-flag | |
| C290A10 | 12C | I2C peripheral issue, several unhandled events | |
| C291A1 | EEPROM | Addressed data is out of memory bounds | |
| C291A2 | EEPROM | I2C communication error | |
| C291A3 | EEPROM | Write to EEPROM failed | |
| C291A4 | EEPROM | Read from EEPROM failed | |
| C291A5 | EEPROM | Verification of written data failed | |
| C291A6 | EEPROM | Difference in data when comparing the source and the data written | |
| C291A7 | EEPROM | Writing of a page in EEPROM failed | |
| C292A | Online RAM test | | |
| C292A0 to C292A15 | Critical error | A critical error occurred during RAM test | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C293A | Exception caught | | |
| C293A1 to C293A30 | Unexpected exception/interrupt | | a) Do a Complete rebooting sequenceb) Update software |



| C294A | ADC | Analog to Digital converter | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
|------------------------|---------------------------|---|--|
| C294A0 to C294A9 | Critical error | A critical error occurred in the ADC driver | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C295A | PCB | Wrong PCB type. Likely a hardware error. | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C295A0 | Wrong PCB type | The printed circuit board is wrong | |
| C296A | Start up check | | |
| C296A0 | Critical error | A critical error occurred during startup | a) Check 10A fuse b) Do a Complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C296A1 | SCB IO failed to power on | | Ensure the IO Power Connector on the Safety Control Board is connected to the 24VDC |
| C296A2 | Start up check | One or more Motor phases is short circuited to ground | |
| C296A3 | Start up check | Motor Indication Signal does not work | |
| C296A4 | Start up check | Phase 1 is not connected. | |
| C296A5 | Start up check | Phase 2 is not connected. | |
| C296A6 | Start up check | Phase 3 is not connected. | |
| C296A7 | Start up check | Motor test results were invalid. | |

| C296A8 | Start up check | Motor PWM output is not zero in Joint State | |
|---------|----------------|--|--|
| C296A9 | Start up check | Robot Voltage was present during self-diagnostics | |
| C296A10 | Start up check | Time out during self- diagnostics | |
| C296A11 | Start up check | Data was received while trying to disable communication | |
| C296A12 | Start up check | Sequence number did not match expected sequence | |
| C296A13 | Start up check | Check the expected sequence number | |
| C296A14 | Start up check | Check the actual sequence number | |
| C296A15 | Start up check | Interval between messages did not match expectations | |
| C296A16 | Start up check | Check the expected interval ticks | |
| C296A17 | Start up check | Check the measured interval ticks | |
| C296A18 | Start up check | Motor Kt value is outside manufacturer specifications | |
| C296A19 | Start up check | Motor Kb value is outside manufacturer specifications | |
| C296A20 | Start up check | Motor R value is outside manufacturer specifications | |
| C296A21 | Start up check | Motor L value is outside manufacturer specifications | |
| C296A22 | Start up check | Processor uB has been in Booting state for too long | |
| C296A23 | Start up check | Cross-monitoring data was invalid for too long while booting | |
| C296A24 | Start up check | Motor Tau value is outside manufacturer specifications | |



| C297A | Joint validation | Validation during power up. | a) Do a Complete rebooting sequence b) Check that SD card and robot type match. c) Update software d) Contact your local Universal Robots service provider for assistance. |
|---------|--|--|---|
| C297A0 | Critical error | A critical error occurred during Joint validation | a) Do a Complete rebooting sequence b) Check that SD card and robot type match. c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C297A1 | Joint validation | Received Node ID from an unexpected device | |
| C297A2 | Joint validation | Received Node ID an unexpected node | |
| C297A3 | Joint validation | Joint processors disagree on Joint Size | |
| C297A4 | Joint validation | Joints disagree with configuration on Joint Size | |
| C297A5 | Joint validation | Found Joint disabled in configuration | |
| C297A6 | Joint validation | Joint processors disagree on Joint ID. | |
| C297A7 | Joint validation | Node ID differs from the stored ID. | |
| C297A8 | Joint validation | Invalid robot configuration | |
| C297A9 | Joint validation | Joint IDs need updating | |
| C297A10 | Joint validation | Timeout while waiting for Node IDs | |
| C297A11 | The Robot arm does not match the Control Box | One or more joints do not match stored Robot Configuration | a) Do a Complete rebooting sequence b) Check that SD card and robot type match. c) Update software d) Contact your local Universal Robots service provider for assistance. |

| C298A | Hand protection | | |
|--------|------------------------------------|---|---|
| | Tool is too close to the lower arm | The tool is too close to the lower Robot arm | a) Check wrist position. b) Verify mounting c) Do a Complete rebooting sequence d) Update software e) Contact your local Universal Robots service provider for assistance |
| C299A | Tool communication | | |
| | Communication error detected | A problem with the Tool communication was detected. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C299A1 | Tool communication | TX buffer overflow | |
| C299A2 | Tool communication | New message started unexpectedly | |
| C299A3 | RX framing error | Framing error detected on received data | a) Check external equipment connection b) Verify the communication configuration matches the hardware. c) Do a Complete rebooting sequence d) Update software e) Contact your local Universal Robots service provider for assistance |
| C299A4 | RX Parity error | Parity error detected on received data | a) Check external equipment connection b) Verify the communication configuration matches the hardware. c) Do a Complete rebooting sequence d) Update software e) Contact your local Universal Robots service provider for assistance |
| C299A5 | Tool communication | RX buffer overflow. | |
| C300A1 | Safety message | Safety message received from an unexpected node. | |



| C300A2 | Safety message | Safety message response received with an unexpected sequence number. | |
|---------|---------------------------|--|--|
| C300A3 | Safety message | Duplicate safety message response received with sequence number. | |
| C301A | Safety message monitor | Safety processors does not agree. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C301A0 | Critical error | A critical error occurred in safety message monitoring | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C301A2 | Safety message monitor | Mode data mismatch | Same as C301A0 |
| C301A3 | Safety message monitor | Position data mismatch | Same as C301A0 |
| C301A4 | Safety message monitor | Revolution data mismatch | Same as C301A0 |
| C301A5 | Safety message monitor | Temperature data mismatch | Same as C301A0 |
| C301A6 | Safety message monitor | Torque data mismatch | Same as C301A0 |
| C301A7 | Safety message monitor | Velocity data mismatch | Same as C301A0 |
| C301A8 | Safety message monitor | Input state data disagreement | Same as C301A0 |
| C301A10 | Safety message monitor | Safety monitor: Don't have the corresponding x-mon data | Same as C301A0 |
| C301A12 | Safety message monitor | Target current data mismatch | Same as C301A0 |
| C301A14 | Safety message monitor | Target Velocity data mismatch | Same as C301A0 |
| C301A15 | Safety message monitor | Target Acceleration data mismatch | Same as C301A0 |

| _ | |
|---|---|
| ď | j |
| ۶ | |
| ā | J |
| ď |) |
| 7 | |
| ø |) |
| ŧ | |
| _ |) |
| | |
| ₹ | |
| ٩ | • |
| C. | j |
| 2 | |
| ,, | |
| ž | |
| ۲ |) |
| 7 |) |
| Ω | |
| 7 | |
| Ü |) |
| ā |) |
| .≥ | |
| 2 | |
| Ξ | J |
| 2 | |
| Ξ | |
| Ċ | Į |
| $\stackrel{\sim}{\sim}$ | ו |
| ì | ١ |
| g | ١ |
| Ξ | ֡ |
| 5 | Į |
| (0 |) |
| Copyright @ 2009-2021 by Universal Robots A/S All rights reserved | |
| 두 | |
| ÷ | |
| 2 | |
| 7 | |
| C |) |
| | |

| C301A16 | Safety message | Issue with setting up the | Same as C301A0 |
|----------|---------------------------|---|---|
| 233.7.13 | monitor | UART mon RX address in TP | 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 |
| C301A17 | Safety message monitor | Issue with setting up the UART mon RX CITER register in TP | Same as C301A0 |
| C301A18 | Safety message monitor | Issue with setting up the UART mon RX BITER register in TP | Same as C301A0 |
| C301A19 | Safety message monitor | Issue with setting up the MK02 UART TX, address is incorrect | Same as C301A0 |
| C301A20 | Safety message monitor | Issue with setting up the MK02 UART TX, CITER REG is incorrect | Same as C301A0 |
| C301A21 | Safety message monitor | Issue with setting up the MK02 UART TX, BITER REG is incorrect | Same as C301A0 |
| C301A25 | Safety message monitor | Node uA's communication to SCB disabled | Same as C301A0 |
| C301A26 | Safety message monitor | Motor parameter (R_pp) data mismatch | Same as C301A0 |
| C301A27 | Safety message monitor | Motor parameter (L_pp) data mismatch | Same as C301A0 |
| C301A28 | Safety message monitor | Motor parameter (Kb) data mismatch | Same as C301A0 |
| C301A29 | Safety message monitor | Motor parameter (Kt) data mismatch | Same as C301A0 |
| C301A30 | Safety message monitor | Motor parameter (T) data mismatch | Same as C301A0 |
| C301A31 | Safety message monitor | Safety Message was not received | Same as C301A0 |
| C301A32 | Safety message monitor | Function indicating if we should monitor data is not configured | Same as C301A0 |
| C301A33 | Safety message monitor | Function to parse messages is not configured | Same as C301A0 |
| C301A34 | Safety message monitor | Function to handle messages is not configured | Same as C301A0 |



| C301A35 | Safety message monitor | Function to handle disable communication requests is not configured | Same as C301A0 |
|---------|---------------------------|---|---|
| C301A36 | Safety message monitor | IMMI Safety IO estop input mismatch | Same as C301A0 |
| C301A37 | Safety message monitor | IMMI Safety IO estop output mismatch | Same as C301A0 |
| C301A38 | Safety message monitor | IMMI Safety IO safeguard input mismatch | Same as C301A0 |
| C301A39 | Safety message monitor | Target torque data mismatch | Same as C301A0 |
| C301A40 | Safety message monitor | compensation current mismatch | Same as C301A0 |
| C302A | Tool configuration | | Please check your configuration on the installation tab |
| C302A1 | Invalid Robot Type | The tool received an invalid robot type | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C303A | System status | | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance |
| C303A0 | Critical error | A critical system error occurred | Same as C303A |
| C303A1 | System status | Starting up | Same as C303A |
| C303A2 | System status | Shutting down | Same as C303A |
| C303A3 | System status | Reset caused by unknown reasons | Same as C303A |
| C303A4 | System status | Reset caused by power loss | Same as C303A |
| C303A5 | System status | Reset caused by window watchdog | Same as C303A |
| C303A6 | System status | Reset caused by independent watchdog | Same as C303A |
| C303A7 | System status | Reset caused by software | Same as C303A |
| C303A8 | System status | Reset caused by power on | Same as C303A |

| C303A9 | System status | Reset caused by reset pin | Same as C303A |
|---------|--|---|---|
| C303A10 | System status | Reset caused by brown out | Same as C303A |
| C303A11 | System status | Reset caused by a loss of lock in the PLL | Same as C303A |
| C303A12 | System status | Reset caused by a loss of external clock. | Same as C303A |
| C303A13 | System status | Reset caused by LLWU module wakeup source | Same as C303A |
| C303A14 | System status | Reset caused by peripheral failure to acknowledge attempt to enter Stop Mode | Same as C303A |
| C303A15 | System status | Reset caused by EzPort receiving the RESET command while the device is in EzPort mode | Same as C303A |
| C303A16 | System status | Reset caused by host debugger system setting of the System Reset Request bit | Same as C303A |
| C303A17 | System status | Reset caused by core LOCKUP event | Same as C303A |
| C303A18 | System status | Reset caused by JTAG | Same as C303A |
| C303A19 | System status | Unexpected core frequency configured | Same as C303A |
| C304A | Self monitoring | | |
| C304A0 | Critical error | A critical error occurred in physical, logical, and temporal monitoring (PLATM) | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C304A3 | Close to the gearbox shear limit. Encoders disagree on the Joint position | The Joint acceleration or deceleration is too high, or there is a mechanical problem in the gear related to encoder mounting. | a) Reduce acceleration in the user program. b) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance or Replace Joint if necessary. |



| 020444 | Fithoutho anadan | Machaniaal weeklass is seen | a) Daduga appelanation in the |
|--------|---|---|---|
| C304A4 | Either the encoder was inappropriately mounted, or the gearbox is loose or broken. Difference between the encoders is present | Mechanical problem in gear related to encoder mounting. | a) Reduce acceleration in the user program. b) Check TCP/Payload and Cog c) Do a Complete rebooting sequence d) Update software e) Contact your local Universal Robots service provider for assistance or Replace Joint if necessary. |
| C304A6 | Motor phase resistance is too high. | The lead/connector is broken, or the Motor phase lead has become disconnected or loose. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C305A | Robot Power Control | | |
| C305A0 | Critical error | A critical error in power control module | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C305A1 | Power supply voltage too low | Robot voltage is lower than 40V. | a) Check for loose connections b) Do a Complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance. |

| ö |
|---------------|
| ved. |
| |
| ese |
| Ē |
| ţ |
| 늄 |
| Ē |
| ₹ |
| |
| Ś |
| ⋖ |
| obots |
| ğ |
| Rob |
| Ξ |
| Jniversal R |
| ē |
| ⋰⋛ |
| בׁ |
| 2021 by Unive |
| 7 |
| Ñ |
| 2 |
| 2009-202 |
| õ |
| |
| 0 |
| ŧ |
| ā |
| > |
| ac |
| |
| ŏ |

| C305A2 | Robot cable not connected | | a) Make sure the cable between Control Box and Robot Arm is correctly connected and it has no damage. b) Check for loose connections c) Do a Complete rebooting sequence d) Update software e) Contact your local Universal Robots service provider for assistance Contact your local Universal Robots service provider for assistance. |
|--------|---|---|---|
| C305A3 | Short circuit in Robot detected or the wrong Robot is connected to the Control Box. | | a) Check for loose connections b) Make sure the cable between Control Box and Robot Arm is correctly connected and it has no damage. c) Check for loose connections d) Do a Complete rebooting sequence e) Update software f) Contact your local Universal Robots service provider for assistance. |
| C305A4 | Robot voltage rising slower than expected | | a) Verify the power supply voltage b) Verify Control Box and Robot Arm are correctly paired c) Check for loose connections d) Do a complete rebooting sequence e) Contact your local Universal Robots service provider for assistance |
| C305A5 | Robot Power Control | Attempted to start Energy Eater with powered robot | |



| C305A6 | Power supply voltage too high | Power supply is higher than 56V | a) Make sure the cable between Control Box and Robot Arm is correctly connected and it has no damage. b) Check for loose connections |
|---------|--|--|--|
| | | | c) Do a Complete rebooting sequence d) Update software e) Contact your local Universal Robots service provider for assistance. |
| C305A7 | Robot Power Control | Energy Eater was active when trying to turn on the Robot arm | |
| C305A8 | The Robot Voltage is too high when powering on the Robot | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |
| C305A9 | The Power State was not OFF when trying to power on the Robot | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C305A10 | Robot Power Control | The Delay Callback setup failed | |
| C305A11 | The power to the robot arm was not removed fast enough after violation | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C306A | Joint | Joint error | |
| C306A0 | Critical error | A critical error occurred in a Joint | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance. |

| C306A1 | Not stopping fast enough | Joint was unable to come to a full stop fast enough. | a) Either an incorrect payload is mounted, or an external force is pushing the robot b) Do a Complete rebooting sequence c) Update software d) Contact your local Universal Robots service provider for assistance. |
|---------|---------------------------------------|--|---|
| C306A2 | Joint | Velocity failed to pass sanity check | |
| C306A3 | Joint | Acceleration failed to pass sanity check | |
| C306A4 | Joint | Joint does not have a stored id | |
| C306A5 | Joint | Joint ID could not be stored | |
| C306A6 | Joint | control-package sequence nu expected sequence number | mber mismatched with |
| C306A7 | Joint | Several instances of mismate sequence numbers within las | • |
| C306A8 | Joint | Sanity check of control-packa recovered after detecting bad | |
| C306A9 | Joint moved more than allowable limit | Potential mechanical failure of the joints brakes | b) Do a Complete rebooting sequencec) Update softwared) Contact your localUniversal Robots service provider for assistance. |
| C306A10 | Joint | Current detected in motor exceeded limits, check current | |
| C306A11 | Joint | Check PWM duty cycle for motor phase A | |
| C306A12 | Joint | Check PWM duty cycle for motor phase B | |
| C306A13 | Joint | Check PWM duty cycle for motor phase C | |
| C307A | Data B | | |
| C308A | Data A | | |
| C309 | Keep-Alive System | | |



| C309A | Critical error | A critical error occurred in the Keep-Alive System | a) Conduct a complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
|--------|-------------------|---|--|
| C309A0 | Keep-Alive System | Critical error | |
| C309A1 | Keep-Alive System | Keep-Alive System message with wrong sequence received from SCB-uPA. | |
| C309A2 | Keep-Alive System | Timeout reached while waiting for a Keep-Alive System message from SCB-uPA. | |
| C309A3 | Keep-Alive System | Go-to-Fault command received a Keep-Alive System message from SCB- uPA. | |
| C309A4 | Keep-Alive System | A Keep-Alive System message with wrong sequence received from SCB-uPB. | |
| C309A5 | Keep-Alive System | Timeout reached while waiting for Keep-Alive System message from SCB-uPB. | |
| C309A6 | Keep-Alive System | Go-to-Fault command received in Keep-Alive System message from SCB- uPB. | |
| C309A7 | Keep-Alive System | Keep-Alive System message received from an unauthorized source | |
| C309A8 | Keep-Alive System | uPA handler received an invalid value | |
| C309A9 | Keep-Alive System | uPB handler received an invalid value | |

C312A5

Data validation

| Troubleshoo | oting | | UNIVERSAL ROBO |
|-------------|--|---|--|
| C309A10 | Lost more than allowed Keep-Alive System messages in a row from Safety Control Board-uPA | An invalid amount of Keep- Alive System messages have been lost from the Safety Control Board Processor A | a) Conduct a complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C309A11 | Lost more than allowed Keep-Alive System messages in a row from Safety Control Board-uPB | An invalid amount of Keep- Alive messages have been lost from the Safety Control Board Processor B | a) Conduct a complete rebooting sequenceb) Update softwarec) Contact your local Universal Robots service provider for assistance |
| C309A12 | Keep-Alive System | Go-to-Violation command received in Keep-Alive System message from SCB- uPA. | |
| C309A13 | Keep-Alive System | Go-to-Violation command received in Keep-Alive System message from SCB- uPB. | |
| C309A14 | Keep-Alive System | Invalid command received in Keep-Alive System message from SCB-uPA. | |
| C309A15 | Keep-Alive System | Invalid command received in Keep-Alive System message from SCB-uPB. | |
| C311A0 | Delay Callback | The timer is not available | |
| C312A | Data validation | | |
| C312A0 | Critical error | A critical error occurred during data validation | a) Do a Complete rebooting sequenceb) Check for ESD noise.c) Update softwared) Contact your localUniversal Robots service provider for assistance. |
| C312A1 | Data validation | Missed several packages | |
| C312A2 | Data validation | Unexpected sequence | |
| C312A3 | Data validation | Several failures in a row | |
| C312A4 | Data validation | Received a package at an | |

Package had unexpected

unexpected time

type



| C313A0 | App version | Check build version | |
|--------|---|---|---|
| C313A1 | App version | Check git sha | |
| C313A2 | App version | Check CRC code | |
| C313A3 | App version | Check build major version | |
| C313A4 | App version | Check build minor version | |
| C313A5 | App version | Check build patch version | |
| C314A | SPI IO | IO sanity check error. | |
| C314A0 | Critical error | A critical error occurred related to IO | a) Do a Complete rebooting sequence b) Check IO connections c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C314A1 | SPI IO | Control bits read wrongly | |
| C314A2 | SPI IO | Output readback does not match the produced value | |
| C314A3 | SPI IO | Safeguard bit transition to low | |
| C314A4 | SPI IO | Emergency Stop bit transition to low | |
| C314A5 | Expected OSSD pulse were not detected on the Configurable Output (CO) | The generated OSSD pulses on the safety output were not seen during readback | a) Verify if safety output is not connected to any power supply or another safety output b) Update software c) Contact your local Universal Robots service provider for assistance |
| C314A6 | An unexpected OSSD pulse was detected on Configurable Output (CO) | An OSSD pulse was detected on the safety output readback, but was not generated by the hardware | a) Verify if safety output is not connected to ground or another safety output b) Update software c) Contact your local Universal Robots service provider for assistance |
| C315A | Watchdog | The system watchdog is not working as expected | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |

| C315A0 to C315A23 | Self-test failed | The system watchdog is not working as expected | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
|-------------------------|--|--|--|
| C316A | MCU | Micro Control Unit | |
| C316A0 | Unknown ID | The Microcontroller Identifier does not match an expected value. Firmware does not match hardware. | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C316A1 | This version of the firmware is obsolete and needs to be updated | The firmware in the robot is too old and needs to be updated | a) Do a Complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance. |
| C317A0 | Failure injection | Injecting type unexpected | |
| C317A1 | Failure injection | Missing handler for specified type | |
| C317A2 | Failure injection | Invalid data provided to specified type | |
| C317A3 | Failure injection | Throw report | |
| C318A0 | Stack monitor | The stack level watermark is breached | |
| C319A0 | Filesys Diagnostic Tool | Read operation started, at specified start address | |
| C319A1 | Filesys Diagnostic Tool | Read operation was succesfully completed | |
| C319A2 | Filesys Diagnostic Tool | Read operation failed, due to illegal address | |
| C319A3 | Filesys Diagnostic Tool | Received data for unexpected address | |
| C319A4 | Filesys Diagnostic Tool | Unxpected address | |
| C319A5 | Filesys Diagnostic Tool | Erased sector at specified address | |
| C319A6 | Filesys Diagnostic Tool | Write operation was succesfully completed | |
| | | | |



| C320A0 to C320A41 | REDnet BLVDS | Data transmission error | |
|--------------------------|------------------------------|---|--|
| C321A0 to C321A41 | REDnet RS485 | Data transmission error | |
| C322A0 | Switch | Switch : Priority package timeout on specified ports | |
| C322A1 | Switch | Switch : Data package timeout on specified ports | |
| C323A0 | SCB Endpoint | Endpoint : Priority data debug channel overflow | |
| C323A1 | SCB Endpoint | Endpoint : data debug channel overflow | |
| C323A2 | SCB Endpoint | Endpoint : Priority data inbound timeout from specified port. | |
| C323A3 | SCB Endpoint | Endpoint : Data inbound timeout from specified port. | |
| C323A4 | SCB Endpoint | Endpoint : Priority data outbound timeout to specified port. | |
| C323A5 | SCB Endpoint | Endpoint : Data outbound timeout to specified port. | |
| C324A0 | TP UART | UART : FiFo overflow | |
| C324A1 | TP UART | UART : Length mismatch | |
| C324A2 | TP UART | UART : Unexpected SOM | |
| C325A53 to C335A66 | SPI uA | uA SPI : Unsupported command | |
| C327A0 | PCle | PCIe Control-Data : Blocked | |
| C327A1 | PCIe | PCIe Priority-Data : Blocked | |
| C327A2 | PCIe | PCIe data-data : Blocked | |
| C328A | Transceiver miscellaneous | | |
| C328A0 | Transceiver miscellaneous | The SoC arrived too early | |

| C328A1 | Transceiver miscellaneous | Timeout while waiting for the SoC, the SoC was lost or delayed more than expected | |
|--------|--|--|---|
| C328A2 | Flash device is not supported, check JEDEC data for device | The flash device's JEDEC ID does not match a supported flash device | a) Conduct a completerebooting sequenceb) Update softwarec) Contact your localUniversal Robots serviceprovider for assistance |
| C329A1 | AXI STREAM | FiFo overflow on interface | |
| C329A2 | AXI STREAM | FiFo overflow cleared | |
| C330A | Injection Molding Machine Interface IMMI IO | | |
| C330A1 | Injection-Molding- Machine-Interface E- Stop output readback does not match the produced value | First byte: produced value, second byte: read value | Check E-stop output |
| C330A2 | Injection-Molding- Machine-Interface Moulding Area Free output readback does not match the produced value | First byte: produced value, second byte: read value | Check output |
| C330A3 | Injection-Molding- Machine-Interface 24V IO voltage outside acceptable range | The voltage measured on the 24V IO rail is lower than expected | a) Check the fuses on the Injection-Molding-Machine-Interface b) Verify there are no short circuits on the 24V IO connectors c) Contact your local Universal Robots service provider for assistance |
| C330A4 | Injection-Molding- Machine-Interface 48V voltages outside acceptable range | The voltages measured on the 48V rails are lower than expected | a) Check the fuses on the Injection-Molding-Machine-Interface b) Verify there are no short circuits on the IO connectors c) Contact your local Universal Robots service provider for assistance |



| C331A | Friction model | | |
|---------|--|---|--|
| C331A0 | Critical error | A critical error occurred in the friction model module | a) Conduct a complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C332A | Servo configuration | | |
| C332A0 | Critical error on Servo configuration | A critical error occurred in the servo configuration module | a) Conduct a complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C332A1 | Servo configuration | The configuration file could not be loaded | |
| C332A2 | Servo configuration | The configuration file could not be updated | |
| C332A3 | Servo configuration | Failed to create configuration file, due to unknown PCB_type | |
| C332A4 | Servo configuration | Failed to acquire the motor datasheet, due to unsupported motor | |
| C333A0 | File message | Critical error | |
| C333A1 | File message | File type is not supported | |
| C333A2 | File message | All arguments are mandatory | |
| C333A3 | File message | Protocol version is not supported | |
| C333A4 | File message | File part is unexpected | |
| C333A5 | File message | CRC is invalid | |
| C333A6 | File message | Unexpected CRC value | |
| C333A7 | File message | Unique ID is invalid | |
| C333A8 | File message | Unexpected unique ID | |
| C333A9 | File message | File version is not supported | |
| C333A10 | File message | File ID is deleted | |

| C334A | Protective Stop: Position deviation while in Locked Axis feature | Robot deviated from constrained axes while in Constrained Freedrive. The maximum range was reached. | a) Unlock constrained axis b) Move robot back to reachable postions |
|--------|---|--|--|
| C336A1 | Hardware configuration manager | An illegal write request to a memory area | |
| C337A0 | Control parameters | Critical error | |
| C337A1 | Control parameters | A selected set of control parameters was not allowed in this application | |
| C337A2 | Control parameters | A selected set of control parameters was not known or was incorrectly applied | |
| C400A | Protective Stop: Elbow position close to safety plane limits | Robot joint 2 – Elbow has reached the Safety Plane limits | Move robot Elbow joint away from the safety plane |
| C401A | Protective Stop: Exceeding user safety settings for stopping time | You have exceeded the safety settings, watch out for high values not allowed in the robot | a) Check speeds and accelerations in the program b) Check usage of TCP, payload and CoG correctly c) Check external equipment activation if correctly set |
| C402A | Protective Stop: Exceeding user safety settings for stopping distance | Protective Stop activated by the stopping distance set in the safety settings. The value was higher so the robot stopped preventing higher distance of stop | Same as C401A |
| C403A | Protective Stop: Danger of clamping between the Robot's lower arm and tool | Robot has entered Protective Stop due to reach maximum point to prevent a clamp situation between joint and robot itself | Same as C401A |
| C404A | Unexpected behavior | | |
| C404A0 | Runtime sends data too often | Communication overload | a) Check external equipment communication frequencyb) Check if wait command or sync() script code are used in the program |
| | | | |



| C404A1 | Runtime tries to receive data too often | Communication overload | Same as C404A0 |
|--------|--|--|---|
| C450A | Force-Torque sensor | | |
| C450A0 | Sensor data invalid | Force-Torque sensor is defective or not mounted correctly | a) Do a Complete rebooting sequence b) Check for loose connections c) Update software d) Contact your local Universal Robots service provider for assistance. |
| C450A1 | Sensor cannot be used, therefore it is disabled | Force-Torque sensor version is newer than the Robot software | Same as C450A0 |
| C450A2 | Force-Torque sensor | Channel signal became invalid | |
| C450A3 | Force-Torque sensor | Check frequency | |
| C450A4 | Force-Torque sensor is expected, but it cannot be detected | Force-Torque sensor is expected, but no signals from the sensor can be detected. | a) Do a Complete rebooting sequence b) Check for loose connections c) Check for damages to the Tool/sensor d) Update software e) Contact your local Universal Robots service provider for assistance. |
| C450A5 | Force-Torque sensor is detected but not calibrated | Force-Torque sensor is installed, but no calibration was found | Same as C450A5 |
| C499A | Motor encoder calibration status | | a) Conduct a complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C499A0 | Actual position isn't final. Position error | Motor encoder calibration status | Same as C499A |
| C499A1 | Actual position has an error. Position error | Motor encoder calibration status | Same as C499A |

| C499A2 | Actual position has a an error and isn't final. Position error | Motor encoder calibration status | Same as C499A |
|--------|--|---|---|
| C499A3 | Target position | Motor encoder calibration status | Same as C499A |
| C499A4 | Actual average position | Motor encoder calibration status | Same as C499A |
| C499A5 | Actual position variance | Motor encoder calibration status | Same as C499A |
| C499A6 | Actual position min to max delta | Motor encoder calibration status | Same as C499A |
| C499A7 | Actual sample position number | Motor encoder calibration status | Same as C499A |
| C720A2 | LVD (low voltage detection) | Low Voltage warning level reached | Same as C720A |
| C710A | ROM Test | | a) Do a complete rebooting sequenceb) Update softwarec) Contact your localUniversal Robots service provider for assistance |
| C710A0 | Critical error | A critical error occurred during ROM validation | Same as C710A |
| C710A1 | ROM corrupted | A critical error occurred during ROM validation | Same as C710A |
| C710A2 | Failed to validate CRC on invariant data in RAM | A critical error occurred during ROM validation | Same as C710A |
| C710A3 | Unexpected size of invariant data | A critical error occurred during ROM validation | Same as C710A |
| C710A4 | Failed to validate CRC on code segment in RAM | A critical error occurred during ROM validation | Same as C710A |
| C720A | Low Voltage Detection (LVD) | | a) Do a Complete rebooting sequence b) Check for loose connections d) Update software e) Contact your local Universal Robots service provider for assistance |



| C720A0 | Reset due to Low Voltage Dectection (LVD) or power off | Voltage needed values is not reaching the necessary values to work. Out of range | Same as C720A |
|--------|--|--|---|
| C720A1 | Low Voltage warning level reached | Voltage needed values is not reaching the necessary values to work. Out of range | Same as C720A |
| C740A | Hardware monitoring | | a) Do a Complete rebooting sequence b) Update software c) Contact your local Universal Robots service provider for assistance |
| C740A0 | Critical error | A critical error occurred during hardware monitoring | Same as C740A |
| C740A1 | 1V2 voltage is outside of the allowed range | | Same as C740A |
| C740A2 | 1V8 voltage is outside of the allowed range | | Same as C740A |
| C740A3 | 2V5 voltage is outside of the allowed range | | Same as C740A |
| C740A4 | 3V3 voltage is outside of the allowed range | | Same as C740A |
| C740A5 | PC 3V3 voltage is outside of the allowed range | | Same as C740A |
| C740A6 | uA's 3V3voltage is outside of the allowed range | | Same as C740A |
| C740A7 | uB's 3V3 voltage is outside of the allowed range | | Same as C740A |
| C740A8 | 5V voltage is outside of the allowed range | | Same as C740A |
| C740A9 | 12V voltage is outside of the allowed range | | Same as C740A |

| τ |) |
|---|---|
| (| U |
| > | > |
| 5 | |
| C | υ |
| C | ŋ |
| (| υ |
| 7 | |
| • | n |
| ř | 5 |
| _ | |
| 7 | 7 |
| • | |
| • | - |
| = | |
| ~ | 7 |
| _ | ۰ |
| | |
| á | 9 |
| 2 | > |
| < | 4 |
| , | ^ |
| Ť | 3 |
| Ċ | כ |
| _ | 5 |
| 7 | 5 |
| $\hat{}$ | 2 |
| ш | |
| _ | |
| Ç | U |
| C | מ |
| 1 | _ |
| (| υ |
| > | > |
| - | |
| | = |
| = | J |
| | |
| 7 | ۹ |
| _ | - |
| _ | |
| Ċ | J |
| × | ` |
| ≍ | |
| ٠. | ٧ |
| Į. | |
| C | 7 |
| C | ٠ |
| | |
| \mathbf{c} | 5 |
| 2 | 5 |
| S | 5 |
| 200 | |
| 000 | |
| + 0 0 0 to | |
| 14+ © 20 | |
| 00 0 +q0 | |
| rioht © 20 | |
| Oc Start | |
| OC Strick | |
| October 000 | |
| Ochricht © 20 | |
| Converight © 20 | |
| Convigable 2009 - 2004 by Haiversal Dobots A /C All rights reserved | |
| Conviriaht © 20 | |

| C740A10 | 24V voltage is outside of the allowed range | | Same as C740A |
|---------|--|--|--|
| C740A11 | 48V voltage is outside of the allowed range | | Same as C740A |
| C740A12 | 58V voltage is outside of the allowed range | | Same as C740A |
| C740A13 | -4V voltage is outside of the allowed range | | Same as C740A |
| C740A14 | Robot voltage is outside of the allowed range | | Same as C740A |
| C740A15 | Robot current is outside of the allowed range | | Same as C740A |
| C740A17 | Inrush protected 48V voltage is outside of the allowed range | | Same as C740A |
| C740A20 | 24V SPI IO voltage | 24V voltage IO is outside its limits (Below 23,0V above 25,7V) | a) Do a Complete rebooting sequence b) Check for loose connections c) Check for damages to the Tool/sensor d) Update software e) Contact your local Universal Robots service provider for assistance |
| C740A21 | 24V SPI IO current | 24V current IO is outside its limits | a) Do a Complete rebooting sequence b) Check for loose connections c) Check for damages to the Tool/sensor d) Update software e) Contact your local Universal Robots service provider for assistance |



| C740A22 | The solenoid voltage is not 0 before activation | | Same as C740A |
|---------|--|--|--|
| C740A23 | The solenoid voltage is not 48V after activation | | Same as C740A |
| C740A24 | The left Three- Position Enabling button is inconsistent | Check for connections problem. Check 3PE functionality | a) Do not press the button repeatedly b) Remove any pressure off the button c) Press the button with more pressure, if light pressing may not work d) Update software e) Contact your local Universal Robots service provider for assistance |
| C740A25 | The right Three- Position Enabling button is inconsistent | Check for connections problem. Check 3PE functionality | Same as C740A24 |
| C740A26 | State for the Three- Position Enabling button | Check for connections problem. Check 3PE functionality | Same as C740A24 |
| C900A | Debug message data | | |

7. Troubleshooting

7.2. LED indicators and Fuses on Safety Control Board

Safety Control Board (SCB)

1. Fuse 48 V:

The 5A fuse (F801) "48V" protects all 48V in the system inclusive of Euromap from over current.

This information is only for troubleshooting. Do NOT replace the fuse under any circumstances.


In case of failure, ONLY replace the SCB with a new tested board.

2. Fuse 24 V:

2 x 5A fuses (F1001 and F1002) in parallel protect the DI/DO 24 V supply on the Safety Control Board, whether the 24 V is from the controller or external power supply. Do NOT replace the fuses under any circumstances. In case of failure ONLY replace the SCB with a new tested board.

3. LED indicators:

- 12V-PSU On when the power plug is connected.
- 12V System: On when the main controller power has been activated.
- 5V On when "12V System" is on and indicates that 5V is present.
- -4V On when "12V System" is on and indicates that 4V to analog I/O is present.
- 3V3A On when 5V is on and indicates 3.3V for logic Safety circuit A is present.
- 3V3B On when 5V is on and indicates 3.3V for logic Safety circuit B is present.
- 48V Indicates 48 V is present on the Safety Control Board
- 24V 48V is detected and ok, indicates that internal 24 V is present for I/Os
- R 48 V present on robot arm
- A Indicates Status for Logic A: a blink sequence
- B Indicates status for Logic B: a blink sequence

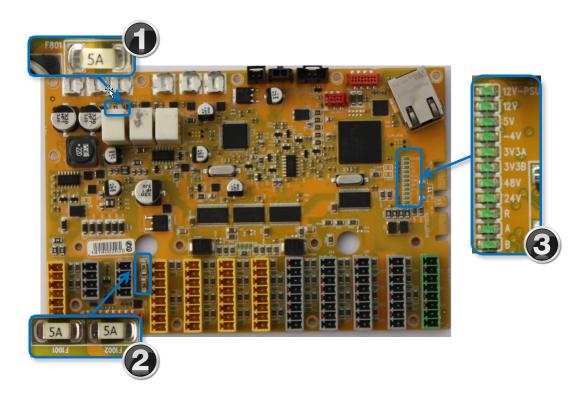

7.3. Normal startup sequence for a CB3.x UR3

- 1. The 12V-PSU LED is on when the power plug is connected to a working power supply.
- 2. When the power button on the teach pendant is pressed, all LED indicators are turned on except for the 48V, 24V and R LEDs. The A and B LEDs also exhibit a special behavior by intermittently turning off and on ("blinking") once triggered.
- 3. The final phase of the startup sequence occurs (immediately) after the Polyscope software is done loading. At this stage, the 48V and 24V LED indicators become active (are switched on).




If the 48V LED indicator is off all the time in the startup sequence you should measure the voltage: See the E-Plan diagram: 5.4.1 Schematic overview


- 1. Measure the 48V on the Safety Control Board (SCB) where the 48V comes from the Current distributor. And check this 1 second pulse.
 - a. The voltage is measured on the Safety Control Board. That means the Safety Control Board is defect.
 - b. No voltage is measured on the Safety Control Board. Then measure the 230 V on the input side of the 48V power supply. If the voltage pulse of 1 second is present, the Power supply is defect.
 - c. No voltage is measured on the input of the power supply. Then measure the 230 V on the input side of the Current distributor. If the voltage is present, the current distributor is defect.

7.4. Error phenomena


7.4.1. Control Box: NO CONTROLLER displayed in Initializing

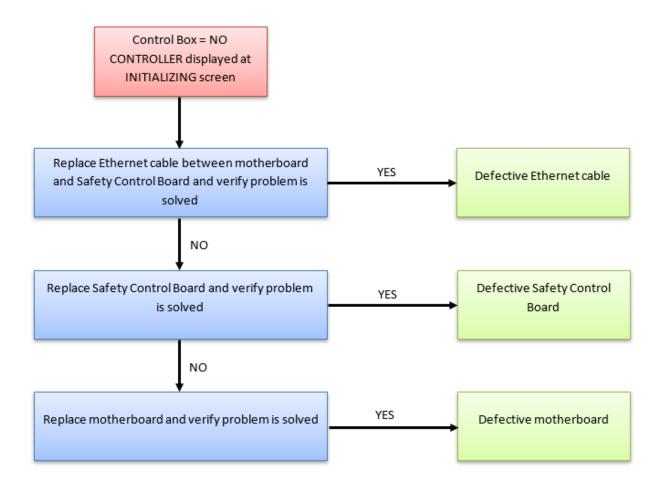

7.4.2. NO CABLE displayed during power up

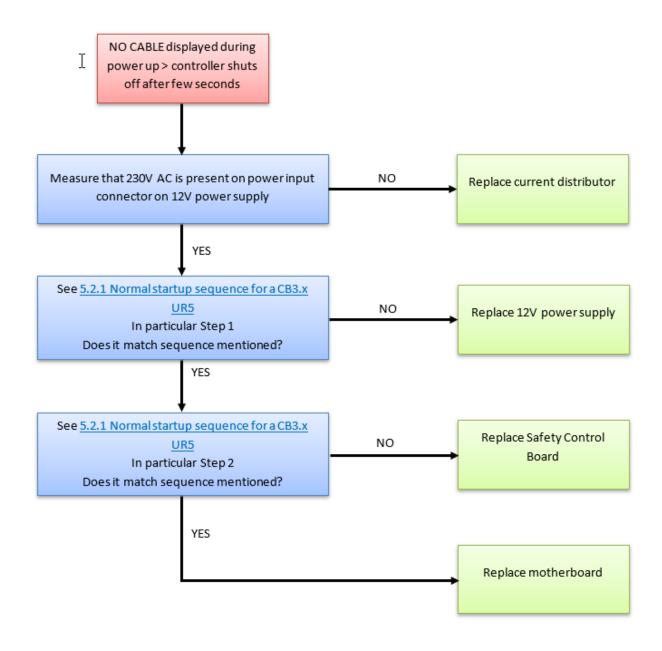

7.4.3. Protective stop

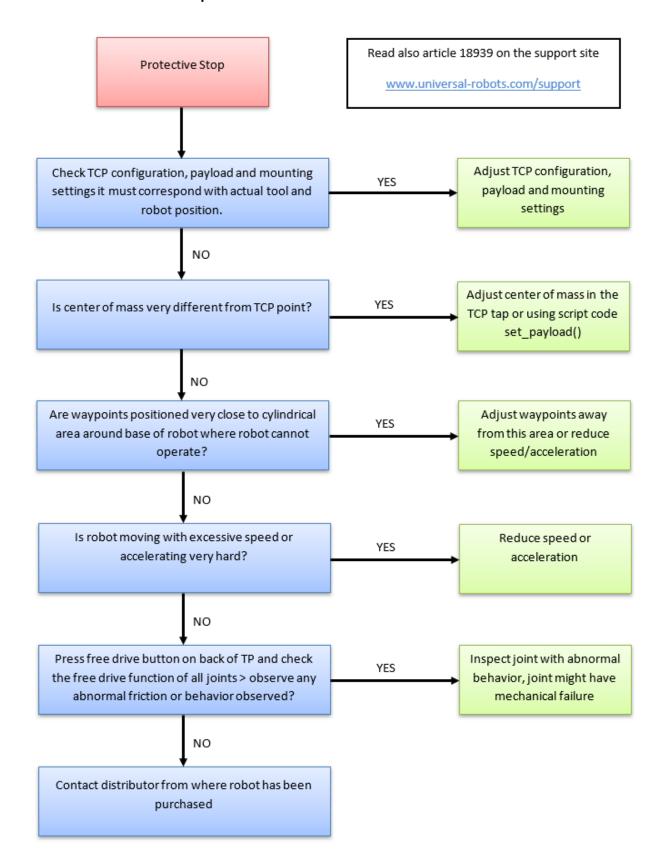

Ignoring protective stops is considered abuse of the robot which voids the warranty.

These faults can be hidden from view under the following two circumstances:

WARNING

Ignoring protective stops masks fault detection! Pay careful attention to protective stops.

Personnel simply resetting a fault without review of why the fault has happened.
 Protective stops must never be acknowledged and reset automatically, it must always be a deliberate action by a user to resume after a protective stop.

In general, protective stops are designed to inform the user that the robot has stopped due to an external event such as hitting an obstacle or similar. In case the robots are pushed close to the limits, the robots can generate protective stops to indicate that they are not capable of following the desired trajectory. After a protective stop, the following must be done before resuming operation:

- 1. If there has been a collision or similar:
 - Remove the obstacle and ensure that operators are out of the way before resuming operation. See Section 2 of Service Manual (see link below).
- 2. If there has been NO collision or similar:

The robot is operating too close to the limits, the application should be adjusted to reduce the load on the robot, for instance by reducing accelerations, by correct use of blends or similar measures.

Protective stops are indications of issues, including program or production issues – not only safety issues. An application which results in daily protective stops is not designed correctly and needs to be modified.

2. If an automatic acknowledgement and reset of a protective stop has been programmed – no one will see the protective stop.

WARNING

Automatic acknowledgement and reset of protective stops masks faults that will lead to a failure condition.

When there is a protective stop, verify the cause.


If there has been no collision, then adjust the program.

If an integrator has set-up the application program to do automatic acknowledgement and reset of protective stops, the customer should contact the integrator change the program immediately, as such override voids the product warranty and masks fault detection.


7.4.4. Power on failure in Initializing

If power turns off a few seconds after Robot Power is turned On in the Initializing window, there are many possible causes for this phenomenon.

Most likely it is a control box failure or a communication failure with a joint or the tool.

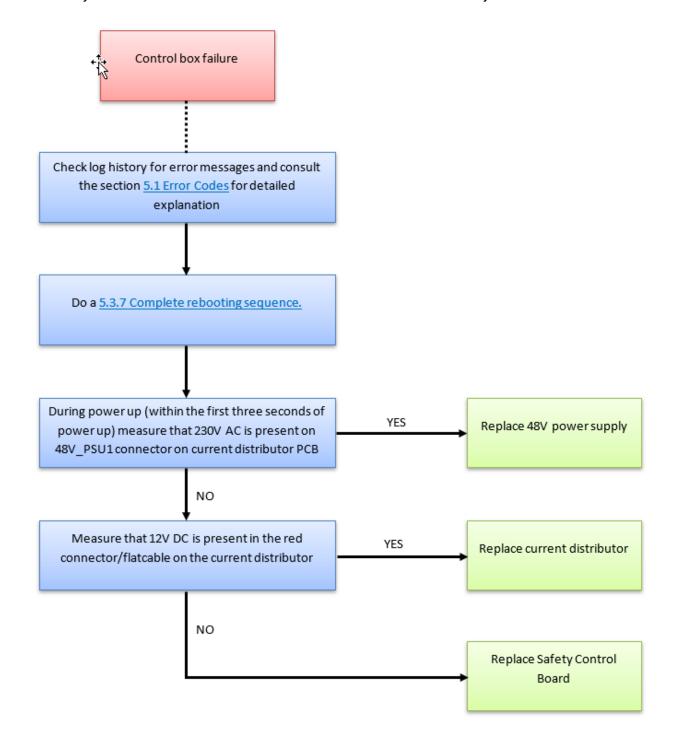


7.4.5. Checklist after a collision

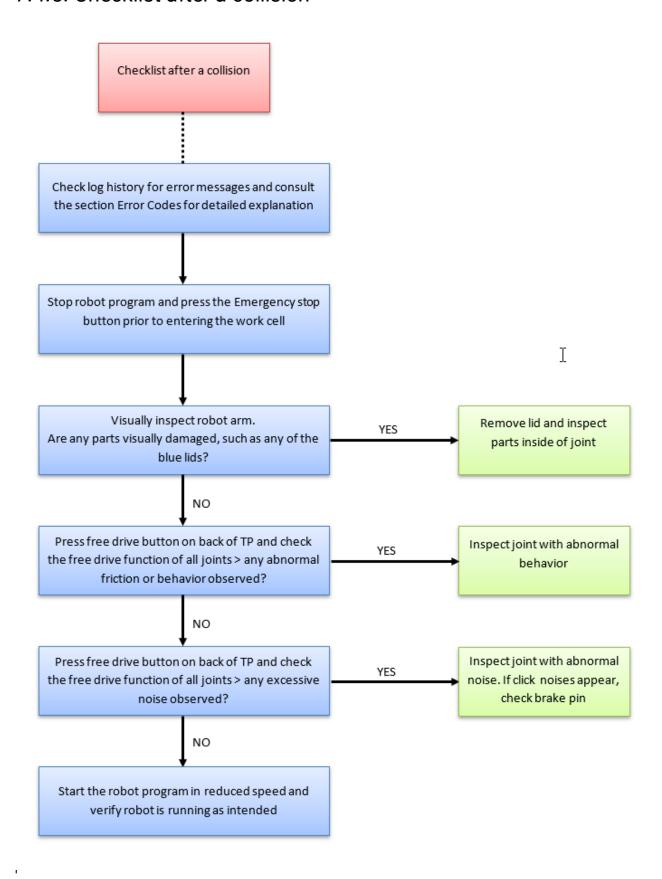


Service Manual 205 UR3

7. Troubleshooting

7.4.6. Communication to joints and tool

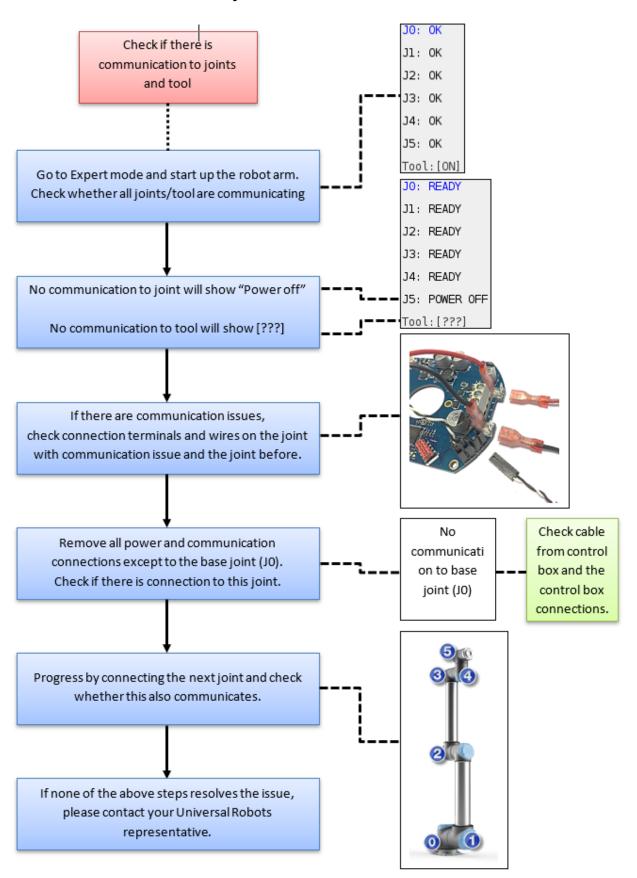

7.4.7. Complete rebooting sequence.

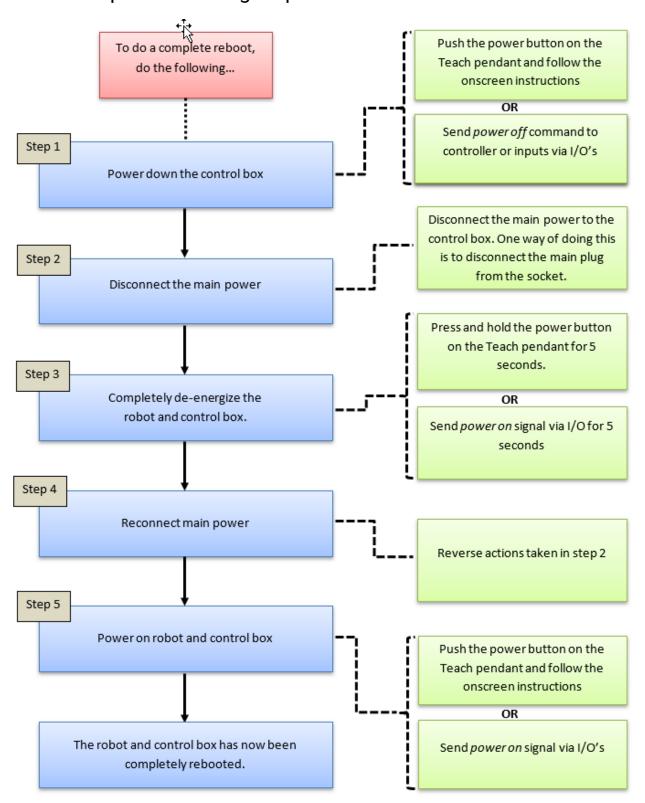


Copyright © 2009-2021 by Universal Robots A/S. All rights reserved.


UNIVERSAL ROBOTS 7. Troubleshooting

7.5. Electrical drawing


Diagrams in pdf or in E-plan format, can be found on the support site www.universal-robots.com/support/

UNIVERSAL ROBOTS

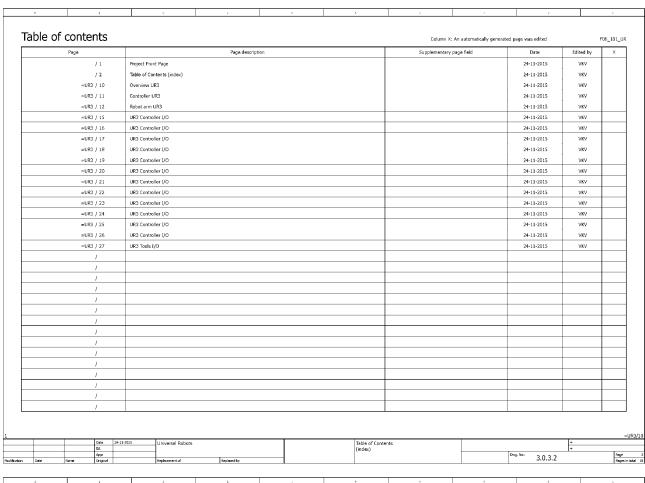

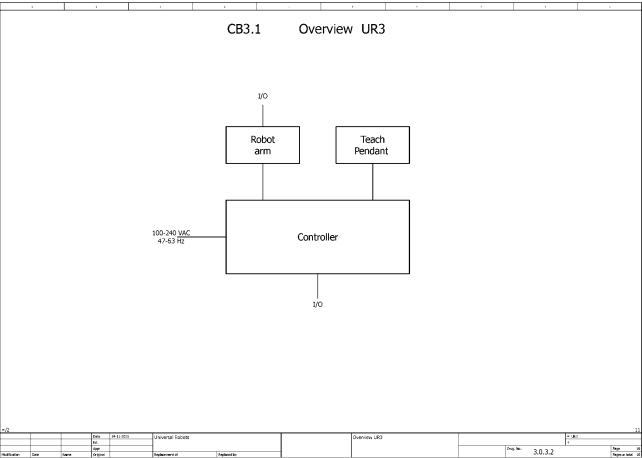


3.0.3.2

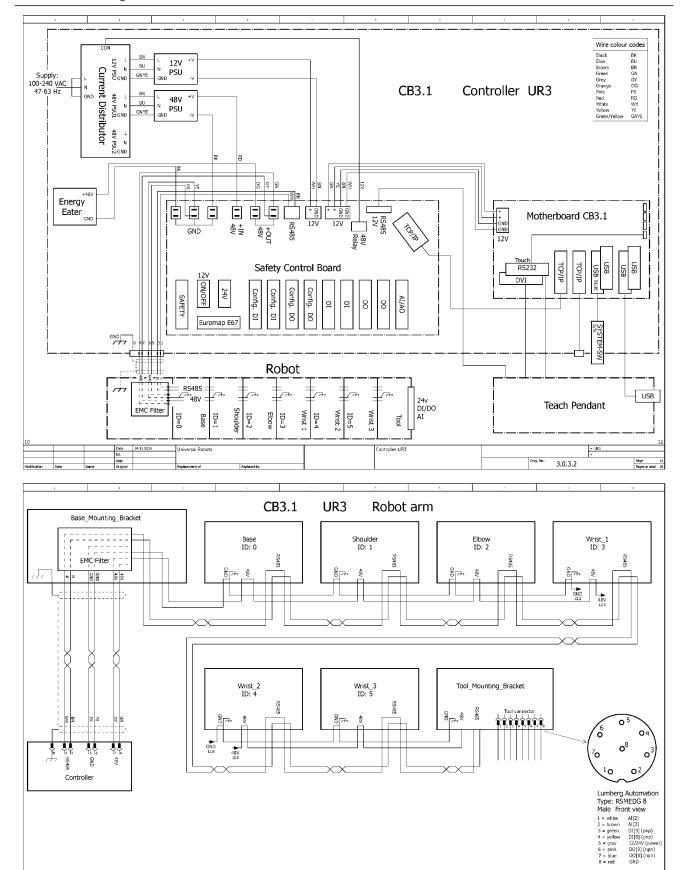


7.6. E-Plan diagrams


Diagrams in pdf or in E-plan format, can be found on the support site


www.universal-robots.com/support/

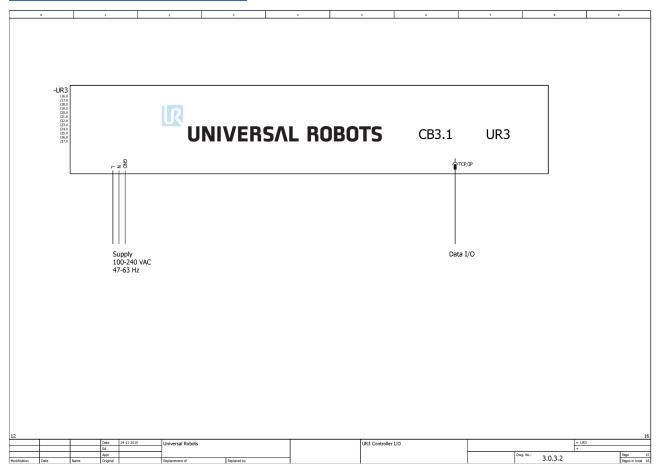

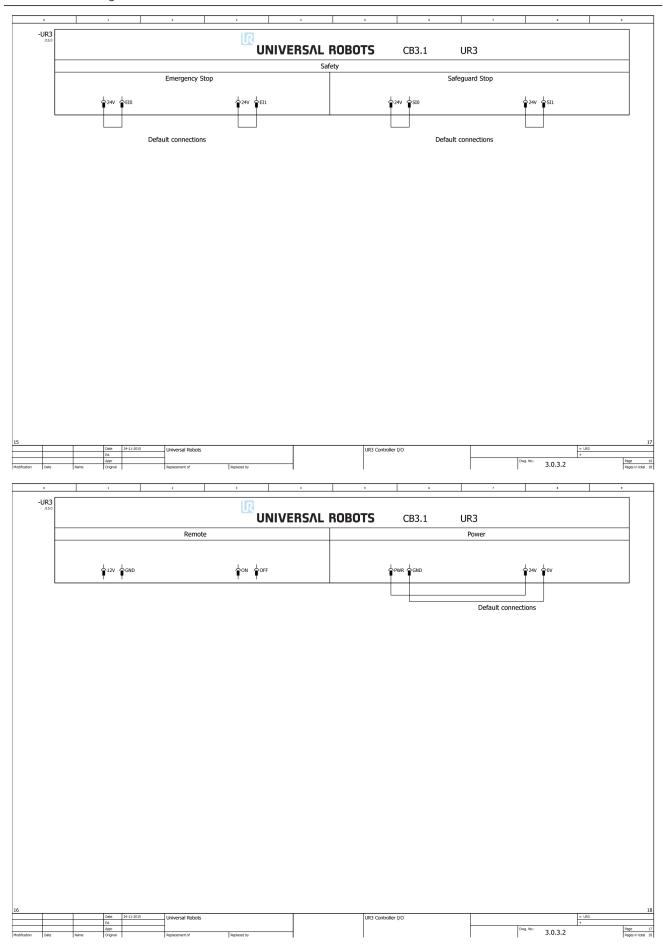





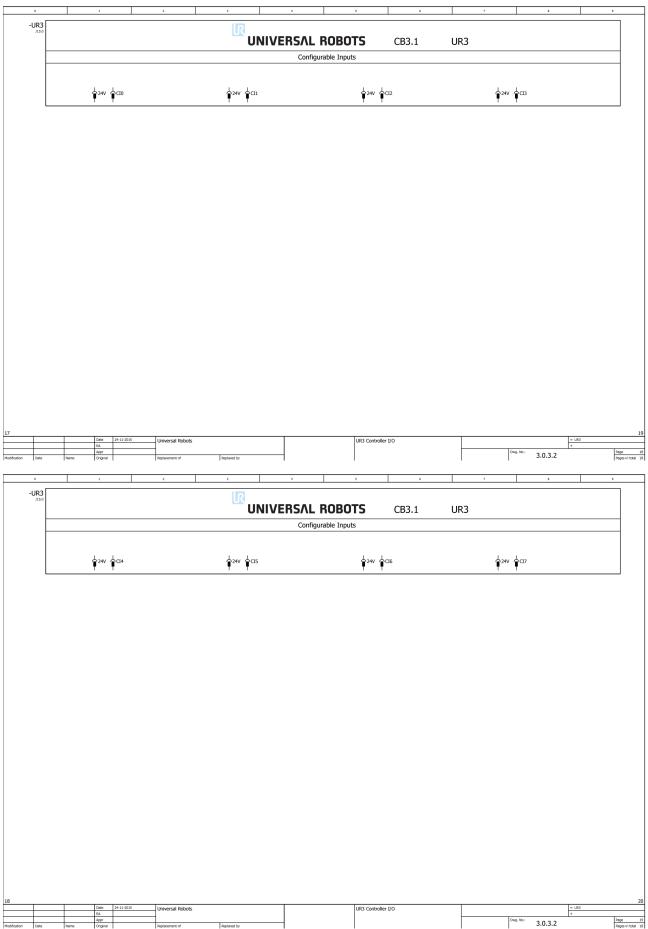

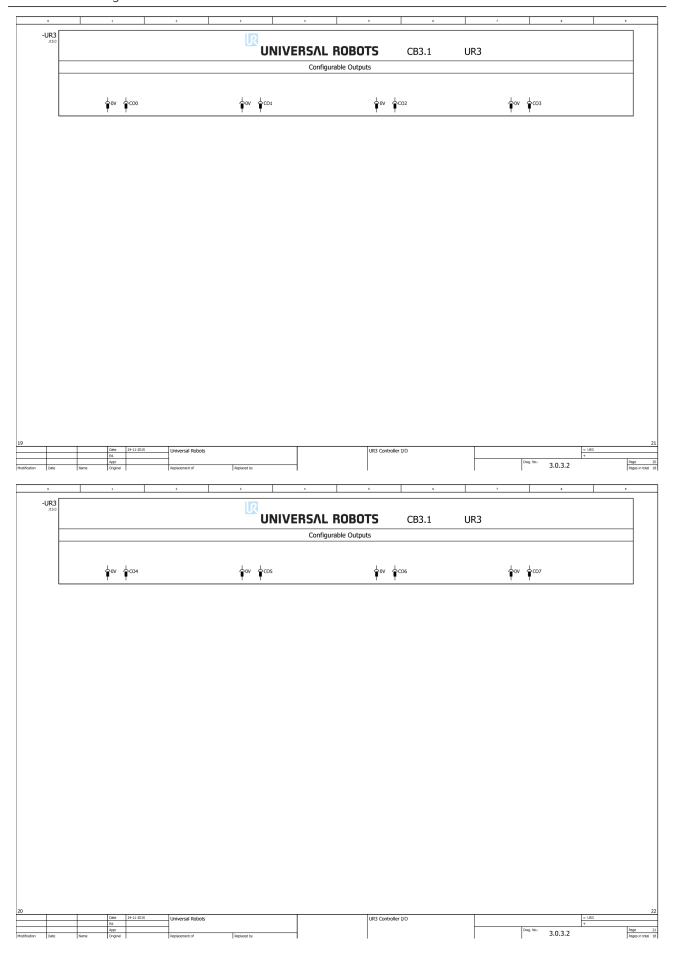




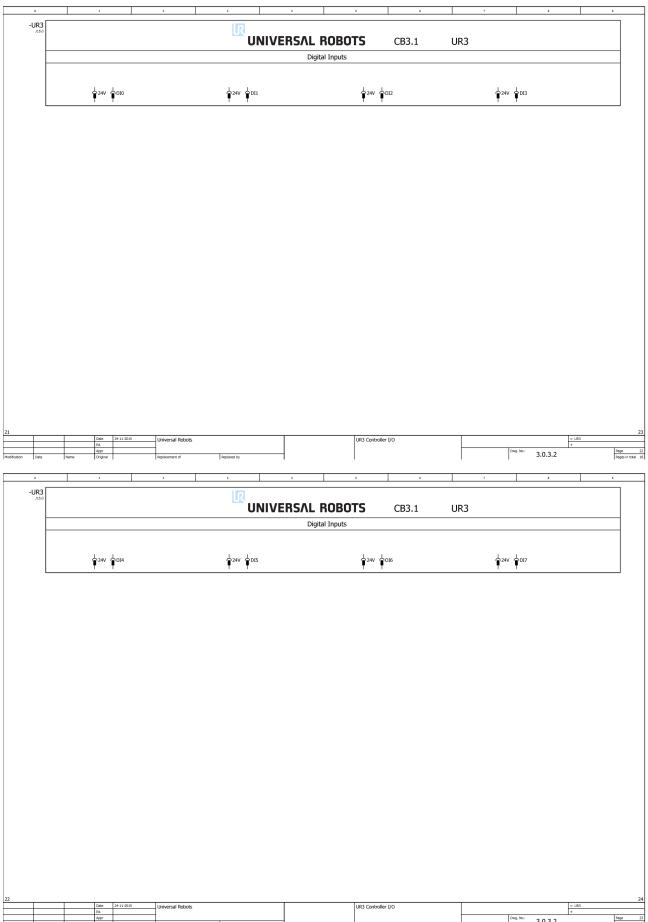

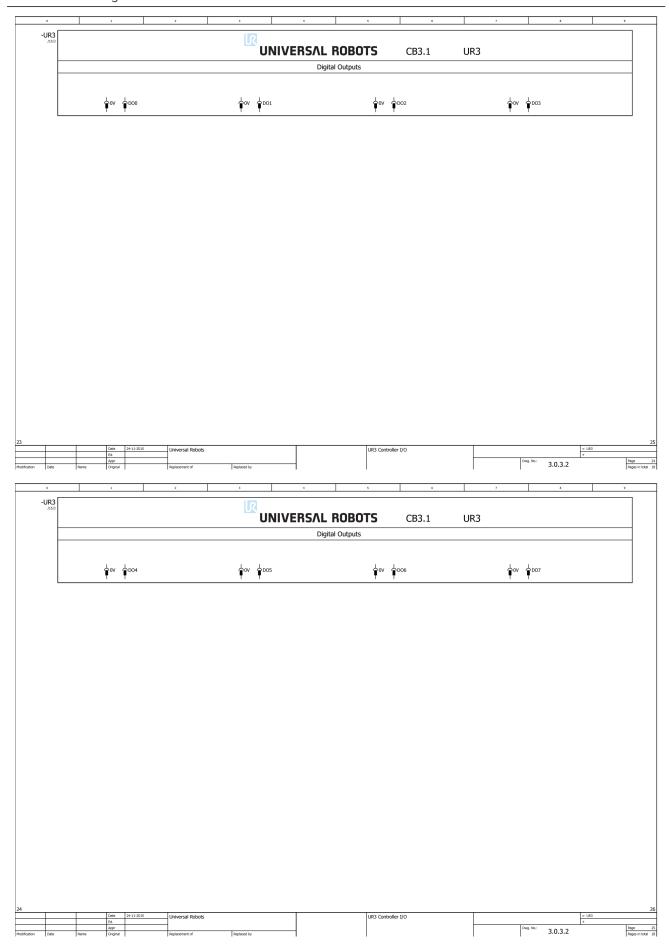



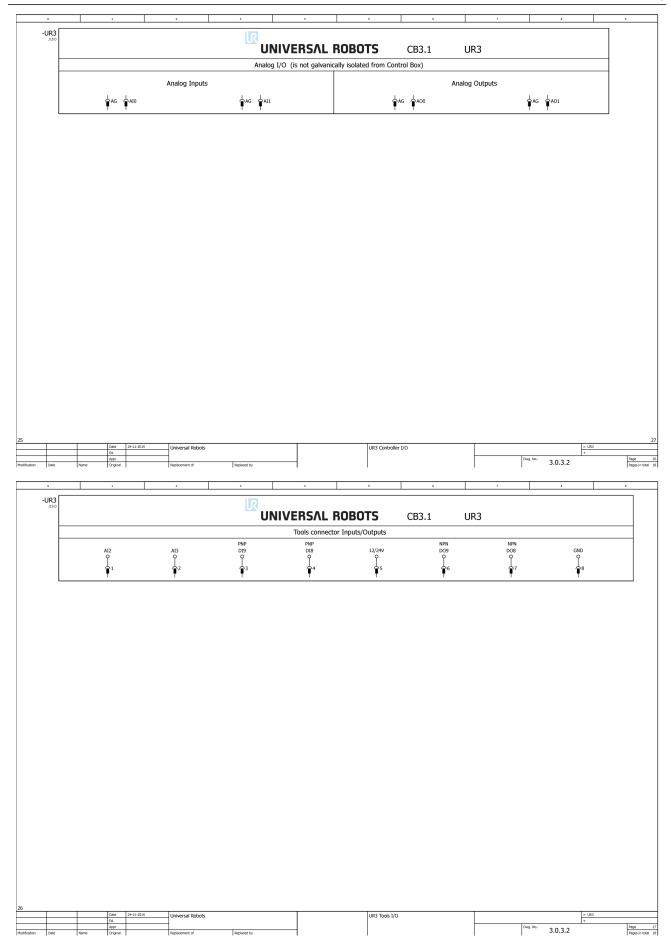



8. Spare Parts

NOTICE

The Spare Parts list incl. parts for other types of Robots. Please take extra notice when looking up part numbers and descriptions.

8.1. Robot arm

| CB3 part no. CB2 Part no. Product Name no. UR3 UR5 UR10 All no. 103303 Flat-ring sealing set UR3, external * - | | | | | | | |
|--|--------|--------|---|-----|-----|------|-----|
| 103413 | • | 022. 4 | Product Name | UR3 | UR5 | UR10 | All |
| 122020 Tool Mounting Bracket UR3 * | 103303 | | Flat-ring sealing set UR3, external | * | | | |
| 122030 Base Mounting Bracket Incl. Cable 6m UR3 | 103413 | | Lid set complete UR3 incl. seal | * | | | |
| 124120 | 122020 | | Tool Mounting Bracket UR3 | * | | | |
| 124220 Joint Size 0 Wrist 2 UR3 * 124320 Joint Size 0 Wrist 3 UR3 * 124321 Joint Size 1 Elbow UR3 * 124122 Joint Size 2 Base UR3 * 124222 Joint Size 2 Shoulder UR3 * 104003 Elbow counterpart and lower arm kit UR3 * 103305 Flat-ring sealing set UR5, external * 103405 Lid set complete UR5 incl. seal * 122041 Tool Mounting Bracket UR5 CB3 * 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 122030 | | <u> </u> | * | | | |
| 124320 | 124120 | | Joint Size 0 Wrist 1 UR3 | * | | | |
| 124321 | 124220 | | Joint Size 0 Wrist 2 UR3 | * | | | |
| 124122 Joint Size 2 Base UR3 * 124222 Joint Size 2 Shoulder UR3 * 104003 Elbow counterpart and lower arm kit UR3 * 103305 103305 Flat-ring sealing set UR5, external * 103405 Lid set complete UR5 incl. seal * 122041 Tool Mounting Bracket UR5 CB3 * 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122211 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122321 Joint Size 1 Wrist 3 UR5 CB3 * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 124320 | | Joint Size 0 Wrist 3 UR3 | * | | | |
| 124222 Joint Size 2 Shoulder UR3 * 104003 Elbow counterpart and lower arm kit UR3 * 103305 103305 Flat-ring sealing set UR5, external * 103405 Lid set complete UR5 incl. seal * 122041 Tool Mounting Bracket UR5 CB3 * 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 124321 | | Joint Size 1 Elbow UR3 | * | | | |
| 104003 | 124122 | | Joint Size 2 Base UR3 | * | | | |
| 103305 103305 Flat-ring sealing set UR5, external * 103405 103405 Lid set complete UR5 incl. seal * 122041 Tool Mounting Bracket UR5 CB3 * 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122321 Joint Size 1 Wrist 3 UR5 CB3 * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 124222 | | Joint Size 2 Shoulder UR3 | * | | | |
| 103405 103405 Lid set complete UR5 incl. seal * 122041 Tool Mounting Bracket UR5 CB3 * 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 104003 | | Elbow counterpart and lower arm kit UR3 | * | | | |
| 103403 Eld set complete ons incl. seal 122041 Tool Mounting Bracket UR5 CB3 * 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 103305 | 103305 | Flat-ring sealing set UR5, external | | * | | |
| 122039 Tool Mounting Bracket UR5 CB2+ * 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 103405 | 103405 | Lid set complete UR5 incl. seal | | * | | |
| 122050 Base Mounting Bracket Incl. Cable 6m UR5 * 122121 Joint Size 1 Wrist 1 UR5 CB3 * 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 122041 | | Tool Mounting Bracket UR5 CB3 | | * | | |
| UR5 122121 | | 122039 | Tool Mounting Bracket UR5 CB2+ | | * | | |
| 122011 Joint Size 1 Wrist 1 UR5 CB2+ * 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 122050 | 122050 | _ | | * | | |
| 122221 Joint Size 1 Wrist 2 UR5 CB3 * 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 122121 | | Joint Size 1 Wrist 1 UR5 CB3 | | * | | |
| 122012 Joint Size 1 Wrist 2 UR5 CB2+ * 122321 Joint Size 1 Wrist 3 UR5 CB3 * | | 122011 | Joint Size 1 Wrist 1 UR5 CB2+ | | * | | |
| 122321 Joint Size 1 Wrist 3 UR5 CB3 * | 122221 | | Joint Size 1 Wrist 2 UR5 CB3 | | * | | |
| | | 122012 | Joint Size 1 Wrist 2 UR5 CB2+ | | * | | |
| 122013 Joint Size 1 Wrist 3 UR5 CB2+ * | 122321 | | Joint Size 1 Wrist 3 UR5 CB3 | | * | | |
| | | 122013 | Joint Size 1 Wrist 3 UR5 CB2+ | | * | | |




UNIVERSAL ROBOTS 8. Spare Parts

| 122123 | | Joint Size 3 Base UR5 CB3 | | * | | |
|--------|--------|---|---|---|---|---|
| | 122031 | Joint Size 3 Base UR5 CB2+ | | * | | |
| 122223 | | Joint Size 3 Shoulder UR5 CB3 | | * | | |
| | 122032 | Joint Size 3 Shoulder UR5 CB2+ | | * | | |
| 122323 | | Joint Size 3 Elbow UR5 CB3 | | * | | |
| | 122033 | Joint Size 3 Elbow UR5 CB2+ | | * | | |
| 123100 | 123100 | Elbow counterpart and lower arm UR5 | | * | | |
| 103310 | 103310 | Flat-ring sealing set UR10, external | | | * | |
| 103410 | 103410 | Lid set complete UR10 incl. seal | | | * | |
| 122061 | | Tool Mounting Bracket UR10 CB3 | | | * | |
| | 122059 | Tool Mounting Bracket UR10 CB2+ | | | * | |
| 122071 | 122071 | Base Mounting Bracket UR10 | | | * | |
| 106424 | 106424 | UR10 Base plug w/wire | | | * | |
| 122122 | | Joint Size 2 Wrist 1 UR10 CB3 | | | * | |
| | 122021 | Joint Size 2 Wrist 1 UR10 CB2+ | | | * | |
| 122222 | | Joint Size 2 Wrist 2 UR10 CB3 | | | * | |
| | 122022 | Joint Size 2 Wrist 2 UR10 CB2+ | | | * | |
| 122322 | | Joint Size 2 Wrist 3 UR10 CB3 | | | * | |
| | 122023 | Joint Size 2 Wrist 3 UR10 CB2+ | | | * | |
| 122324 | | Joint Size 3 Elbow UR10 CB3 | | | * | |
| | 122034 | Joint Size 3 Elbow UR10 CB2+ | | | * | |
| 122124 | | Joint Size 4 Base UR10 CB3 | | | * | |
| | 122042 | Joint Size 4 Base UR10 CB2+ | | | * | |
| 122224 | | Joint Size 4 Shoulder UR10 CB3 | | | * | |
| | 122043 | Joint Size 4 Shoulder UR10 CB2+ | | | * | |
| 104001 | 104001 | Elbow counterpart and lower arm kit UR10. (incl. lid, gasket, screws, etc.) | | | * | |
| 103500 | | Wire bundle kit for size 0 | * | | | |
| 103501 | | Wire bundle kit for size 1 | * | * | | |
| 103502 | | Wire bundle kit for size 2 | * | | * | |
| 103503 | | Wire bundle kit for size 3 | | * | * | |
| 103504 | | Wire bundle kit for size 4 | | | * | |
| 103508 | | Wire bundle kit for lower arm | | | | * |
| 103509 | | Wire bundle kit for upper arm | | | | * |
| 103810 | | UR10 Elbow lock | | | * | |
| | | | | | | |



8.2. Controller

| CB3 part no | CB2 Part no | Product Name | UR3 | UR5 | UR10 | All |
|----------------|----------------|---|-----|-----|------|-----|
| 102203 | | Controller excl. Teach Pendant UR3 CB 3.2 | * | | | |
| 102205 | | Controller excl. Teach Pendant UR5 CB3.2 | | * | | |
| 102200 | | Controller excl. Teach Pendant UR10 CB3.2 | | | * | |
| 124920 | | Controller OEM CB3.2 UR3 | * | | | |
| 124923 | | Controller OEM CB3.2 UR5 | | * | | |
| 124925 | | Controller OEM CB3.2 UR10 | | | * | |
| 122091 | | Teach Pendant complete CB3.x | | | | * |
| | 122092 | Teach Pendant complete CB2/CB2.1 | | * | * | |
| 122673 | | Euromap E67 module | * | | | |
| | 106700 | Euromap E67 kit CB2 (incl. Bypass plug and cable) | | * | * | |
| 106800 | | Euromap E67 kit CB3 (incl. Bypass plug and cable) | | | | * |
| 107100 | | Euromap E67 kit CB3.2 (incl. Bypass plug and cable) | | | | |
| 123670 | 123670 | Euromap E67 cable 6m | | | | * |
| 122671 | 122671 | Euromap E67 Bypass Plug | | | | * |
| 122650 | | Motherboard kit CB2.1 and CB3.1 (incl. RAM) | | | | * |
| | 122700 | Masterboard kit CB2 | | * | * | |
| | 122420 | CB2.0 to CB2.1 Motherboard Upgrade Kit | | * | * | |
| 122430 | | CB3.0 to CB3.1 Motherboard Upgrade Kit | | * | * | |
| 171030 | 171030 | RAM module CB2.0 and CB3.0 | | * | * | |
| 171031 | | RAM module CB2.1 and CB3.1 | | | | * |
| 171022 | 171022 | Flash card CB2 and CB3 | | * | * | |
| 122421 | 122421 | Flashcard for Robot incl. SW and Serial no. CB2 and CB3 | | * | * | |
| 177002 | 177002 | Power Supply Unit 12V | | | | * |
| 177003 | 177003 | Power Supply Unit 48V | | | | * |
| 122431 | 122431 | USB for Robot incl. SW and Serial no. CB2.1 and CB3.1 | | | | * |
| 172080 | 172080 | Current Distributor PCB | | | | * |
| 172290 | | Safety Control Board | | | | * |

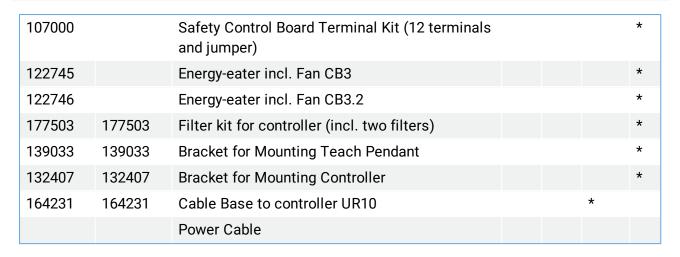

8.3. Tools

| CB3 part no | CB2 Part no | Product Name | UR3 | UR5 | UR10 | All |
|----------------|----------------|---|-----|-----|------|-----|
| 109011 | 109011 | Tool kit UR3/UR5/UR10 (kit includes all of the parts marked with *) | | | | * |
| 109101 | 109101 | * Spanner hex 5,5mm | | | | * |
| 109102 | 109102 | * Spanner hex 7,0mm | | | | * |
| 109110 | 109110 | * Spanner hex 10,0mm | | | * | |
| 109103 | 109103 | * Screwdriver torx T10 | | | | * |
| 109104 | 109104 | * Torque screwdriver torx T8 + T10 | | | | * |
| 109111 | | * Torque screwdriver torx T10 | * | | | |
| 109112 | | * Torque screwdriver torx T20 | * | | | |
| 109105 | 109105 | * Torque wrench hex 5,5mm Size 1 and Size 2 | | | | |
| 109106 | 109106 | * Torque wrench hex 7,0mm Size 3 | | | | * |
| 109107 | 109107 | * Torque wrench hex 10,0mm Size 4 | | | * | |
| 109180 | 109180 | * ESD Wrist strap | | | | * |
| 164084 | 164084 | * Bypass cable (for setting joint-ID) | | | | * |
| 185500 | | Dual calibration tool | | | | * |
| 131501 | 131501 | Bracket for mounting robotarm UR5 (Item profile) | | * | | |
| 131502 | 131502 | Bracket for mounting robotarm UR5 (BOSCH profile) | | * | | |
| 131503 | | Bracket for mounting robotarm UR3 (Item & BOSCH profile) | * | | | |
| 131510 | 131510 | Bracket for mounting robotarm UR10 (Item & BOSCH profile) | | | * | |
| 131095 | | Lid tool protective cap alu. for tool connector | | * | | |
| | | | | | | |



| 173100 | 173100 | Cable for tool external with angle connector | | | * |
|--------|--------|---|--|---|---|
| 173101 | | Cable for tool external w/90-degree connector | | * | * |

9. Packing of robot

Packing of robot and controller box for shipment

NOTICE

Remove any external tooling and external electrical connections before shipment. Universal Robots may reject the shipment if 3rd party products cannot be unmounted safely or they prohibit to the execution of required post repair tests. Universal Robots assume no responsibility for 3rd party goods return shipment. Please ensure the robot, controller and teach pendant is packed responsibly. Universal Robots will always return Universal Robots products in original Universal Robots packaging.

- Download correct put_in_box program in regard to robot type and packing material from www.universal-robots.com/support/
- Upload the program to the robot. See Using Magic files on how this can be done.
- Load the program and follow instructions given when running the program.
 Note: If robot cannot run or power is not available, it is possible to manually release the brakes for each joint individually and pack the robot accordingly. For brake release, see Brake release
- · Power down, disconnect power and disconnect robot arm from controller.
- Pack robot arm and controller box in designated boxes. Make sure the robot arm is orientated correct in the box.









10. Change log

| Date Revision Action Changes | | | | |
|--|-------------------|----------|-----------|--|
| December UR3_ en_3.1.1 December UR3_ en_3.1.2 Added en_3.1.2 Added en_3.2.0 Added en_3.2.0 Added en_3.2.0 Added en_3.2.0 Added en_3.2.0 Added en_3.2.0 Error code C71A12 | Date | Revision | Action | Changes |
| 2015 en_3.1.2 codes, Updated Electrical drawings, Torque value for elbow changed, October 2016 UR3_ en_3.2.0 Added en_3.1.20 Wire bundle installation guide 2016 Corrected 5.2 LED startup sequence 2016 Corrected Various spellings, word, setup February 2017 Added 1.4 Warning signs 2017 Added Tolerance description to C50A5 and C50A6 October 2017 Added Error code C103A3 2018 Changed Error code C20A1 description 2018 Added Troubleshooting 5.3.7 Corrected Thow to fix" text corrected on many error codes 2018 en_3.2.1 May 2019 UR3_ en_3.2.2 Updated I.4 Warning signs Aug 2019 UR3_ en_3.2.4 Corrected Wersion number to match UR5 and UR10 September UR3_ en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | Revision 3.1.1 released |
| December 2016 Added Error code C71A12 Corrected 5.2 LED startup sequence Corrected Various spellings, word, setup February 2017 Added 1.4 Warning signs Added Tolerance description to C50A5 and C50A6 October 2017 Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply January 2018 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated 1.4 Warning signs Added Inspection plan to chapter 2 en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | codes, Updated Electrical drawings, Torque value for elbow |
| Corrected S.2 LED startup sequence Corrected Various spellings, word, setup February 2017 Added 1.4 Warning signs Added Tolerance description to C50A5 and C50A6 October 2017 Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply January 2018 Corrected "how to fix" text corrected on many error codes September 2018 Bursa en_3.2.1 May 2019 UR3 en_3.2.2 Updated 1.4 Warning signs Added Merge control box details en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | 3.1.20 Wire bundle installation guide |
| Corrected Various spellings, word, setup 7. Packing robot | | | Added | Error code C71A12 |
| Changed 7. Packing robot Added 1.4 Warning signs Added Tolerance description to C50A5 and C50A6 October 2017 Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply January 2018 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Added Merge control box details Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Corrected | 5.2 LED startup sequence |
| Added 1.4 Warning signs Added Tolerance description to C50A5 and C50A6 Added Troubleshooting 5.3.6 Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply Added Troubleshooting 5.3.7 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ Updated en_3.2.2 Updated 1.4 Warning signs Aug 2019 UR3_ Added Merge control box details en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Corrected | Various spellings, word, setup |
| Added Tolerance description to C50A5 and C50A6 Added Troubleshooting 5.3.6 Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply Added Troubleshooting 5.3.7 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Added Merge control box details en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Changed | 7. Packing robot |
| October 2017 Added Troubleshooting 5.3.6 Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply Added Troubleshooting 5.3.7 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Added Merge control box details en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | 1.4 Warning signs |
| Added Error code C103A3 Changed Error code C20A1 description Added Steps when replacing 48V power supply Added Troubleshooting 5.3.7 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Corrected Version plan to chapter 2 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | Tolerance description to C50A5 and C50A6 |
| Changed Error code C20A1 description Added Steps when replacing 48V power supply Added Troubleshooting 5.3.7 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Aug 2019 UR3_ en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | Troubleshooting 5.3.6 |
| Added Steps when replacing 48V power supply Added Troubleshooting 5.3.7 Corrected "how to fix" text corrected on many error codes September 2018 | | | Added | Error code C103A3 |
| January 2018 Corrected "how to fix" text corrected on many error codes September UR3_ en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated Inspection plan to chapter 2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Added Merge control box details Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Changed | Error code C20A1 description |
| Corrected "how to fix" text corrected on many error codes September UR3_ Added Inspection plan to chapter 2 en_3.2.1 May 2019 UR3_ Updated Inspection plan to chapter 2 en_3.2.2 Updated 1.4 Warning signs Aug 2019 UR3_ Added Merge control box details en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | Steps when replacing 48V power supply |
| September 2018 UR3_ en_3.2.1 Added Inspection plan to chapter 2 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Aug 2019 UR3_ en_3.2.4 Added Merge control box details Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | Troubleshooting 5.3.7 |
| 2018 en_3.2.1 May 2019 UR3_ en_3.2.2 Updated Inspection plan to chapter 2 Updated 1.4 Warning signs Aug 2019 UR3_ en_3.2.4 Added Merge control box details Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Corrected | "how to fix" text corrected on many error codes |
| en_3.2.2 Updated 1.4 Warning signs Aug 2019 UR3_ en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Added | Inspection plan to chapter 2 |
| Aug 2019 UR3_ en_3.2.4 Added Merge control box details Corrected Version number to match UR5 and UR10 September Added Update Error Codes | May 2019 | | Updated | Inspection plan to chapter 2 |
| en_3.2.4 Corrected Version number to match UR5 and UR10 September Added Update Error Codes | | | Updated | 1.4 Warning signs |
| September Added Update Error Codes | Aug 2019 | | Added | Merge control box details |
| The state of the s | | | Corrected | Version number to match UR5 and UR10 |
| | September 2020 | | Added | Update Error Codes |