

Home Report



70 SHUNA CRESCENT, GLASGOW, G20 9QS

Date of Valuation: 26/MAY/2021

Our Reference: 16122







FIRST SURVEYORS SCOTLAND WAS ESTABLISHED IN THE COURSE OF 1999 AND COMPRISES SEVEN OF SCOTLAND'S LEADING FIRMS OF CHARTERED SURVEYORS. OUR RICS ACCREDITED AND REGISTERED VALUER TEAMS ACROSS SCOTLAND ARE AVAILABLE TO PROVIDE EXPERT ADVICE AND A FULL RANGE OF PROPERTY SERVICES.

NATIONAL COVERAGE - LOCAL EXPERTISE - FIRST SURVEYORS SCOTLAND.

EACH OFFICE HAS BEEN ESTABLISHED FOR MANY YEARS AND IS OPERATED BY AN EXPERIENCED AND KNOWLEDGEABLE CHARTERED SURVEYOR.

ONE CALL GIVES YOU ACCESS TO THE GREATEST CONCENTRATION OF INDEPENDENT OFFICES ACROSS SCOTLAND.

DHKK CHARTERED SURVEYORS ARE PROUD MEMBERS OF FIRST SURVEYORS SCOTLAND.

WE ARE "PANEL SURVEYORS" AND OUR HOME REPORTS ARE RELIABLY ACCEPTED BY ALL MAJOR BANKS AND BUILDING SOCIETIES.

AS PART OF FIRST SURVEYORS SCOTLAND WE HAVE A NETWORK OF AVAILABLE OFFICES ACROSS SCOTLAND.

DIXON HEANEY KEAN KENNEDY (DHKK LTD) WAS FORMED FROM THE MERGER OF LONG ESTABLISHED FIRMS DIXON HEANEY AND KEAN KENNEDY. WE ARE EDINBURGH, FIFE AND GLASGOW & THE WEST BASED CHARTERED SURVEYORS OFFERING RESIDENTIAL VALUATION AND SURVEY SERVICES. THE PRACTICE OFFERS A WEALTH OF EXPERIENCE AND LOCAL KNOWLEDGE AND OUR LONGSTANDING CLIENT BASE IS EVIDENCE OF OUR EXEMPLARY SERVICE.



survey report on:

_	
Property address	70 SHUNA CRESCENT GLASGOW G20 9QS
Customer	Mr & Mrs Vandertoorn
Customer address	
Prepared by	DHKK Chartered Surveyors
Date of inspection	26th May 2021



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise of a mid-terraced house set over 3 floors.
Accommodation	The accommodation comprises:
	Ground Floor: Entrance hallway, living room and WC.
	First Floor: Upper landing, kitchen bedroom and bathroom (with WC).
	Second Floor: Upper landing, master bedroom with en-suite provision and bedroom 3.
Gross internal floor area (m²)	114 square metres or thereby.
Neighbourhood and location	The subjects are located within an established district of Glasgow, where surrounding properties are generally of similar design, use and character. All local amenities and facilities can be found within
	the wider geographical area and are considered to be within a relatively reasonable commuting distance.
Age	Built circa 2007, 14 years approximately (estimated for Home Report purposes).
Weather	It was dry and overcast at the time of our inspection.
Chimney stacks	There are no chimney stacks pertaining to the subjects.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as

	being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is of shallow pitched design and overlaid in an assumed membrane finish or equivalent, (unseen).
	Access into the roof void is by way of a hatch within the ceiling of the hallway. This revealed a timber roof frame structure. It should be appreciated that our inspection within this area was limited to a head and shoulders inspection only and that as a result, no full inspection has taken place therein.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater fittings are of PVC materials. Rainwater goods run internally and hence no full inspection was available.
Main walls	Visually inspected with the aid of binoculars where
	appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The subjects are of a modern method of construction. The external façade comprises of infill sections of glazed 'curtain' walling and brick finishes. The internal walls are dry lined internally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The subjects are accessed by way of a glazed entrance door. There is patio door provision to the rear providing access to the patio area.
	The window openings are of double glazing.
External decorations	Visually inspected.
	Painted and stained finishes to external metalwork and timberwork.
Conservatories / porches	Not applicable.

Communal areas	Circulation areas visually inspected.
	The extent of communal areas pertaining to the subjects and maintenance obligations should be confirmed and clarified by reference to the Title Deeds.
Garages and permanent outbuildings	Not applicable.
Outside areas and boundaries	Visually inspected.
	The extent of outside areas and boundaries pertaining to the subjects and maintenance obligations should be confirmed and clarified by reference to the Title Deeds.
	The subjects have private grounds to front and rear elevations. There is timber decking to the rear grounds of the subjects.
	Our inspection was of a superficial nature and no inspection below the decking was available and hence no comment can be made on the condition of the framework structure.
Ceilings	Visually inspected from floor level.
	The ceilings within the subjects are of plasterboard design.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls within the subjects are of plasterboard finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	The floors are of assumed solid construction to ground levels, overlaid on the date of our inspection. Upper floors are of assumed suspended timber construction.
	At the time of our inspection, the property had fitted floor coverings throughout. Due to the presence of these floor coverings, no sight was possible of the floor structure.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery incorporates timber skirtings and door facings together with internal pass doors of timber construction.
	The kitchen fittings incorporate a range of floor and wall mounted units.

Chimney breasts and fireplaces	Not applicable.
Internal decorations	Visually inspected.
	Internal decorations incorporate paper, paint and tiled finishes.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Electricity is from the mains supply with the electrical switchgear located within the under-stairs cupboard of the living room at ground level. The circuitry incorporates an older style consumer unit distribution system.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Gas is from the mains supply with the meter located externally to the front elevation.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is from the mains supply. Water piping, where visible, is run in copper and PVC.
	Bathroom fittings incorporate a three-piece suite within the bathroom.
	Shower room fittings incorporate a shower cubicle, wash hand basin and WC.
	There is separate WC provision to the layout of the subjects.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Domestic heating and hot water are assumed to be provided by the way of the gas fired boiler, wall mounted unit located in the kitchen apartment.

Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. All foul and surface water drainage is presumed to be to the main public sewer. The system was not tested.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

It is standard practice to recommend that compliant smoke, heat and carbon monoxide (CO) alarms should be commissioned and maintained in accordance with manufacturer's specification.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.

Although considerable care was taken during the course of our inspection to detect defects serious in nature, we were unable to inspect those parts of the property which were covered, concealed or inaccessible. In areas where no inspection was possible, it has been assumed that there are no defects that will have a material effect on the valuation.


As stated in the attached Terms and Conditions, the testing of service installations is out with the scope of this inspection. It is therefore not possible to confirm that all service installations comply with current regulations.

Our inspection of the roof structure was limited due to the sight lines affordable from ground floor level. We cannot therefore comment fully upon its condition.

No inspection below any form of sanitary ware was available and hence we cannot comment upon its condition or otherwise in this

regard.

Sectional Diagram showing elements of a typical house

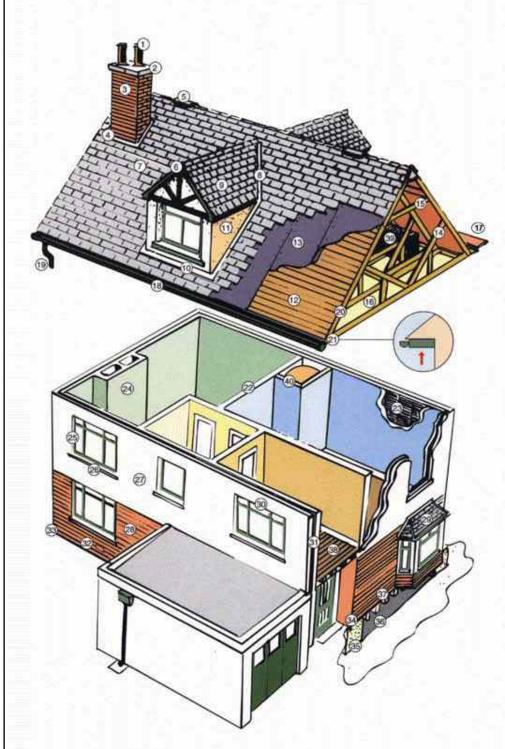

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4 Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7 Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- (11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- S
- 26) Window sills
- (27) Rendering
- 28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 9) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	Within the limitations of our inspection, there was no significant structural movement observed to the subjects.

Dampness, rot and infestation	
Repair category	1
Notes	Within the subjects and within the limitations of our inspection, moisture meter readings revealed no evidence of any significant dampness issues. In addition, from our visual inspection of accessible areas, no significant rot or infestation was also present on the date of our inspection.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	It should be appreciated that shallow pitched roof coverings and finishes do have a limited life span and will require reactive repairs and regular ongoing maintenance to ensure that they remain in a wind and watertight condition.

Rainwater fittings	
Repair category	1
Notes	We would highlight that it was not raining during our inspection and we would recommend that all rainwater conductors be inspected during heavy rainfall in order to ensure that they allow for a free run off of rainwater. The rainwater fittings run internally and as a result, no inspection has taken place and hence we cannot fully comment upon their condition or otherwise.

Main walls	
Repair category	2
Notes	Sections of the curtain wall glazing to the rear elevation show signs of delamination, requiring future remedial works. Although this property has sections of cladding, in accordance with current RICS guidance, an EWS1 is not considered required for the basis of this report, however, future lending criteria may demand its own requirements. The position should be clarified prior to conclusion of a sale.

Windows, external doors and joinery	
Repair category	1
Notes	The windows, external doors and joinery are generally in satisfactory condition having regard to age and type. Double glazing, can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. In addition, seals to double glazed units are prone to unexpected failure. It is therefore likely that maintenance repairs will be required as part of an on- going maintenance programme.

External decorations	
Repair category	1
Notes	In general terms, the external decoration of the subjects was seen to be in a satisfactory state of repair, however, we did note some localised sections that are weathered and a programme of redecoration will be required in due course.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	1
Notes	The extent of communal boundaries pertaining to the subjects and maintenance obligations should be confirmed and clarified by reference to the Title Deeds.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	1
Notes	The exact extent of outside areas and boundaries pertaining to the subject property and maintenance obligations should be confirmed and clarified by reference to the Title Deeds.
	Outside areas were seen to be in a satisfactory state of repair. Boundaries will require on-going maintenance and repair, given their nature and function.
	It should be appreciated that given its timber nature, ongoing maintenance will be required to the timber decking and that additionally only a superficial inspection has taken place and as a result no comment can be made upon the sub-structure elements.

Ceilings	
Repair category	1
Notes	The ceiling finishes were seen generally to be in satisfactory condition having regard to age and type, however, general plaster repairs can be anticipated during the course of future redecoration.

Internal walls	
Repair category	1
Notes	The internal wall finishes were seen generally to be in satisfactory condition having regard to age and type, however, general plaster repairs can be anticipated during the course of future redecoration.

Floors including sub-floors	
Repair category	1
Notes	The floor finishes were seen generally to be in satisfactory condition having regard to age and type, however, localised section of loose flooring were noted

Internal joinery and kitchen fittings	

Internal joinery and kitchen fittings	
Repair category	1
Notes	Internal joinery and kitchen fittings show signs of wear and tear consistent with age.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes	The subjects have been decorated to a neutral standard. Some modifications may be required to suit personal tastes.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electrical installation, where visible, appears to be of semi-modern design. The system, however, was not tested as per the scope of our inspection and a copy of a recent electrical testing certificate would require to be exhibited to ensure that the system is fully compliant with current regulations. Any recommendation made regarding the installation should be undertaken.

Gas	
Repair category	1
Notes	Our valuation assumes that the gas installation and appliances within the subjects comply with current Gas Safe standards.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	Plumbing and sanitary fittings were seen from a visual inspection to be in serviceable condition.
	A plumbing contractor can advise on the plumbing system, where required.

Heating and hot water	
Repair category	2
Notes	The central heating system within the subjects is of semi-modern design and as a result will not be as efficient as its more modern equivalent. Confirmation should, however, be obtained that the system has been recently serviced by a Gas Safe registered engineer to manufacturer's specification. Documentary evidence of recent servicing ideally should be exhibited.

Drainage	
Repair category	1
Notes Within the limitations of our inspection, no major defects were evident likely to have a material effect on the market value.	

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	GF/FF/2F
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Confirmation should be sought in respect of common areas and factoring requirements pertaining to the subjects.

In the course of the conveyancing process it is standard practice to obtain a Property Enquiry Certificate. As it stands, we are unaware of any adverse issues affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate and in the event of any issues arising then these brought to our attention for consideration.

It is assumed that there are no communal, statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

Although this property has sections of cladding, in accordance with current RICS guidance, an EWS1 is not considered required for the basis of this report, however, future lending criteria may demand its own requirements. The position should be clarified prior to conclusion of a sale.

Assumed Absolute Ownership.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes it is recommended that the subjects be insured for a sum of not less than £240,000 (TWO HUNDRED AND FORTY THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters and in taking account of general observations on site, we are of the opinion that the current market value of the subjects in their present condition and with the benefit of full vacant possession may be fairly stated in the capital sum of £235,000 (TWO HUNDRED AND THIRTY-FIVE THOUSAND POUNDS STERLING).

PLEASE NOTE: The Valuer's address shown in this report is the Head Office, administration centre only. The Valuer is locally based within Glasgow & the west. DIXON HEANEY KEAN KENNEDY (DHKK LTD) are members of First Surveyors Scotland.

The outbreak of COVID-19, declared by the World Health Organisation as a Global Pandemic on the 11th March 2020, has and continues to impact many aspects of daily life and the global economy, with some real estate markets having experienced lower levels of transactional activity and liquidity. Travel restrictions have been implemented by many countries and lockdowns applied to varying degrees. Whilst restrictions have now been lifted in some cases, local lockdowns may continue to be deployed as necessary and the emergence of significant further outbreaks are possible.

The pandemic and the measures taken to tackle COVID-19 continue to affect economies and real estate markets globally. Nevertheless, as at the valuation date some property markets have started to function again, with transaction volumes and other relevant evidence returning to levels where an adequate quantum of market evidence exists upon which to base opinions of value. Accordingly, and for the avoidance of doubt, our valuation is not reported as being subject to material valuation uncertainty as defined by VPS 3 and VPGA 10 of the RICS Valuation, Global Standards.

For the avoidance of doubt this explanatory note has been included to ensure transparency and to provide further insight as to the market context under which the valuation opinion was prepared. In recognition of the potential for market conditions to move rapidly in response to changes in the control or future spread of COVID-19 we

highlight the importance of the valuation date.	
Signed	Security Print Code [677756 = 1653] Electronically signed
Report author	Charlie Gilmour
Company name	DHKK Chartered Surveyors
Address	54 Corstorphine Road, Edinburgh, EH12 6JQ
Date of report	27th May 2021



Property Address	
Address Seller's Name Date of Inspection	70 SHUNA CRESCENT, GLASGOW, G20 9QS Mr & Mrs Vandertoorn 26th May 2021
Property Details	
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block □ Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes only Approximate Year of 0	No. of units in block
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 1 WC(s) - Other (Specify in General remarks)
	cluding garages and outbuildings) 114 m² (Internal) - m² (External) greater than 40%) X Yes No
Garage / Parking / 0	Outbuildings
Single garage Available on site?	□ Double garage X Parking space □ No garage / garage space / parking space X Yes □ No
Permanent outbuilding	gs:
There are no permai	nent outbuildings pertaining to the subjects.

Construction								
Walls	Brick	Stone	Con	crete	Timber frame	X Othe	er (specify in Ger	neral Remarks)
Roof	Tile	Slate	Aspl	halt	Felt	X Othe	er (specify in Ger	neral Remarks)
Special Risks								
Has the property	suffered struc	tural movem	ent?				Yes	X No
If Yes, is this rece	nt or progres	sive?					Yes	No
Is there evidence, immediate vicinity	•	ason to antic	cipate subsid	dence, h	eave, landslip (or flood in th	e Yes	X No
If Yes to any of the	e above, prov	vide details ir	General Re	emarks.				
Service Connec	tions							
Based on visual ir of the supply in G			vices appear	to be no	on-mains, pleas	se comment	on the type a	and location
Drainage	X Mains	Private	None		Water	X Mains	Private	None
Electricity	X Mains	Private	None		Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None					
Brief description of	of Central Hea	ating:						
Gas fired boiler t	o radiators.							
Site								
Apparent legal iss	ues to be ver	ified by the o	conveyancer	. Please	e provide a brie	f description	n in General R	temarks.
Rights of way		es / access			enities on separate	·	ared service conr	
Ill-defined boundar	ies	Agricu	Iltural land inclu	ided with p	property	Oth	ner (specify in Ge	neral Remarks)
Location								
X Residential suburb	Re	sidential within t	town / city	Mixed re	esidential / comme	rcial Ma	inly commercial	
Commuter village	Re	mote village		solated	rural property	Oth	ner (specify in Ge	neral Remarks)
Planning Issues	5							
Has the property If Yes provide det			d / altered?	Yes	X No			
Roads								
X Made up road	Unmade roa	d Partl	y completed ne	w road	Pedestrian a	access only	Adopted	Unadopted

General Remarks

The subjects comprise of a mid-terraced house set over 3 floors and are located within an established district of Glasgow, where surrounding properties are generally of similar design, use and character. All local amenities and facilities can be found within the wider geographical area and are considered to be within a relatively reasonable commuting distance.

The roof is of shallow pitched design and overlaid in an assumed membrane finish or equivalent, (unseen). The subjects are of a modern method of construction. The external façade comprises of infill sections of glazed 'curtain' walling and brick finishes. The internal walls are dry lined internally.

Confirmation should be sought in respect of common areas and factoring requirements pertaining to the subjects.

It is assumed that there are no communal, statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The external fabric was seen to be in a fair state of repair and given the age and nature of the structure on-going maintenance and repair works should be anticipated paying particular attention to roof coverings, rainwater conductor goods, and external brickwork/cladding elements.

The internal fabric was seen to be in an average condition in regard to age and character. A number of items were noted as requiring repair however these should be capable of remedy during the course of routine care and maintenance.

Essential Repairs			
None apparent.			
Estimated cost of essential repairs £	Retention recommended? Yes	No	Amount £

Comment on Mortgageability

The subjects form suitable security for release of a mortgage advance based on our inspection.

PLEASE NOTE: The Valuer's address shown in this report is the Head Office, administration centre only. The Valuer is locally based within Glasgow & the west. DIXON HEANEY KEAN KENNEDY (DHKK LTD) are members of First Surveyors Scotland.

The outbreak of COVID-19, declared by the World Health Organisation as a Global Pandemic on the 11th March 2020, has and continues to impact many aspects of daily life and the global economy, with some real estate markets having experienced lower levels of transactional activity and liquidity. Travel restrictions have been implemented by many countries and lockdowns applied to varying degrees. Whilst restrictions have now been lifted in some cases, local lockdowns may continue to be deployed as necessary and the emergence of significant further outbreaks are possible.

The pandemic and the measures taken to tackle COVID-19 continue to affect economies and real estate markets globally. Nevertheless, as at the valuation date some property markets have started to function again, with transaction volumes and other relevant evidence returning to levels where an adequate quantum of market evidence exists upon which to base opinions of value. Accordingly, and for the avoidance of doubt, our valuation is not reported as being subject to material valuation uncertainty as defined by VPS 3 and VPGA 10 of the RICS Valuation, Global Standards.

For the avoidance of doubt this explanatory note has been included to ensure transparency and to provide further insight as to the market context under which the valuation opinion was prepared. In recognition of the potential for market conditions to move rapidly in response to changes in the control or future spread of COVID-19 we highlight the importance of the valuation date.

Valuations	
Market value in present condition	£ 235,000
Market value on completion of essential repairs	£ -
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 240,000
Is a reinspection necessary?	Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£
Is the property in an area where there is a steady demand for rented accommodation of this type?	Yes No
Declaration	

Signed Security Print Code [677756 = 1653]

Electronically signed by:-

Surveyor's name Charlie Gilmour

Professional qualifications MRICS

Company name DHKK Chartered Surveyors

Address 54 Corstorphine Road, Edinburgh, EH12 6JQ

Telephone 0141 648 2555

Fax

Report date 27th May 2021

Energy Performance Certificate (EPC)

Dwellings

Scotland

70 SHUNA CRESCENT, GLASGOW, G20 9QS

Dwelling type:Mid-terrace houseDate of assessment:26 May 2021Date of certificate:27 May 2021Total floor area:114 m²

Primary Energy Indicator: 149 kWh/m²/year

Reference number: 0819-0525-3000-0416-3222 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,112	See your recommendations
Over 3 years you could save*	£150	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

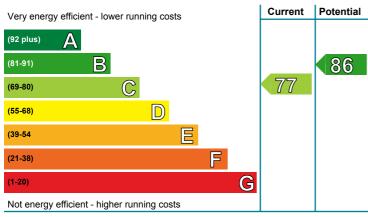


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (77)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

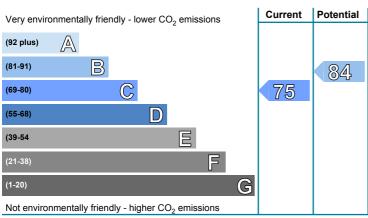

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (75)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Low energy lighting	£15	£60.00
2 Solar water heating	£4,000 - £6,000	£90.00
3 Solar photovoltaic (PV) panels	£3,500 - £5,500	£927.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, insulated (assumed)	****	★★★★☆
Roof	Flat, insulated (assumed)	***	★★★★ ☆
Floor	Solid, insulated (assumed) To external air, insulated (assumed)	_ _	_ _
Windows	Fully double glazed	***	****
Main heating	Boiler and radiators, mains gas	***	****
Main heating controls	Programmer, room thermostat and TRVs	***	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	****
Lighting	Low energy lighting in 75% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 26 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,467 over 3 years	£1,473 over 3 years	
Hot water	£312 over 3 years	£222 over 3 years	You could
Lighting	£333 over 3 years	£267 over 3 years	save £150
Total	£2,112	£1,962	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement		
		indicative cost	per year	Energy	Environment	
1	Low energy lighting for all fixed outlets	£15	£20	C 77	C 75	
2	Solar water heating	£4,000 - £6,000	£30	C 78	C 77	
3	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£309	B 86	B 84	

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

2 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation	
Space heating (kWh per year)	8,443	N/A	N/A	N/A	
Water heating (kWh per year)	2,279				

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Charles Gilmour Assessor membership number: EES/019377

Company name/trading name: DHKK Limited

Address: 54 Corstorphine Road

Edinburgh EH12 6JQ

Phone number: 0131 313 0444
Email address: survey@dhkk.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Property Address	70 Shuna Crescent, Glasgow, G20 9QS
Seller(s)	Doctor G T Van Der Toorn and Kelly-ann van der Toorn
Completion date of Property Questionnaire	28-05-2021

Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of Ownership						
	How long have you owned	the property?	14 years				
2.	Council Tax						
	Which Council Tax band is	your property in?)				
	□A □B □	C 🛛 D	ΠE	□F	□G		
3.	Parking						
	What are the arrangements	for parking at yo	our property	?			
	(Please tick all that apply)						
	Garage						
	Allocated parking space	\boxtimes					
	Driveway						
	On street						
	Resident Permit						
	Metered parking						
	Shared parking						
	Other (please specify)						

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/Additions/Extensions	
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)? If you have answered yes, please describe below the changes which you have made:	No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.	N/A
b.	Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	N/A
	(ii) Did this work involve any changes to the window or door openings?	N/A
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	

7.	Central heating	
	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes
	If you have answered yes or partial – what kind of central heating is there?	
	(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?	
	When built	
	(ii) Do you have a maintenance contract for the central heating system?	No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	No	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
	N/A	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate, which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	N/A

b.	Are you aware of the existence of asbestos in your property?			No	
	If you have answered yes, please give				
4.0	_				
10.	Services				
a.	Please tick which services are connecte supplier:	ed to your prope	erty and give details of the		
	Services	Connected	Supplier		
	Gas or liquid petroleum gas	\boxtimes			
	Water mains or private water supply	\boxtimes			
	Electricity	\boxtimes			
	Mains drainage	\boxtimes			
	Telephone	\boxtimes			
	Cable TV or satellite				
	Broadband	\boxtimes			
b.	Is there a septic tank system at your	property?		No	
	If you have answered yes, please answ	er the two ques	tions below:		
	(i) Do you have appropriate consents fo	N/A			
	(ii) Do you have a maintenance contrac	N/A			
	If you have answered yes, please give of have a maintenance contract:				

1,000		
11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: Factor manages common areas	Yes
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	No
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	No

f.	As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)? If you have answered yes, please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: Queens Cross Factoring Limited (Glasgow) Suite 12, Firhill Business Centre 74-76 Firhill Road G20 7BA	Yes
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	No Please select
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. Factor costs are approximately GBP 280 per year	

13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	No
b.	As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property? If you have answered yes, please give details:	No
c.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	N/A

14.	Guarante	ees	
a.	Are there any guarantees or warranties for any of the following:		
	(i)	Electrical work	No
	(ii)	Roofing	No
	(iii)	Central heating	No
	(iv)	National House Building Council (NHBC)	No
	(v)	Damp course	No
	(vi)	Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)	No
b.		ve answered yes or 'with title deeds', please give details of the work or ins to which the guarantee(s) relate(s):	
c.		any outstanding claims under any of the guarantees listed above? ve answered yes, please give details:	No
15.	Boundar	ies	
	last 10 ye	you are aware, has any boundary of your property been moved in the ears? ve answered yes, please give details:	No

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or	other authorised	body or	person(s	S)
---------------------------------	------------------	---------	----------	----

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
Date:	28 May 2021		