
WiredScore Report

Ealing Gateway

26-30 Uxbridge Road London, W5 2AU



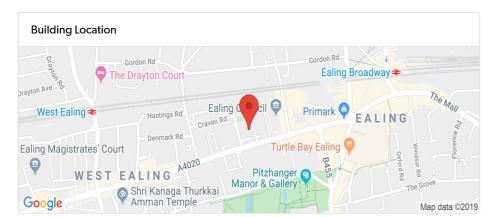

Building Profile

Address: 26-30 Uxbridge Road, London, W5 2AU

Rentable Sqft(k): 84

| Section | Audit Reported Points |
|---------------------------|-----------------------|
| Building Connectivity | 27 / 45 |
| Building Infrastructure | 34 / 41 |
| Readiness | 0/14 |
| Total | 61 / 100 |
| Wired Certification Level | Certified |

Auditor Notes

Ealing Gateway is centrally located on Uxbridge Road in the heart of Ealing.

From a connectivity perspective, the building has two fibre providers who are present and available to service tenants.

Virgin can offer tenants dedicated, super-fast internet access upon request whilst BT Openreach has blown fibre into the building, allowing occupiers to procure high speed internet services through over 500 different service providers.

From an infrastructure perspective, the building has two diverse intake locations with available capacity to accommodate future communication cabling installations.

The building has two secure and diverse riser spaces which penetrate from the ground floor to the top floor.

The building also offers secure and dedicated space for service providers to terminate their equipment at ground floor level.

Score Report

| | Final Score | |
|---------------------------|-------------|--|
| Wired Certification Score | 61 / 100 | |
| Wired Certification Level | Certified | |

| Opportunities for Improvement | Points | |
|--|---|--|
| Building Connectivity | | |
| Bring in a fixed wireless provider to create an alternate form of connectivity into the building from internet service providers entering from street level. | +5pts | |
| Install additional fibre or fixed wireless providers to improve the number of internet service options for tenants within the building. | +4pts for 1 additional +7pts for 2 additional +10pts for 3 additional | |
| Extend distribution of fibre connectivity to all floors of the building. | +3pts | |
| Building Infrastructure | | |
| Provide free WiFi in common areas. | +2pts | |
| Install a universal comms chamber to allow carrier to easily access the building without needing extensive construction. | +1pt | |
| Create a secure area for the placement and protection of ISP termination equipment. | +2pts for dedicated telco room | |
| Provide direct connections to backup electricity for telco equipment to ensure that a commercial power failure will not affect the building. | +2pts | |
| Readiness | | |
| Locate wayleave agreements for all carriers in the building. | +3pts for some agreements +5pts for all agreements | |
| Create a standard wayleave agreement to streamline the legal process of obtaining service in the building. | +8pts | |
| Locate routes from existing carriers. Buildings can also create a set of standard telco schematics to reduce the amount of time it takes for tenants to receive service in the building by having pre-agreed cable routes. | +1pt | |
| Total Points | 39 | |

Building Connectivity

Auditor Notes

BT Openreach has copper services entering the building via intake 1 which are terminated within Riser 1 at ground floor level. This allows occupiers to procure phone lines and asymmetrical internet services through over 500 different service providers.

BT Openreach also has blown fibre entering the building via intake 1 which is terminated within Riser 1 at ground floor level. This allows occupiers to procure high speed internet services through over 500 different service providers.

Virgin has a direct fibre connection entering the building via intake 1 and can service customers directly from the breakout location within Riser 1 at ground floor level.

Additional note:

Vodafone (Cable & Wireless) fibre cabling was found to enter the building via Intake 1 and was also located within Riser 1. However, no internal termination equipment was located within a landlord area during the survey. As a result, it was not possible to confirm that this provider can service multiple tenants of the building.

| Name of Carrier | Transmission Medium | Intake Locations | Location of Telco Equip in Building | Riser Present In | Full Distribution | Wayleave Agreement Present |
|-----------------|-------------------------|------------------|--|------------------|-------------------|----------------------------------|
| BT Openreach | Copper Pairs (ADSL) | Intake 1 | Riser 1 (ground floor) | Riser 1 | No | No |
| BT Openreach | Direct fibre connection | Intake 1 | Riser 1 (ground floor) | Riser 1 | No | No |
| Virgin | Direct fibre connection | Intake 1 | Riser 1 (ground floor) | Riser 1 | No | No |

| # | Question | Points |
|----|--|--------|
| 1. | Type of cabling that currently exists for the building: Copper, Coax, FTTC, or FTTP | 3/3 |
| 2. | Type of cabling that currently exists for the building: Fixed Wireless | 0/5 |
| 3. | Type of cabling that currently exists for the building: BT Openreach Fibre | 11/11 |
| 4. | Carrier has direct fibre connection or Carrier has existing equipment present to deliver service over Openreach | 9/9 |
| 5. | Number of existing fibre or fixed wireless internet providers available that have a physical presence in the building. | 4/14 |
| 6. | If the building has fibre, is the fibre fully distributed for occupiers to easily connect to? | 0/3 |

Building Infrastructure

1) Is WiFi present in the lobby for tenants and guests alike?

Audit Reported: No Points: 0 / 2

Question Description:

Does building management, tenant, or retail offer free internet in the lobby and common spaces of the building?

Auditor Notes

Ealing Gateway does not provide free WiFi in the common areas.

2) Building has a universal communications chamber for easy connections to street infrastructure?

Audit Reported: No Points: 0 / 1

Question Description:

Universal communications chambers are underground spaces located near the property line (often under the pavement) that contain conduits from the manhole and transition them to conduits that enter the building. Universal chambers allow for faster installations to tenants in the building since they remove the need to construct new connections to the grid every time a cable is needed.

Auditor Notes

The building is not serviced via universal communication chambers.

3) Building has multiple communications intakes - Points of Entry (POEs)?

Audit Reported: Yes Points: 8 / 8

Question Description:

Multiple POEs means that there are telecom cable entry points into the building from different locations or sides of the building; this creates a physical separation so that if the connectivity on one side of the building is disrupted (construction, fire, flooding, etc.], connectivity from the other side can still be functional. Conduit supporting cables must

be separated by at least 7m to support true diversity of connection. In order to be considered a "conduit location," access to the building must come through a below-ground conduit vs. a non-protected or exposed cable that is draped around the building.

Auditor Notes

The building has two communication intake locations which are separated by more than 7m: Intake 1 & Intake 2.

Intake 1 enters the building at ground floor level into Riser 1 on the east side. It is expected that providers would utilise this intake via a duct route from Uxbridge Road.

Intake 2 enters the building at ground floor level into Riser 2 on the west side from Craven Road.

4) Communication Intakes (POEs) have capacity for additional wireline providers to place cables?

Audit Reported: Yes Points: 4 / 4

Question Description:

There is at least 60% open space in at least one 100mm standard conduit.

Auditor Notes

There is ample available capacity to accommodate future communication cabling installations within the ducts at Intake 1 & Intake 2.

Additional note:

Although available capacity could be proven at Intake 1 via one spare duct, it was not possible to confirm duct quantity at Intake 1 as they are concealed underneath congested cabling routes.

5) The building has comms areas present for ISP termination equipment and locates them in a:

Audit Reported: Shared utility closet or room Points: 2 / 4

Question Description:

Telecom equipment within a building can be easily damaged or cut, creating risk of service interruption. Thus, where this equipment is located and how it is secured is an important factor affecting service. Options:

- No communal room for ISP termination equipment.
- Hallway or open space: ISP equipment is located in an open work area.
- Shared utility closet or room: ISP equipment is shared with other utilities i.e. Water/Electricity.
- Dedicated telco room under lock and key: a separate, designated, protected space for ISPs to place equipment.
- Answers should be selected based on the lowest threshold observed (e.g. if even one carrier has equipment in a hallway in an open environment, this answer should be selected)

Auditor Notes

There is BT Openreach copper, BT Openreach fibre and Virgin fibre equipment terminated within Riser 1 at ground floor level. This is a secure but shared utility location as the riser is shared with air conditioning pipework and ducting as well as other building systems.

As individuals who are not specialised in communication services and equipment will have access to any shared utility spaces, service provider's fibre equipment is not sufficiently protected from potential damage or data theft.

6) Is there spare capacity to install new telecommunications equipment in the telco room/comms intake room?

Audit Reported: Yes Points: 3 / 3

Question Description:

Space for additional equipment suggests that a new carrier could easily come into the building and provide service to tenants without major infrastructure work needed to create space for equipment. Ensure there is space in a secure room for at least 1 post rack (1mx1m) or 1 wall mount backboard (1mx1m) depending on the size of the building and its requirements.

Auditor Notes

There is wall space available to accommodate future communication equipment installations within Riser 2 at ground floor level.

Future communication equipment installations should take place within a secure and dedicated space for service providers to terminate their equipment to ensure it is sufficiently protected from potential damage or data theft.

7) Building provides option of direct connections to backup electricity for telco equipment present?

Audit Reported: No Points: 0 / 2

Question Description:

Does the building provide the option of direct connections to the building's backup electricity for telco equipment present?

Auditor Notes

There is no confirmed back-up power available for communication services within the building.

8) Building has riser space that goes from the basement to the top floor in a closed, protected environment?

Audit Reported: Yes Points: 4 / 4

Question Description:

This question evaluates the state of riser pathways that support the existing telecom cabling. To answer Yes, the following two requirments should be satisfied: 1) There is dedicated riser space that runs vertically from the basement to the rooftop, and 2) The vertical riser is protected in a secure environment so that the cables cannot be easily accessed or damaged.

Auditor Notes

The building has two communication riser locations which are secure and penetrate from the ground floor to the top floor: Riser 1 & Riser 2.

9) Building riser cupboards have room for additional cabling?

| Audit Reported: Yes | Points: 3 / 3 |
|---------------------|----------------------|
| | |

Question Description:

This question evaluates the capacity of the existing riser pathways to support any new telecom cabling to be added to the building. Easily supporting the addition of any new ISPs means that the building has space in the risers (there is at least 40% spare tray capacity) to provide access for new providers to the building without significant infrastructure upgrades.

Auditor Notes

There is available capacity within the Riser 2 pathway to accommodate future communication cabling installations.

There is minimal available capacity within the Riser 1 pathway to accommodate future communication cabling installations as the pathway is congested with cabling.

10) Is there capacity for horizontal run from the riser space to tenant telecom closet?

Audit Reported: Yes Points: 4 / 4

Question Description:

Needs to have one of the following:

- 1. Conduits or trunking from riser to tenant
- 2. Dropped ceiling space from riser to tenant
- 3. Raised floors from riser to occupier

Auditor Notes

Horizontal cabling from the risers can be installed within the raised floor or suspended ceiling void available on each floor.

11) Building has two or more diverse riser cupboard locations?

| Audit Reported: Yes | Points: 4 / 4 |
|---------------------|---------------|
|---------------------|---------------|

Question Description:

Risers are vertical shaft ways that house telecom cabling and provide access from the equipment in the basement to all floors. Two or more diverse riser locations (separated by at least 7m) creates route diversity for one or more carriers, and helps to protect against outages if there are damages to one conduit or riser. This improves the resiliency of connectivity for tenants to keep their systems up and running.

Auditor Notes

The building has two communication riser locations which are separated by more than 7m: Riser 1 & Riser 2.

12) If yes to the previous question, are the risers serviceable through two separate pathways?

Audit Reported: Yes Points: 2 / 2

Question Description:

Risers are serviced by diverse routes, meaning they can be serviceable from providers in the basement through at least 2 pathways in case of disruption at one.

Auditor Notes

It is possible to create diverse routes to the risers from the intake locations.

Readiness

1) Building has signed Wayleave Agreements in place with carriers?

Audit Reported: No Agreements on File Points: 0 / 5

Question Description:

Signed Wayleave Agreements documents (also called "Right of Entry" or "Right of Way" contracts) indicate that an agreement is in place between the Landlord and the Internet Service Provider that owns cables and equipment in the building. The agreements limit the potential for future conflicts or challenges between landlord and carrier that may threaten the ability of tenants to maintain their current or future internet connectivity. The carrier's relationship to the building should be transparent to the tenant.

Auditor Notes

There are no signed wayleave agreements held on file for:

BT Openreach

Virgin

2) Does building management have a standard wayleave on file to expedite service to new tenants?

Audit Reported: No Points: 0 / 8

Question Description:

Standard Wayleave agreements for telecommunications (also known as Telecom Policies and Procedures) describe the landlord's rules for installing, maintaining, and removing telecom equipment. Existence of these pro-actively developed terms & conditions help ensure there is a streamlined process in place to allow new providers to supply service to the building. Standard Wayleave should include:

- 1. A description of the telecoms 'permitted apparatus', including wires and ducts.
- 2. Terms dealing with the supply in advance of drawings and specifications of the telecoms/apparatus installation.
- 3. Details of the obligations of all parties regarding avoidance of nuisance, installation, maintenance, improvement, alteration and removal of the apparatus.
- 4. Arrangements for alterations of the apparatus.
- 5. Provisions regarding assignment and termination.

Question may be adjusted to incorporate an official standard wayleave agreement requirement

Auditor Notes

The building does not have a Standard Wayleave Agreement on file. Having this agreement in place will streamline the installation process for new providers.

3) Schematics for telco routes are on file?

Audit Reported: No Points: 0 / 1

Question Description:

Are there schematics or drawings in place that can be used in conjunction with Wayleaves to streamline the installations process? Plans should outline telecommunication spaces and possible cable routes.

Auditor Notes

There are no schematics held on file. Having installation drawings and method statements held on file will help streamline the installation of new cabling within the building.

Additional Questions

| 1) In the wayleave agreement terms, who bears the cost of wayleave negotiations? | Occupier |
|--|----------|
| Auditor Notes | |
| The occupier is responsible for the cost of any wayleave negotiations. | |
| 2) In the wayleave agreement terms, does the building charge the carriers rent? | No |
| Auditor Notes | |
| There are no rental charges to carriers within the building. | |
| 3) Does the building have space on the roof for the placement of fixed wireless, cellular, or satellite equipment? | Yes |
| Auditor Notes | |
| There is space on the building's roof for the placement of devices. | |
| 4) Does building management allow placement of devices on roof? | Yes |
| Auditor Notes | |
| Occupiers can place devices on the roof with consent of the landlord. | |
| 5) Does the building have diverse power entry into the building? | No |
| Auditor Notes | |
| The building does not have confirmed diverse power feeds. | |
| 6) If Wifi is present in common spaces, is it provided by an internal business or through building management (either directly or through a managed service provider)? | No |
| | |
| Auditor Notes The building does not provide free WiFi within the common areas. | |
| 7) Is there a Distributed Antenna System (DAS) in place for mobile phone service? | No |
| Auditor Notes | |
| There is no DAS in place. | |

| 8) Is there carrier mobile phone equipment in place for mobile phone service throughout the building? | No |
|---|-----|
| Auditor Notes | |
| The building has no cellular boosting equipment. | |
| | |
| 9) Is telecommunications equipment in your building located above grade (to prevent possible damages from flooding)? | Yes |
| Auditor Notes | |
| Service provider equipment is terminated at ground floor level. | |
| | |
| 10) Have you or your service providers implemented any Green / Sustainability measures for reducing the environmental impact of the connected building provisions at this location? | No |
| Auditor Notes | |
| There have been no green / sustainability measures put in place. | |
| | |
| 11) Does your building have a Building Management System (BMS) to control and monitor the building's mechanical and electrical equipment? | Yes |
| Auditor Notes | |
| There is a BMS in place. | |
| | |
| 12) What is the external wall material (e.g. Brick, Stone, Glass, etc) | |